Bay State Gas - Select Reports

File Create View Search Process Reports Security Admin Degree-Days Menu Help

Report Title
Print Distribution Work Orders
Backlog / Completion Report
Work Order List
Pipe Condition Report
All Purpose Work Order List
Cost by Work Order Status
Special Project Cost Report
D.O.T. Leak Report
D.O.T. Retirements Report
D.O.T. Additions Report
D.O.T. Leak Repairs Report
Work Orders Initiated by CCS
WPM Completed Units
WPM Completed Units Detail
Backlog by District
GL Balancing Report
GL Balancing by Source Code

- (•) Distribution
- ( ) Service/Meter
- ( ) Productivity
- ( ) Surveys

Start Sna... CIS... Bay... \\S... Sca... Desktop My Doc 11:10 AM

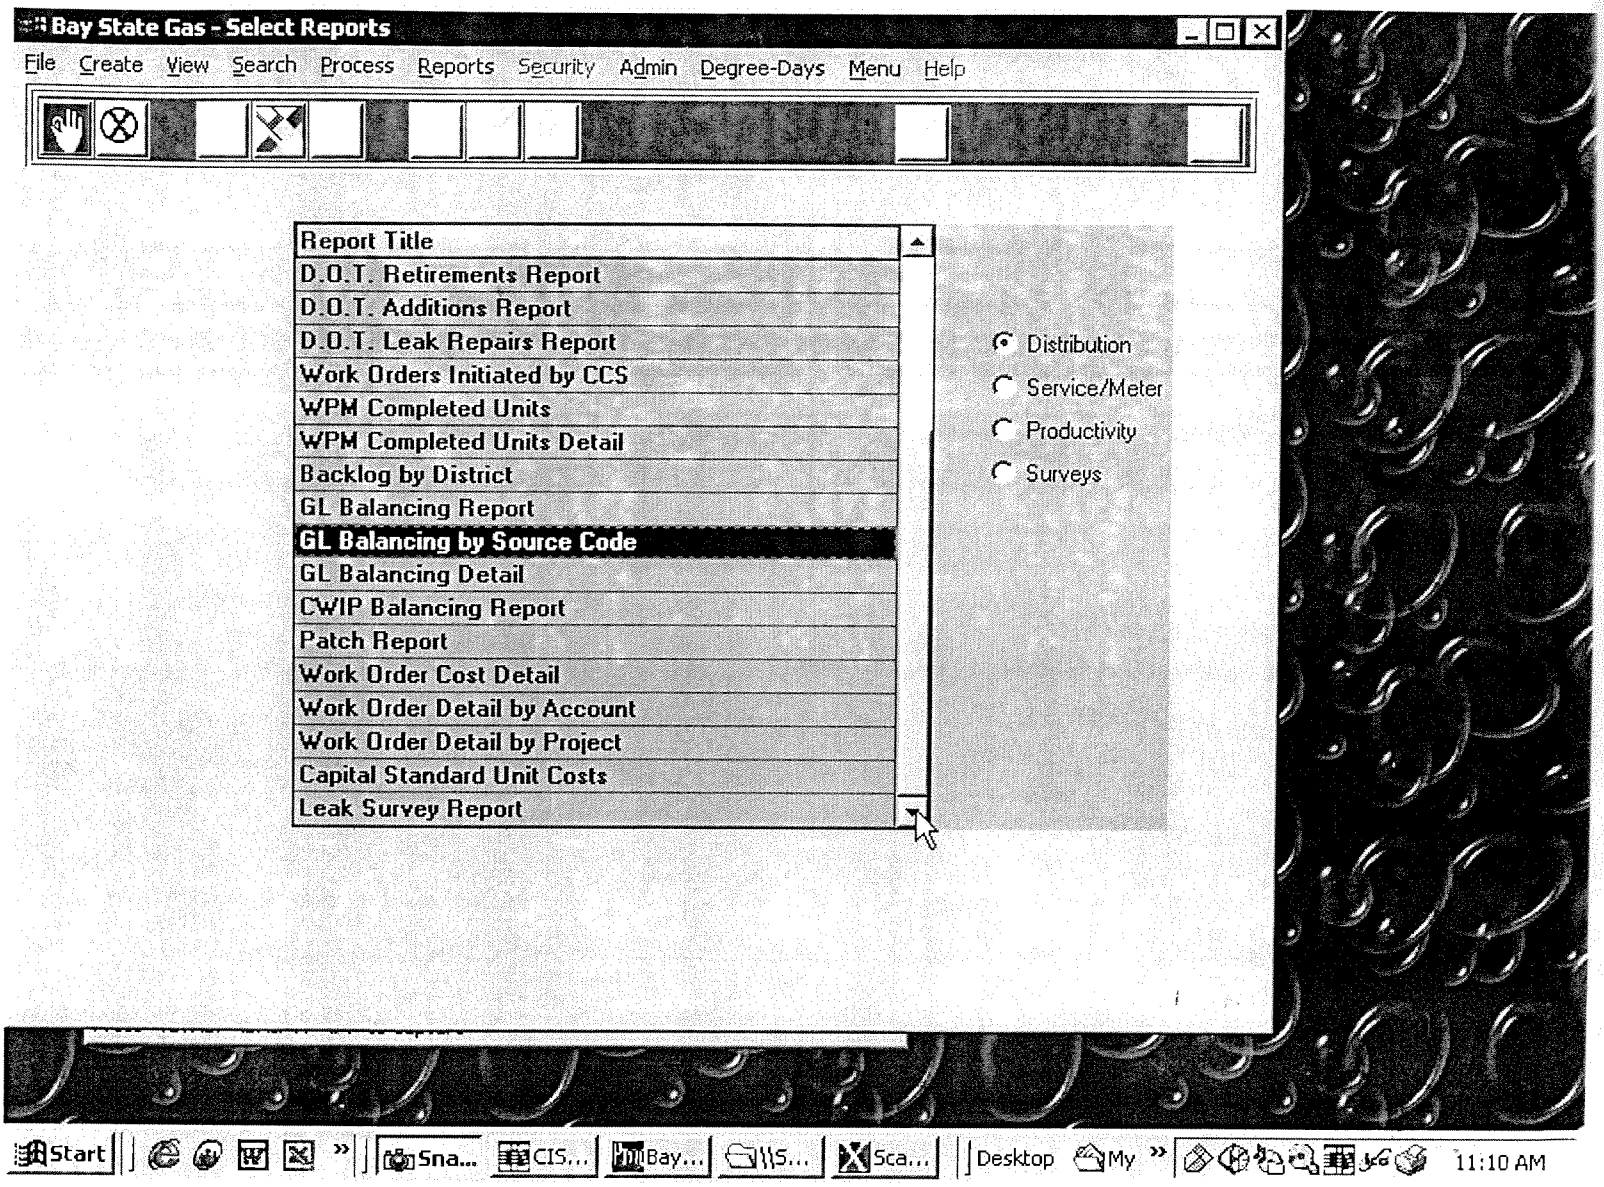
Bay State Gas - Select Reports
File Create View Search Process Reports Security Admin Degree-Days Menu Help
Report Title
D.O.T. Retirements Report
D.O.T. Additions Report
D.O.T. Leak Repairs Report
Work Orders Initiated by CCS
WPM Completed Units
WPM Completed Units Detail
Backlog by District
GL Balancing Report
GL Balancing by Source Code
GL Balancing Detail
CWIP Balancing Report
Patch Report
Work Order Cost Detail
Work Order Detail by Account
Work Order Detail by Project
Capital Standard Unit Costs
Leak Survey Report
Distribution
Service/Meter
Productivity
Surveys
Start
Sna...
CIS...
Bay...
\\S...
Sca...
Desktop
My
11:10 AM

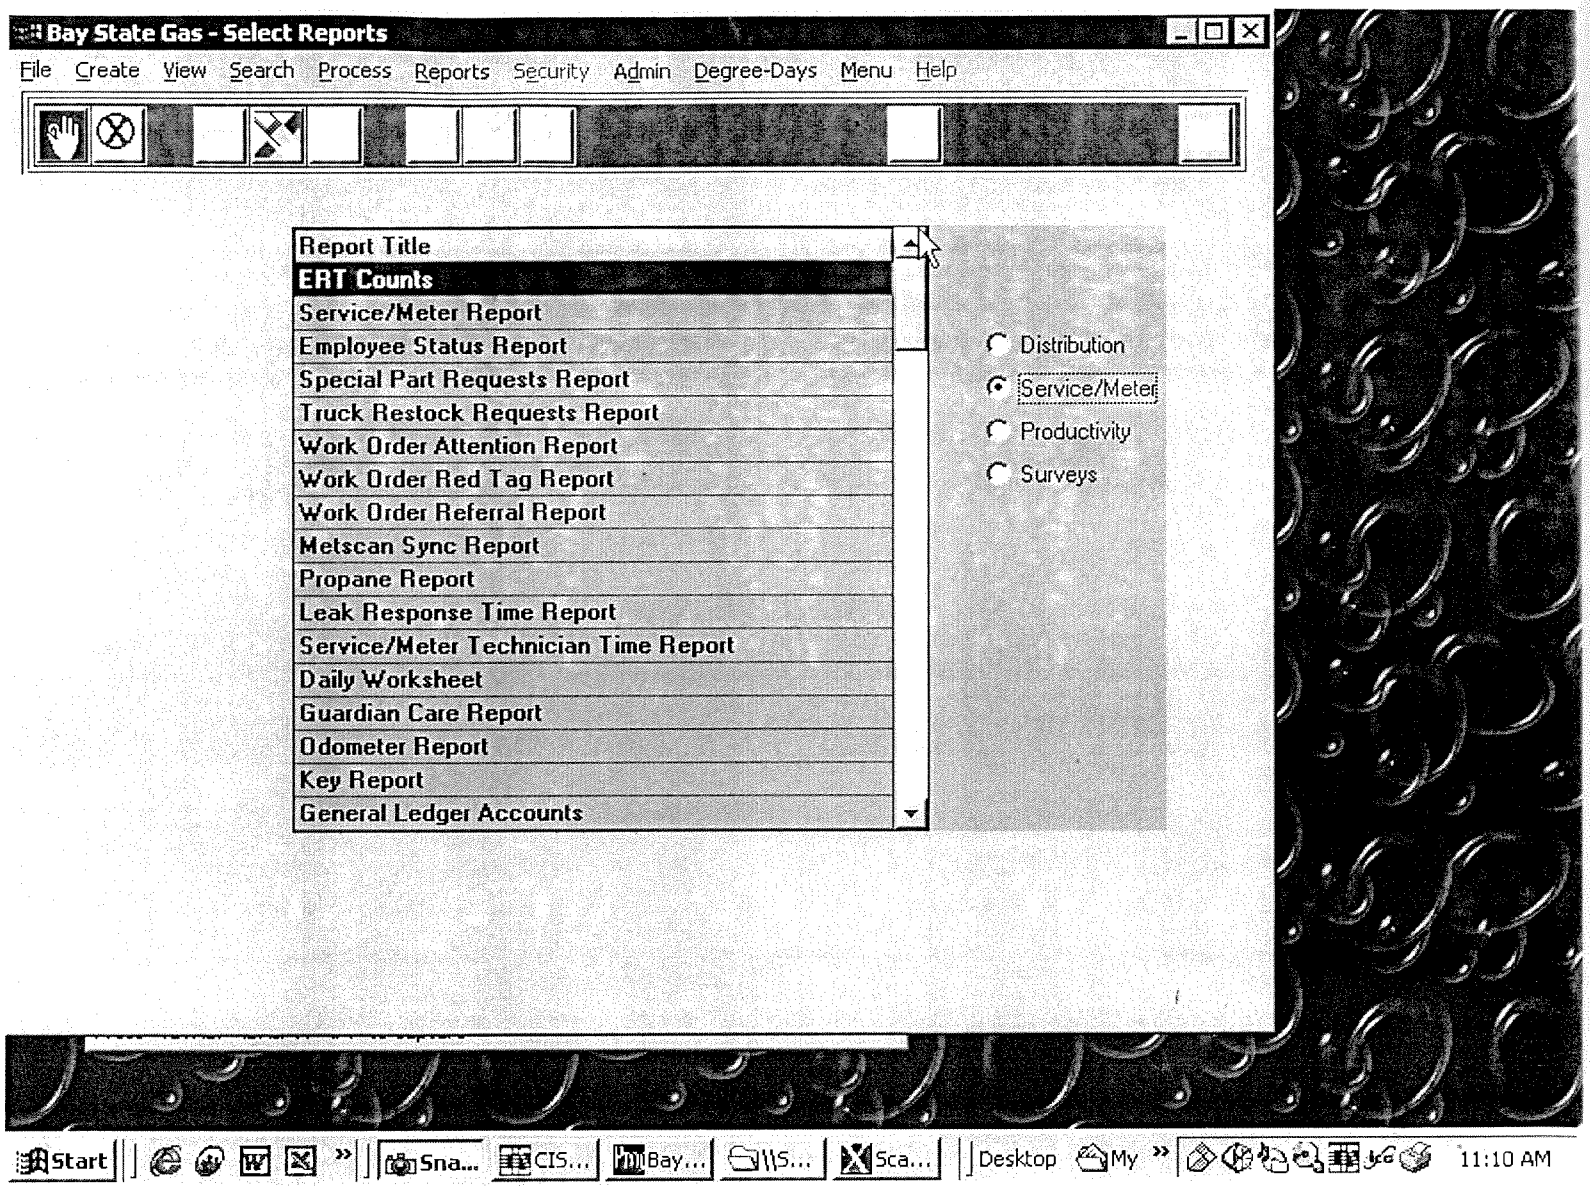
Bay State Gas - Select Reports
File Create View Search Process Reports Security Admin Degree-Days Menu Help
Report Title
ERT Counts
Service/Meter Report
Employee Status Report
Special Part Requests Report
Truck Restock Requests Report
Work Order Attention Report
Work Order Red Tag Report
Work Order Referral Report
Metscan Sync Report
Propane Report
Leak Response Time Report
Service/Meter Technician Time Report
Daily Worksheet
Guardian Care Report
Odometer Report
Key Report
General Ledger Accounts
Distribution
Service/Meter
Productivity
Surveys
Start
Sna...
CIS...
Bay...
\\S...
Sca...
Desktop
My
11:10 AM

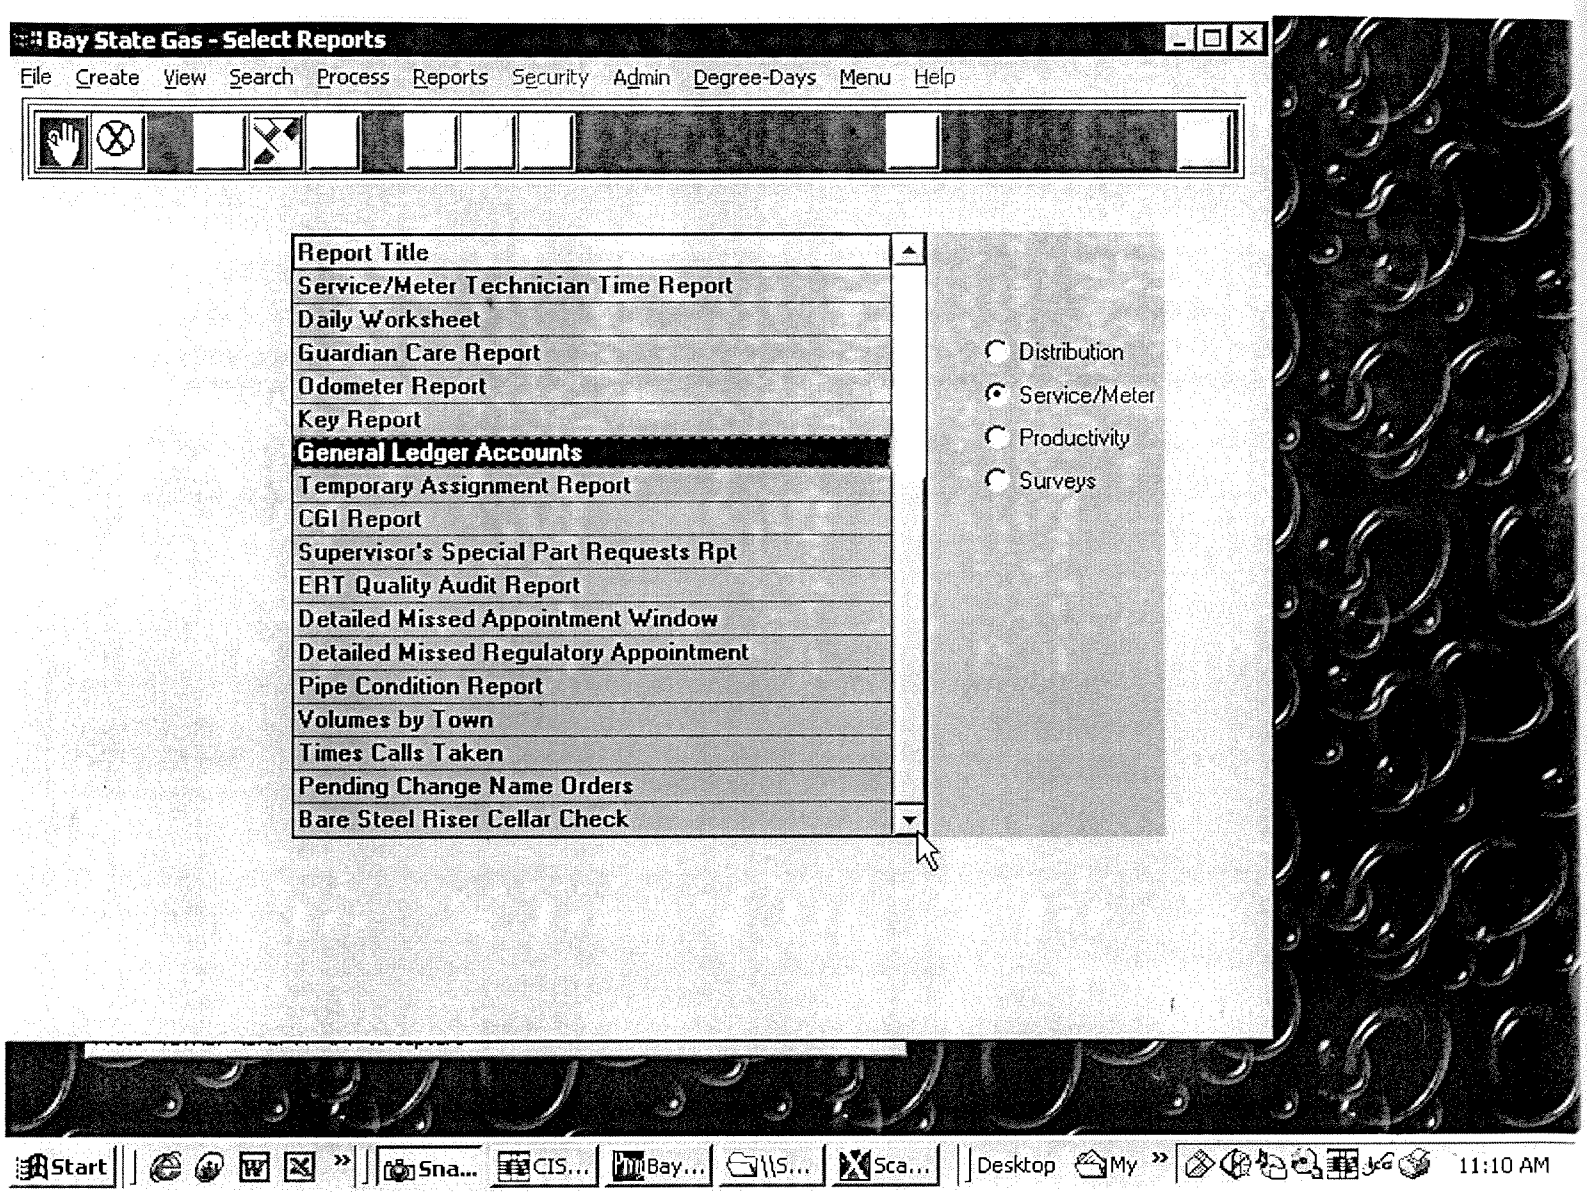
Bay State Gas - Select Reports
File Create View Search Process Reports Security Admin Degree-Days Menu Help
Report Title
Service/Meter Technician Time Report
Daily Worksheet
Guardian Care Report
Odometer Report
Key Report
General Ledger Accounts
Temporary Assignment Report
CGI Report
Supervisor's Special Part Requests Rpt
ERT Quality Audit Report
Detailed Missed Appointment Window
Detailed Missed Regulatory Appointment
Pipe Condition Report
Volumes by Town
Times Calls Taken
Pending Change Name Orders
Bare Steel Riser Cellar Check
Distribution
Service/Meter
Productivity
Surveys
Start
Sna...
CIS...
Bay...
\\S...
Sca...
Desktop
My
11:10 AM

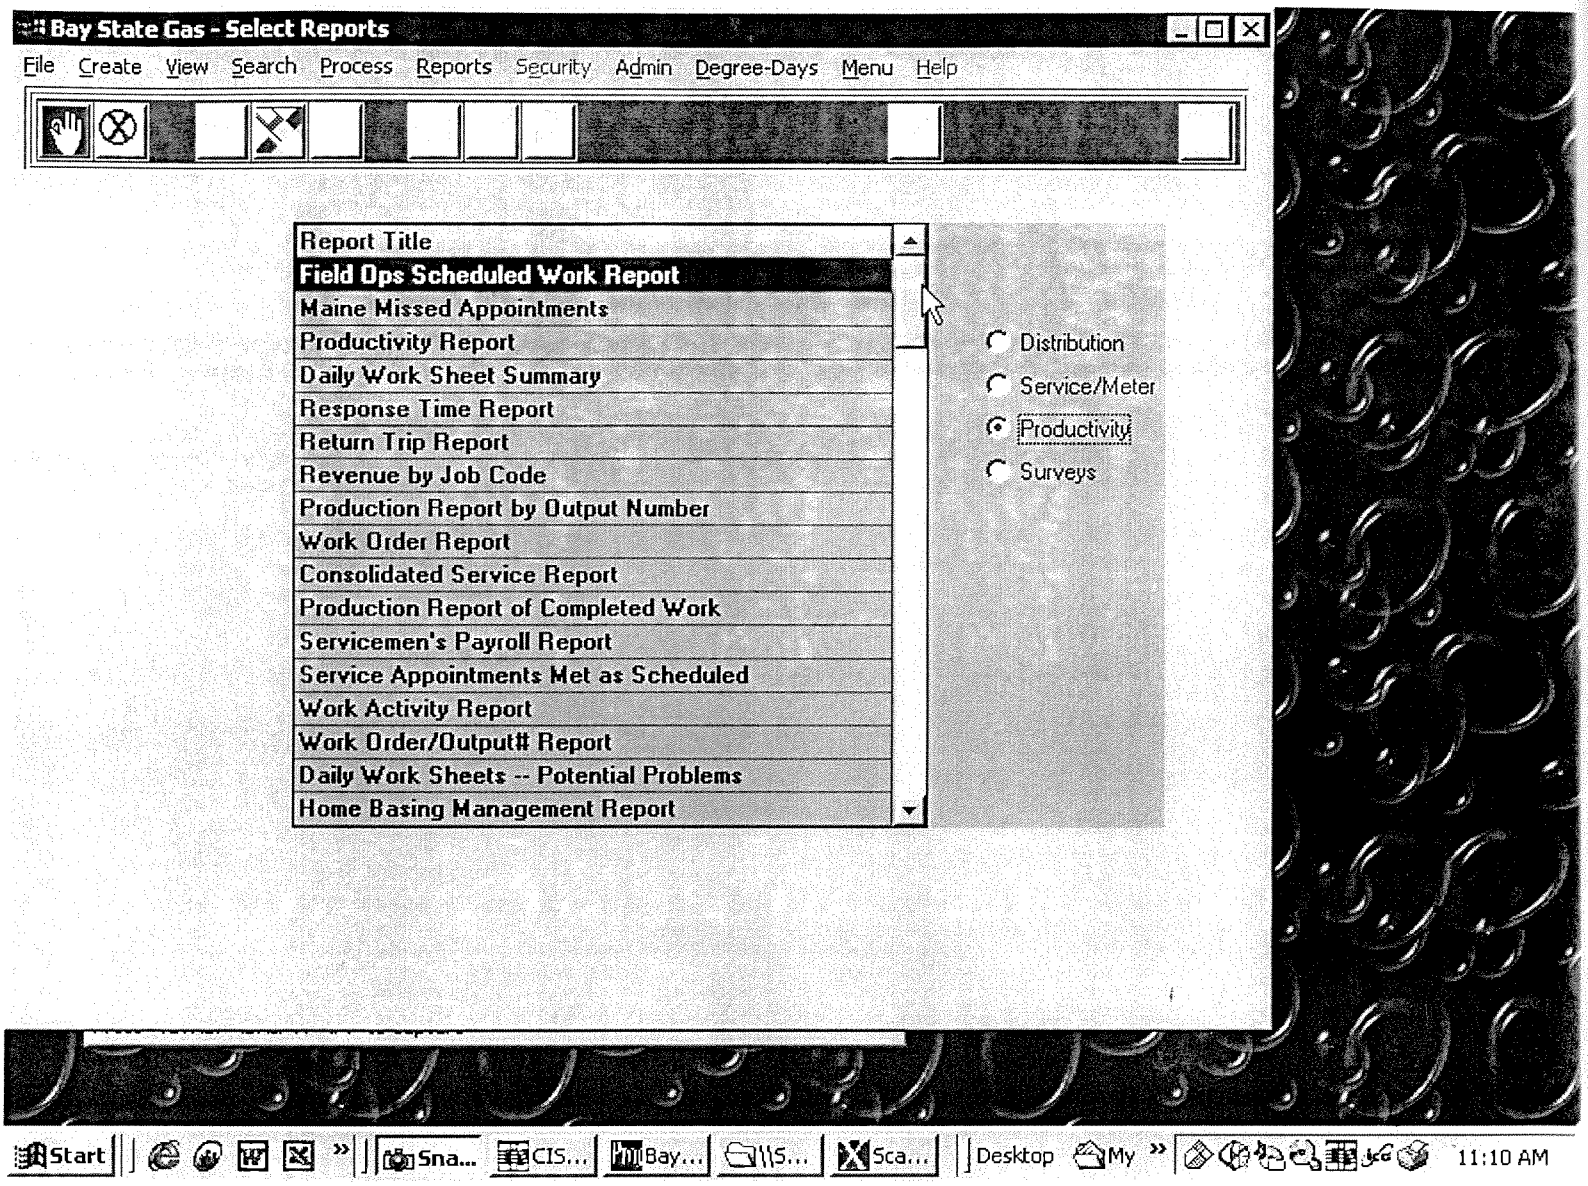
Bay State Gas - Select Reports
File Create View Search Process Reports Security Admin Degree-Days Menu Help
Report Title
Field Ops Scheduled Work Report
Maine Missed Appointments
Productivity Report
Daily Work Sheet Summary
Response Time Report
Return Trip Report
Revenue by Job Code
Production Report by Output Number
Work Order Report
Consolidated Service Report
Production Report of Completed Work
Servicemen's Payroll Report
Service Appointments Met as Scheduled
Work Activity Report
Work Order/Output# Report
Daily Work Sheets -- Potential Problems
Home Basing Management Report
Distribution
Service/Meter
Productivity
Surveys
Start
Sna...
CIS...
Bay...
\\S...
Sca...
Desktop
My
11:10 AM

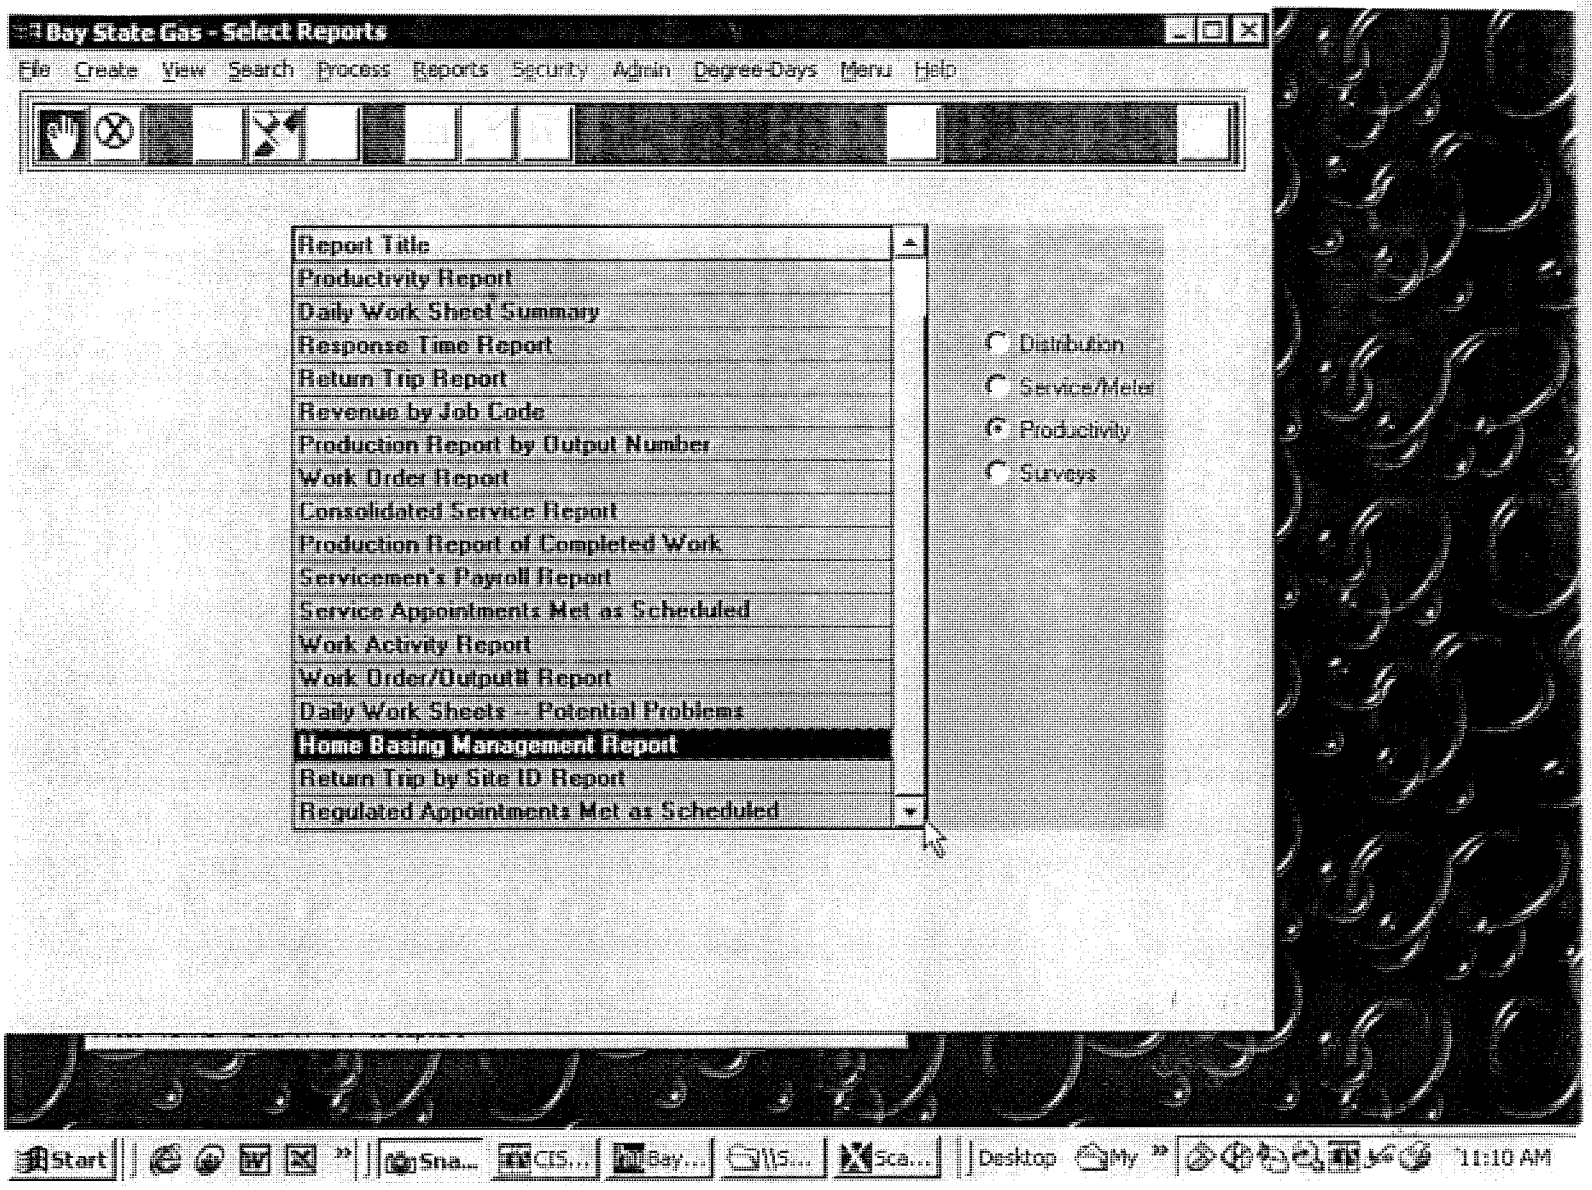
Bay State Gas - Select Reports
File Create View Search Process Reports Security Admin Degree-Days Menu Help
Report Title
Productivity Report
Daily Work Sheet Summary
Response Time Report
Return Trip Report
Revenue by Job Code
Production Report by Output Number
Work Order Report
Consolidated Service Report
Production Report of Completed Work
Servicemen's Payroll Report
Service Appointments Met as Scheduled
Work Activity Report
Work Order/Output# Report
Daily Work Sheets -- Potential Problems
Home Basing Management Report
Return Trip by Site ID Report
Regulated Appointments Met as Scheduled
Distribution
Service/Meter
Productivity
Surveys
Start
Desktop
11:10 AM

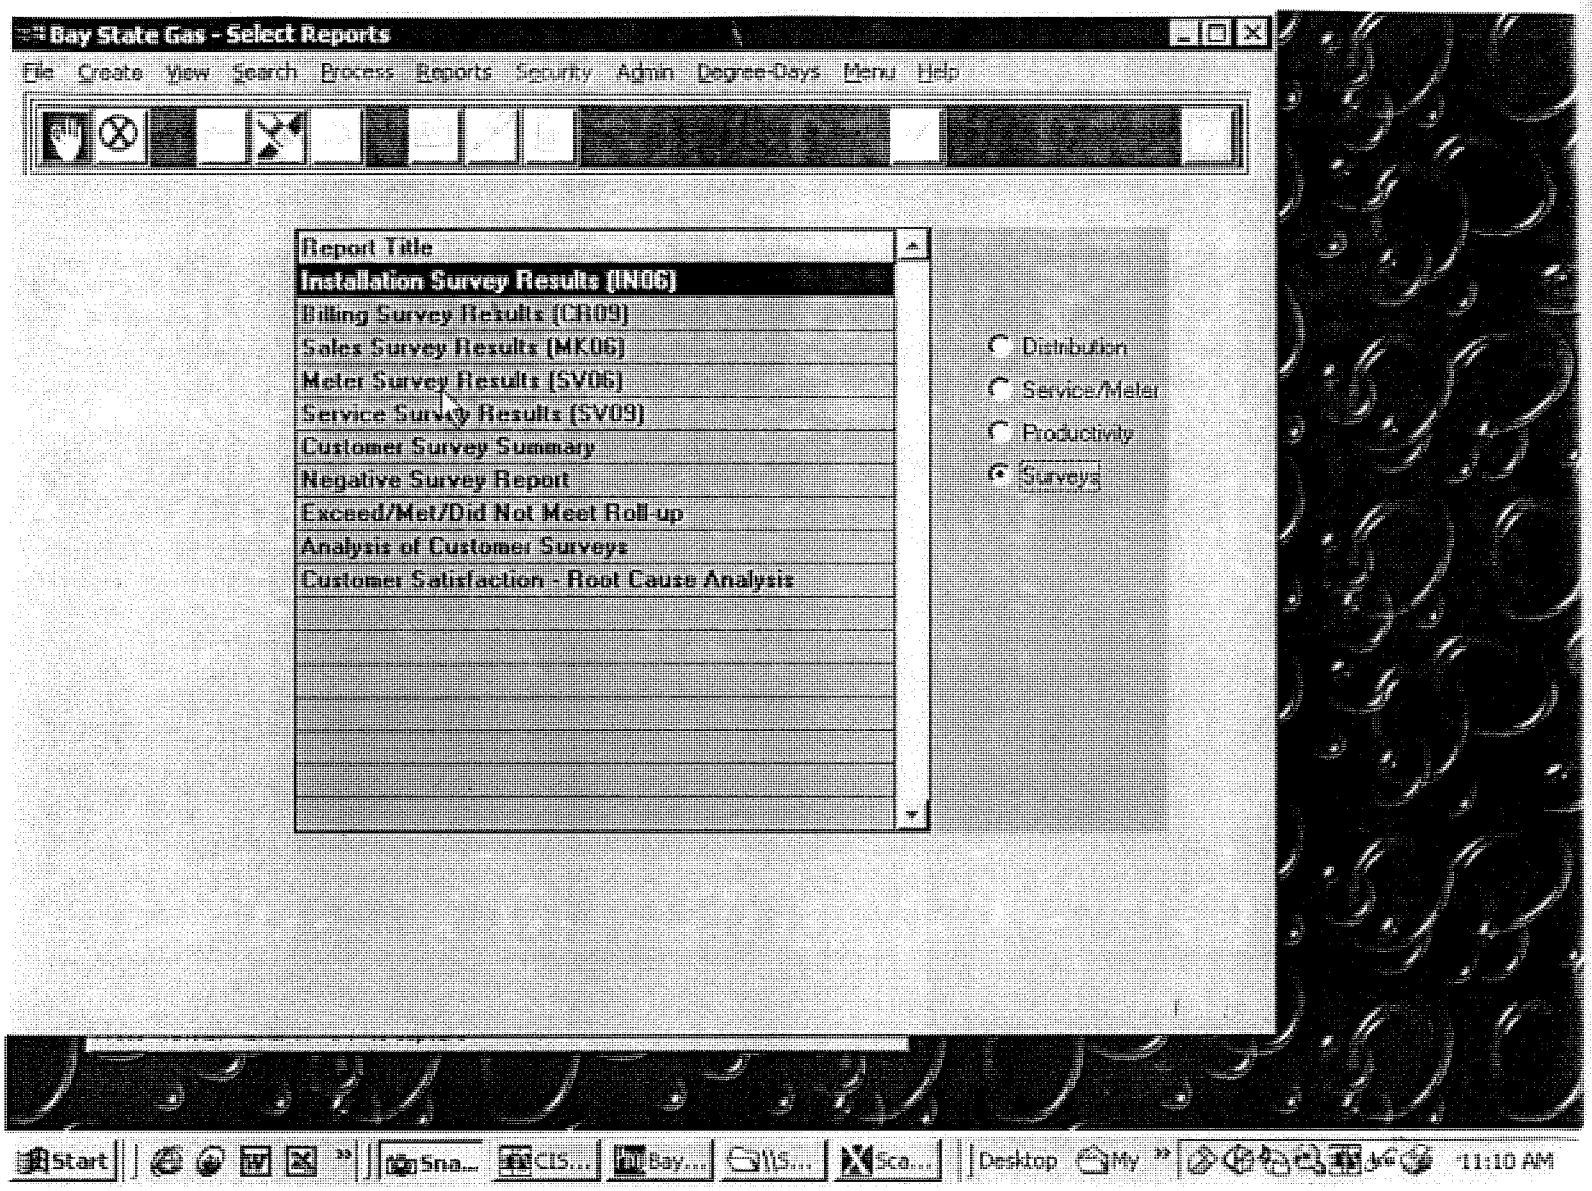
Bay State Gas - Select Reports
File Create View Search Process Reports Security Admin Degree-Days Menu Help
Report Title
Installation Survey Results (IN06)
Billing Survey Results (CR09)
Sales Survey Results (MK06)
Meter Survey Results (SV06)
Service Survey Results (SV09)
Customer Survey Summary
Negative Survey Report
Exceed/Met/Did Not Meet Roll-up
Analysis of Customer Surveys
Customer Satisfaction - Root Cause Analysis
Distribution
Service/Meter
Productivity
Surveys
Start
Desktop
11:10 AM

Program: wwrpt050.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Report

==========
R E P O R T P A R A M E T E R S
==========

Report Type : Detail
Report Sort : Normal
Division : Brockton
Leak Cause : Material Failure
From Date : 01/01/2004
To Date : 12/31/2004

Program: wwrpt050.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Report
MAINS

Work Code	Town	At	To Lot	Street	Work Order	Status Date	Lk Cl	Pipe Size	Pipe Type	Year	Pr	Pipe Cond	Cause of Leak	Comments
LRMXB	Scituate	162		Front St	5469903-1	01/13/2004	1	2 "	CS	1984	2	FA	Material Failure	REPAIRED LEAK ON 2" DRESSER.
STILL														
LRMXB	Brockton	33		Fenway Cir	5468834-1	01/20/2004	2	1 1/4	PP	2001	1	LN	Material Failure	loaking at poss loc tightened up st
LRMXB	Canton	634		Washington St	5480010-1	01/23/2004	2	4 "	BS	1949	2	FA	Material Failure	replaced bolts on 4" dressed to sto
LRMXB	Taunton	53		General Cobb St	5495234-1	02/09/2004	1	4 "	CI	1923	1	PO	Material Failure	Cut off leaking 3 /4 drip repair 1
LRMXB	Randolph			Canton St	5485863-1	02/10/2004	2	1 1/2	CS	1986	2	LN	Material Failure	found compression c. cock leaking,
LRMXB	Walpole			Robbins Rd	5498352-1	02/18/2004	2	4 "	PP	1991	2	FA	Material Failure	Found dresser couplings leaking, ab
LRMXB	Randolph	168		Chestnut St	5483626-1	02/20/2004	2	2 "	BS	1931	2	PO	Material Failure	tightened bolts or exsisting 2" ful
LRMXB	Brockton	14		Carroll Ave	5502524-1	02/24/2004	2	1 1/2	BS	1909	1	FA	Material Failure	leak tested and pipointed leak- fou
LRMXB	Taunton	325		Bay St	5514688-1	03/02/2004	1	6 "	CI	1901	1	FA	Material Failure	replaced leaking clamp on broken ma
LRMXB	Attleboro	1201		Park St	5506190-1	03/10/2004	2	1/2 "	PP	1984	3	LN	Material Failure	Service tee to #1201 was leaking.
LRMXB	Attleboro	63		West St	5516240-1	03/25/2004	2	6 "	CI	1912	1	FA	Material Failure	Cut off old drip that was leaking.
LRMXB	Bridgewater	136		Broad St	5485845-1	04/08/2004	2	6 "	CS	1959	2	PO	Material Failure	NIPPLE LEAKING INSTALL 6" SERV SEAL
LRMXB	Wrentham	708		Franklin St	5545832-1	04/09/2004	2	6 "	BS	1928	2	FA	Material Failure	REPLACED TEE. PINNED OLD TEE FLOW L
LRMXB	Foxboro			Rockhill St	5555867-1	04/22/2004	1	2 "	CS	1971	2	VP	Material Failure	LEAK ON DRESSER. INSTALL 1 - 3" X 6
LRMXB	Marshfield	16		Summer St	5563396-1	04/30/2004	1	1/2 "	PP	1985	2	FA	Material Failure	REMOVE 1/2" CC & 1/2" LEAKING DRESS
LRMXB	Bridgewater	35		Country Dr	5551310-1	05/19/2004	2						Material Failure	TIGHTEN AND DOPE TEE CAP ON SERVICE
LRMXB	Attleboro	200		N Main St	5516270-1	05/23/2004	2	6 "	CI	1937	1	FA	Material Failure	CUT OFF DRIP RISER & CEMENTED COVER
LRMXB	Easton			Washington St	5543615-1	06/02/2004	2	4 "	BS	1930	2	FA	Material Failure	LEAK TESTED & PINPOINTED LEAK FOUND
LRMXB	Mansfield	1000		West St	5347287-1	06/07/2004	2	4 "	CS	1962	2	FA	Material Failure	replaced cap on no blo tee and repa
LRMXB	Marshfield	12		Foster Ave	5603067-1	06/14/2004	2	2 "	PP	2004	2	LN	Material Failure	REPAIRED PUNCTURED 2" PP MAIN WITH
LRMXB	Randolph	47		Fitch Ter	5615641-1	06/28/2004	1	2 "	CS	1963	2	FA	Material Failure	TIGHTENED DRESSOR TO STOP LEAK
LRMXB	Berkley	522		Berkley St	5198873-1	07/07/2004	2	1 1/2	WI	1911	2	PO	Material Failure	repaired leaking clamps and added a
LRMXB	Wrentham	346		South	5597077-1	07/07/2004	2	4 "	BS	1948	2	FA	Material Failure	replaced 4 x 6 handiband with anoth
LRMXB	Bridgewater	355		Laurel St	5638856-1	07/23/2004	1	4 "	CS	1961	2	FA	Material Failure	REPAIR LEAKING TEE TO HOUSE 355
LRMXB	Canton	6		Lawrence St	5635864-1	07/26/2004	2	2 "	BS	1917	2	PO	Material Failure	FOUND WELDED PIN FROM OLD CUT OFF L
LRMXB	Brockton	444		Plain St	1652217-1	08/18/2004	2	3/4 "	CS	1989	3	LN	Material Failure	leak tested and pinpointed leak fou
LRMXB	Franklin	2		Mill River Cir	5671704-1	09/13/2004	2	1/2 "	PP	1989	2	FA	Material Failure	REPLACED O RING ON TEE TO HOUSE #1.
LRMXB	Marshfield			Field St	5687796-1	09/21/2004	2	2 "	CS	1964	2	LN	Material Failure	REPAIRED LEAK ON 2" DRESSER TIGHTEN
LRMXB	Scituate	1		Second Ave	5691242-1	09/25/2004	2	6 "	PP	1994	2	FA	Material Failure	REPLACE LEAKING PP CAP ON PP TEE
LRMXB	Taunton	122		Hart St	5698830-1	10/01/2004	1	6 "	PP	2004	2	LN	Material Failure	DUG & FOUND PLASTIC TEE LEAKING @ C
LRMXB	Bridgewater	49		South St	5645686-1	10/07/2004	2	1 "	CS	1981	2	LN	Material Failure	REPAIRED LEAKING DRESSER ON SERVIC
LRMXB	Medway			Village St	5567689-1	10/18/2004	2						Material Failure	leaking at petes plug
10/13/04 - 3'														
LRMXB	Stoughton			Canton St	5604460-1	10/29/2004	2						Material Failure	leaking on 1 1/4" tee to main going
LRMXB	Hanover	1102		Hanover St	5733802-1	11/03/2004	1	2 "	PP	2001	2	FA	Material Failure	FOUND PLASTIC TEE CAP LEAKING REMOV
LRMXB	Holbrook			Spring St	5739601-1	11/09/2004	2	2 "	PP	2000	2	LN	Material Failure	LEAK ON HIGH VOLUME TEE ON CAP HIGH
LRMXB	Marshfield	44		Shirley St	5738569-1	11/10/2004	2	1 "	BS	1930	3	FA	Material Failure	installed 1 1/2pc too fix leak on d
LRMXB	Wrentham	15		Jennifer Dr	5735337-1	11/15/2004	2						Material Failure	dug up service tee leak at cap
LRMXB	Marshfield			Ocean St	5747452-1	11/23/2004	2						Material Failure	found 2" steel dresser nut loose an
LRMXB	Stoughton	82		Canton St	5747484-1	11/26/2004	2	1 1/4	BS	1915	2	FA	Material Failure	cut off 1 1/4" tee and welded pin.
LRMXB	Brockton	93		Summer St	5766502-1	12/08/2004	2	6 "	BS	1912	2	PO	Material Failure	leak tested & pinpointed leak. foun
LRMXB	Brockton	21		Provost St	5775050-1	12/17/2004	1	1/2 "	PP	1987	2	LN	Material Failure	install new permaset curb cock
LRMXB	Hanson	168		Winter St	5781585-1	12/25/2004	1	1 "	BS	1962	2	LN	Material Failure	REPLACED VENT ON FARM TAP REG BLEW
LRMXB	Taunton	120		Ingell St	5784428-1	12/30/2004	1	1 1/2	CS	1957	1	FA	Material Failure	REPAIRED LEAK AT DRESSER & PURGED.
LRMXB	Marshfield	36		Landing Rd	5781506-1	12/31/2004	2	2 "	CS	1977	2	FA	Material Failure	leak at dresser

Total : 44

Continued on next page...

Program: wwrpt050.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Report
SERVICE

Work Code	Town	At	To	Lot	Street	Work Order	Status Date	Lk Cl	Pipe Size	Pipe Type	Year	Pr	Pipe Cond	Cause of Leak	Comments
LRSXB	Hanson	168			Winter St	5461033-1	01/02/2004	1	1/2 "	PP	1970	3	FA	Material Failure	Remove flow limitor at C.C.
LRSXB	Taunton	473		0	Somerset AVE	5464705-1	01/08/2004	1	1/2 "	BS	1937	1	FA	Material Failure	REMOVED LEAKING COUPLING, INSTALL T
LRSXB	Easton	670			Depot St	5472443-1	01/12/2004	1	1 1/4	PP	1997	3	LN	Material Failure	Replacekerotest C.C. with new one.
LRSXB	Scituate	21			Washington Ln	5463297-1	01/12/2004	2	1/2 "	PP	1978	2	FA	Material Failure	Remove leaking c.c.
LRSXB	Norton	267			W Main St	5461176-1	01/13/2004	2						Material Failure	REPLACED LEAKING KEROTEST C.C. WITH
LRSXB	Walpole	7			Patty Ann Pl	5461028-1	01/17/2004	2	1/2 "	PP	1987	2	LN	Material Failure	remove .50 kerotest and curb cock.
LRSXB	Walpole	44			Edgewood Ave	5432690-1	01/23/2004	2	1/2 "	PP	2003	2	FA	Material Failure	replaced leaking pavement coupling
LRSXB	Foxboro	17			Sand St	5357640-1	01/24/2004	2	2 "	CS	1964	2	FA	Material Failure	p.c. leaking repair cap, end of mai
LRSXB	Stoughton	19			Clover Ln	5452449-1	01/24/2004	2	1/2 "	PP	1987	2	LN	Material Failure	removed kero tesk curb cock replace
LRSXB	Attleboro	64			Mechanic St	5489365-1	02/02/2004	1	1 1/4	PP	1987	2	LN	Material Failure	replaced leaking carotest cc with 1
LRSXB	East Bridgewater	75			Washington St	5490280-1	02/02/2004	1	3/4 "	CS	1981	2	FA	Material Failure	replaced regulator on tap
measures															
LRSXB	Attleboro	68			Wilmarth St	5504440-1	02/03/2004	2	2 "	BS	1963	3	FA	Material Failure	replaced leaking tee with a 3/4 " x
LRSXB	East Bridgewater	78			Washington St	5488869-1	02/03/2004	1	3/4 "	CS	1957	2	FA	Material Failure	replaced regulator on frm tap
LRSXB	Millis	810			Main St	5495451-1	02/03/2004	1	1 "	PP	1987	2	LN	Material Failure	replaced kero test curb with 1" per
LRSXB	Millis	16			Milliston St	5489989-1	02/03/2004	1	1 "	PP	1987	2	LN	Material Failure	removed kero test, repaired b4 1" p
LRSXB	Stoughton	30			Central Dr	5430436-1	02/04/2004	2	1 "	BS	1944	2	PO	Material Failure	found cap leaking, repaired leak by
LRSXB	Brockton	67			Highland Ter	5492674-1	02/05/2004	1	4 "	CI	1908	1	PO	Material Failure	replaced service seal clamp and fit
LRSXB	Canton	138			Chapman St	5493660-1	02/06/2004	1	1/2 "	PP	1983	?	LN	Material Failure	removed kero test, curb cock instal
LRSXB	Mansfield	2			Jacob Dr	5485833-1	02/07/2004	2	1/2 "	PP	1987	2	FA	Material Failure	removed leaking kero test c.c.
LRSXB	West Bridgewater	550			N Main St	5473820-1	02/20/2004	2	1 1/4	PP	1989	2	LN	Material Failure	replaced kerotest c.c. with new per
LRSXB	Duxbury	104			Tremont St	5514128-1	02/26/2004	1	4 "	BS	1928	2	VP	Material Failure	REPLACE LEAKING TEE. PLURGE IN FRON
LRSXB	Taunton	135			Lima Dr	5510409-1	02/27/2004	1	1/2 "	PP	1987	2	LN	Material Failure	found kero test c. cock leaking rem
LRSXB	Walpole	5			Drake Cir	5512911-1	03/01/2004	1	1/2 "	PP	1988	2	LN	Material Failure	renewed kero test c.c. and repalced
LRSXB	Halifax	430			Plymouth St	5534244-1	03/26/2004	1	2 "	CS	1972	2	FA	Material Failure	Repair leak at dresser.
LRSXB	Norton	7			Robin Cir	5548250-1	04/09/2004	1	1/2 "	PP	1986	2	LN	Material Failure	REMOVED KERO-TEST C.C. & REPLACED W
LRSXB	Randolph	12			N Harriette St	5575095-1	05/06/2004	2	3/4 "	CS	1970	2	FA	Material Failure	FOUND CAP ON TEE TO # 12 LEAKING RE
LRSXB	Taunton	25			Highland St	5571727-1	05/10/2004	1	1/2 "	PP	1999	3	FA	Material Failure	REPLACE LEAKING PERMASET AT RISER.
LRSXB	Bridgewater	17			Blueberry Knls	5583404-1	05/23/2004	1	1/2 "	PP	1991	2	LN	Material Failure	replaced a leaking permaset couplin
LRSXB	Brockton	524			E Ashland	5594400-1	06/24/2004	2	1/2 "	PP	1987	2	FA	Material Failure	REMOVED KAROTEST C.C. FLO LIMITER T
LRSXB	Brockton	28			Leyden St	5616722-1	06/30/2004	1	1 1/4	BS	1909	2	PO	Material Failure	CUT IN 1 1/4" COMPRESSION CURB COCK
LRSXB	Canton	195			Lawrence St	5554953-1	07/06/2004	2	2 "	BS	1924	2	PO	Material Failure	found tee to #195 leaking. pinned o
LRSXB	Taunton	87			Amherst Ave	5610463-1	07/08/2004	2	1 1/4	PP	1988	2	FA	Material Failure	removed kero test cc
LRSXB	Foxboro	16			School St	5624986-1	07/10/2004	2	3/4 "	CS	1977	2	LN	Material Failure	found cap leaking, repaired by rele
LRSXB	Stoughton	5			Drake Ave	5696037-1	09/23/2004	1	1/2 "	PP	1987	2	LN	Material Failure	installed 3/4" x 1/2" pt with no fl
LRSXB	Randolph	70			Union St	5705651-1	10/07/2004	1	6 "	CS	1984	2	LN	Material Failure	REPAIRED LEAKING 1/2" PP @ FLOWLIMI
LRSXB	East Bridgewater	176			Pine St	5593320-1	10/13/2004	2	1/2 "	PP	2003	2	LN	Material Failure	REPAIR LEAK ON SERVICE (1 1/4" PLUG
LRSXB	Sharon	242			Hampton Rd	5709330-1	10/18/2004	2						Material Failure	removed leaking karotest cc flo lim
LRSXB	Mansfield	550			Ware St	5720043-1	10/21/2004	2						Material Failure	remove kero test curb cock
LRSXB	Scituate	7			Fieldstone Rd	5731240-1	11/01/2004	1	1 "	CS	1959	2	FA	Material Failure	REPAIRED LEAKING DRESSER TIGHTEN NU
LRSXB	Seekonk	3			Read St	5715305-1	11/01/2004	2	1/2 "	PP	1987	2	FA	Material Failure	TOOK OUT OLD KERO TEST CC REPLACED
LRSXB	Randolph	4			Hill Park Ter	5732358-1	11/04/2004	2	1/2 "	PP	1989	2	LN	Material Failure	removed kero test curb cock and rep
LRSXB	Attleboro	55			Leedham St	5742831-1	11/12/2004	1	1/2 "	PP	1987	3	LN	Material Failure	LEAK ON KEROTEST C.C. REMOVED C.C.
LRSXB	Attleboro	55			Leedham St	5755231-1	11/12/2004	1	1/2 "	PP	1987	3	LN	Material Failure	LEAK ON KEROTEST C.C. REMOVED C.C.
LRSXB	Sharon	6			Saw Mill Pond Rd	5738580-1	11/12/2004	2	1/2 "	PP	1987	3	FA	Material Failure	replaced kero test cc that was leak
LRSXB	Walpole				Bird & Sons Dr	5261835-1	12/04/2004	2	3/4 "	CS	1980	2	FA	Material Failure	replaced leaking cap on tee
LRSXB	Canton	105			Walnut St	5775954-1	12/18/2004	1	1 "	PP	1987	2	LN	Material Failure	replaced 1" kero test cc with 1" st
LRSXB	Canton	12			Royal Ave	5776586-1	12/21/2004	2	1/2 "	PP	2004	?	LN	Material Failure	kerotest curb cock leak and take ou
LRSXB	Hanover	124			Olde Forge Rd	5753833-1	12/30/2004	2	1/2 "	PP	1987	2	LN	Material Failure	removed kerotest cc 2' 1/2"pp. 2 1/
LRSXB	Scituate	20			Berkshire Rd	5787188-1	12/30/2004	1	1/2 "	PP	2000	2	LN	Material Failure	REPLACED 1 FOOT 1/2" PP @ FLOW LINI

Continued on next page...

Program: wwrpt050.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Report

Total : 49

Continued on next page...

Program: wwrpt050.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Report

Cause of Leak	MAINS Class 1	MAINS Class 2	MAINS Class 3	MAINS Other	SERVICE Class 1	SERVICE Class 2	SERVICE Class 3	SERVICE Other	Cause Total
Material Failure	12	32	0	0	25	24	0	0	93
TOTALS:	12	32	0	0	25	24	0	0	93

End of Report

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

==========
R E P O R T P A R A M E T E R S
==========

Division : Brockton
Leak Class : (All)
Pipe Type : Bare Steel
Pipe Size : (All)
Pipe Pressure : (All)
From Date : 01/01/2004
To Date : 12/31/2004
Status From :
Status To :

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
1	04/23/2004	04/23/2004	SRERB	19			4th St	Attleboro	MA	5556947-1	Low	Bare Steel	1 1/2 "	RELIEVED 2ND STBY CREW. RENEWAL CU
1	05/21/2004	05/21/2004	LRMXB	85			Adamsdale Ave	Attleboro	MA	5581781-1	High	Bare Steel	2 "	CLAMP MAIN 2". PURGE, HIGH READINGS
1	06/18/2004	06/17/2004	LRSFB	59			Black Oak Dr	Attleboro	MA	5606493-1				
1	01/14/2004	01/13/2004	SRERB	55			Bliss Ave	Attleboro	MA	5470758-1				ReCC and Replace with 1/2 plastic a
1	01/14/2004	01/13/2004	LRSXB	55			Bliss Ave	Attleboro	MA	5471515-1				Remove C.C., Replace with 5 ' of 1/
2	05/18/2004	07/12/2004	LRMXB	28			Bourne Ave	Attleboro	MA	5578522-1	Intermedt	Bare Steel	2 "	installed three 2 x 6 handiband cla
2	06/08/2004	08/05/2004	LRMXB				Brown St	Attleboro	MA	5596787-1	Intermedt	Bare Steel	3 "	INSTALLED 3" X 6" HANDIBAND CLAMP O
1	09/22/2004	09/22/2004	LRMXB	142			Brown St	Attleboro	MA	5689086-1	Intermedt	Bare Steel	4 "	CUT OFF STUB & PINNED MAIN & INSTAL
											Intermedt	Bare Steel	3/4 "	
1	08/09/2004	08/07/2004	SRERB	180			Brown St	Attleboro	MA	5650960-1				Leak at punch & tee. Replace tee on
2	01/05/2004	02/02/2004	LRMXB	375			Brown St	Attleboro	MA	5461043-1	Intermedt	Bare Steel	3 "	Repaired leak on 3" main, installed
1	03/31/2004	03/30/2004	LRMXB	375			Brown St	Attleboro	MA	5537838-1	High	Bare Steel	3 "	Install 1-3" full seal.
2	01/05/2004	01/26/2004	LRMXB	396			Brown St	Attleboro	MA	5461074-1	Intermedt	Bare Steel	3 "	repaired leak on 3" b.s main using
1	03/01/2004	03/01/2004	LRMXB				County St	Attleboro	MA	5512463-1				removed 2 old press on seals, insta
2	07/20/2004	08/13/2004	LRMXB				County St	Attleboro	MA	5633410-1				leak tested and pinpointed leak. fo
1	06/15/2004	06/15/2004	SRERB	142			County St	Attleboro	MA	5602906-1	Low	Bare Steel	1 1/4 "	Renewed srvc from c.c. in, previous
1	03/18/2004	03/18/2004	LRSFB	109			Dean St	Attleboro	MA	5527562-1				Installed new 1 1/4 HPC.
1	03/01/2004	02/28/2004	LRSFB	37			Dennis St	Attleboro	MA	5512744-1				changed leaking meter, raised burie
2	07/22/2004	08/09/2004	JXXXB	57			Dennis St	Attleboro	MA	5635862-1				SEAL 6" BELL JOINT.
2	03/04/2004	03/29/2004	JXXXB				Elizabeth St	Attleboro	MA	5516264-1				Sealed 5 joints- 2 on a Regular Hub
3	09/02/2004	09/02/2004	LRSXB	34			Forest St	Attleboro	MA	5672197-1				see 5669497
1	03/08/2004	03/08/2004	SRERB	22			Franklin St	Attleboro	MA	5518962-1	Low	Bare Steel	1 1/4 "	renewed service c.c. to house using
1	07/20/2004	07/20/2004	SRERB	32			Grant St	Attleboro	MA	5633706-1				Renewed service from c.c. to house.
1	07/19/2004	07/19/2004	LRMXB	31			Greenhill Ave	Attleboro	MA	5632806-1				INSTALLED 2 CLAMPS ON 2" MAIN (CHES
2	07/30/2004	08/07/2004	RTMXB	31			Greenhill Ave	Attleboro	MA	5642802-1				CUT 2" STUB OFF AT VALVE.
1	07/23/2004	07/23/2004	CDSXB	33			Guisti Dr	Attleboro	MA	5636873-1				REPLACED 1' OFF 1/2" PLASTIC WITH 2
2	05/03/2004	06/04/2004	SRERB	4			Hazelwood Ave	Attleboro	MA	5565225-1				renewed service from tee to propert
1	04/06/2004	04/03/2004	JCIXB	14			Hodges St	Attleboro	MA	5543542-1				AVON SEAL 4" BELL JOINT.
2	02/17/2004	02/18/2004	LRSXB	79			Hollcott Dr	Attleboro	MA	5501647-1				Clamped 1 1/4 service pipe using
2	08/23/2004	08/26/2004	JXXXB				Horton St	Attleboro	MA	5662115-1				avon sealed 3 joints on 3 way tee.
2	11/22/2004	12/13/2004	JCIXB	35			James St	Attleboro	MA	5751820-1				avon seales 8" joint
1	01/02/2004	01/02/2004	SRERB	24			John St	Attleboro	MA	5459492-1				Renewed service from main to inside
2	12/14/2004	01/03/2005	SRERB	25			Lawn St	Attleboro	MA	5771258-1				renewed service relocate service to
1	12/22/2004	12/19/2004	LRMXB	40			Lawn St	Attleboro	MA	5779264-1	Intermedt	Bare Steel	2 "	INSTALLED 3 - 2" HANDY BANDS ON B.S
1	11/12/2004	11/12/2004	LRSXB	55			Leedham St	Attleboro	MA	5742831-1				LEAK ON KEROTEST C.C. REMOVED C.C.
1	11/26/2004	11/12/2004	LRSXB	55			Leedham St	Attleboro	MA	5755231-1				LEAK ON KEROTEST C.C. REMOVED C.C.
1	12/14/2004	12/12/2004	LRMXB				Locust St	Attleboro	MA	5771445-1	Intermedt	Bare Steel	2 "	DISASSEMBLED & REPACKED GATE VALVE.
2	05/13/2004	01/10/2005	LRMXB	407			Locust St	Attleboro	MA	5574583-1	High	Bare Steel	4 "	removed 2" 4" handy band and insta
1	12/14/2004	12/14/2004	LRMXB	499			Locust St	Attleboro	MA	5771410-1	Intermedt	Bare Steel	3 "	REPACKED VALVE & LOCUST & OAKHILL.
4	09/10/2004	09/09/2004	LRMXB	178			Main St	Attleboro	MA	5678375-1				negative results
2	10/07/2004	10/22/2004	JXXXB	185			Maple St	Attleboro	MA	5705461-1				installed one 6" avon boot
1	02/02/2004	02/02/2004	LRSXB	64			Mechanic St	Attleboro	MA	5489365-1				replaced leaking carotest cc with 1
2	03/16/2004	03/30/2004	LRSXB	64			Mechanic St	Attleboro	MA	5525573-1				Repaired leak, had to cut off old r
2	11/02/2004	11/16/2004	LRMXB	208			Mendon Rd	Attleboro	MA	5732344-1				repaired leak using 1 4" handy band
1	03/02/2004	03/02/2004	JCIXB				N Main St	Attleboro	MA	5513793-1				sealed 5" joint.
2	03/04/2004	05/23/2004	LRMXB	200			N Main St	Attleboro	MA	5516270-1				CUT OFF DRIP RISER & CEMENTED COVER
2	11/23/2004	11/17/2004	LRMXB				Newport	Attleboro	MA	5752596-1				5732368 completed installed 2 clamp
1	09/17/2004	09/17/2004	LRMXB	369			Newport Ave	Attleboro	MA	5684443-1				clamp main handiband
2	11/02/2004	11/17/2004	LRMXB	369	389		Newport Ave	Attleboro	MA	5732368-1	Intermedt	Bare Steel	2 "	repaired leaks in 2 separate locati
2	10/21/2004	11/04/2004	LRMXB	950			Oak Hill Ave	Attleboro	MA	5720035-1				repaired leak using 1-4" handi band
2	02/20/2004	03/05/2004	LRMXB	1049			Oak Hill Ave	Attleboro	MA	5504436-1	Intermedt	Bare Steel	4 "	repaired leak using 1-4" handy band

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
1	11/19/2004	11/19/2004	LRMXB	2			Oakhill Ave	Attleboro	MA	5750219-1				Leak on threads on valve, rise sid
1	12/18/2004	12/13/2004	LRMXB	58			Old Stagecoach Rd	Attleboro	MA	5776097-1	Intermedt	Bare Steel	3 "	REPAIRED LEAKING GATE VALVE.
2	10/08/2004	10/21/2004	JCIXB	73			Orange St	Attleboro	MA	5706988-1				installed 2 6" avon boots
2	06/30/2004	08/02/2004	JCIXB	79			Orange St	Attleboro	MA	5617027-1				FOUND LEAK ON 6" ENCAPSULATION KIT
1	04/02/2004	04/02/2004	LRMXB	12			Park Ave	Attleboro	MA	5540425-1				CLAMPED MAIN, USING 1 - FULL SEAL.
2	02/27/2004	04/06/2004	LRMXB				Park St	Attleboro	MA	5510549-1	Intermedt	Bare Steel	2 "	clamped main using 2 - 2" handi ban
1	09/18/2004	09/14/2004	CDSXB				Park St	Attleboro	MA	5685250-1				SHUT OFF SERVICE AT C.C. TO BE CUT
2	05/15/2004	05/20/2004	RTMXB	2			Park St	Attleboro	MA	5576868-1				CUT END OF MAIN. INSTALLED DRESSER
1	04/26/2004	04/26/2004	SRERB	14	16		Park St	Attleboro	MA	5558793-1	Low	Bare Steel	1 1/2 "	REPLACED PIPE 4' OF 2" STEEL BACK T
2	02/23/2004	03/10/2004	LRMXB	1201			Park St	Attleboro	MA	5506190-1				Service tee to #1201 was leaking.
1	02/19/2004	02/19/2004	LRMXB	1503			Park St	Attleboro	MA	5503443-1	Intermedt	Bare Steel	4 "	installed 4" handy band on 4" BS
1	02/23/2004	02/23/2004	LRMXB	1503			Park St	Attleboro	MA	5505987-1	Intermedt	Bare Steel	4 "	leak tested and pipointed leak, rep
1	02/24/2004	02/24/2004	LRMXB	1503			Park St	Attleboro	MA	5507083-1	High	Bare Steel	4 "	repair leak with one 4" clamp, purg
1	10/02/2004	10/01/2004	LRMXB	1503			Park St	Attleboro	MA	5699897-1	Intermedt	Bare Steel	4 "	INSTALLED 1 - 4" FULL SEAL CLAMP ON
3	07/02/2004	09/13/2004	LRSFB	5			Peckham St	Attleboro	MA	5619623-1				RETHREADED RISER. INSTALLED NEW FIT
1	03/09/2004	03/09/2004	RTSRB	16			Perrin	Attleboro	MA	5519603-1				cut off service at main installed 1
1	09/16/2004	09/16/2004	CDMXB	205			Pine St	Attleboro	MA	5683311-1				CONTRACTOR HIT PIPE, NOT OURS.
2	08/30/2004	10/05/2004	JXXXB				Pleasant St	Attleboro	MA	5668475-1				avon seal 5 joints all 1 ' away fro
1	02/18/2004	02/18/2004	LRSFB	1077			Pleasant St	Attleboro	MA	5502645-1				repaired fit leak.
2	05/25/2004	08/02/2004	JCIXB				Robert St	Attleboro	MA	5584653-1	Intermedt	Bare Steel	6 "	Repaired leaking encapsulation join
4	02/18/2004	02/14/2004	RTSRB	3			Robert St	Attleboro	MA	5502320-1	Low	Bare Steel	4 "	cut off service clamp main w/ 4" ha
1	12/18/2004	12/18/2004	CDSXB	253			Robinson Ave	Attleboro	MA	5776058-1				REPAIRED 1/2" PLASTIC SERVICE.
1	05/14/2004	05/14/2004	SRERB	30			S Main St	Attleboro	MA	5576027-1	Low	Bare Steel	1 1/2 "	INSERTED 1.25" P.P. FROM C.C. IN TO
2	04/29/2004	04/24/2004	LRSFB	418			S Main St	Attleboro	MA	5562242-1				REPAIRED LEAK ON OUTSIDE METER FIT.
2	09/10/2004	10/04/2004	LRSXB	146			South Ave	Attleboro	MA	5678385-1				Installed 3 - 2" handi bands on 2"
2	05/18/2004	07/16/2004	SRERB	7			Sturdy St	Attleboro	MA	5578520-1				renewed service from main to end w/
2	11/08/2004	11/15/2004	LRMXB	21			Tappan Ave	Attleboro	MA	5738567-1				repaired leak on drip. installed ne
2	08/27/2004	09/14/2004	LRMXB				Thacher St	Attleboro	MA	5666825-1				REPAIRED LEAK ON SAVER NIPPLE.
1	04/30/2004	04/30/2004	LRSXB				Wall St	Attleboro	MA	5563378-1				FOUND DAMAGE TO 2" SERVICE. REMOVED
2	08/30/2004	09/14/2004	LRMXB				Washington St	Attleboro	MA	5668288-1				REPAIRED LEAK ON MAIN & VALVE. VALV
2	03/04/2004	03/23/2004	JXXXB	32			West St	Attleboro	MA	5516268-1	Low	Bare Steel	6 "	6" CI coupling leaking, Avon Sealed
2	03/04/2004	03/25/2004	LRMXB	63			West St	Attleboro	MA	5516240-1				Cut off old drip that was leaking.
2	02/20/2004	02/03/2004	LRSXB	68			Wilmarth St	Attleboro	MA	5504440-1	High	Bare Steel	2 "	replaced leaking tee with a 3/4 " x
2	04/02/2004	04/10/2004	LRMXB	86			Wilmarth St	Attleboro	MA	5540557-1	Intermedt	Bare Steel	2 "	installed 2" full seal on B S main
1	04/23/2004	04/23/2004	LRMXB	86			Wilmarth St	Attleboro	MA	5556943-1	Intermedt	Bare Steel	2 "	installed 1 h.b. clamp on main - pu
1	05/18/2004	05/18/2004	LRMXB	86			Wilmarth St	Attleboro	MA	5578376-1	Intermedt	Bare Steel	2 "	LEAK ON 2" 1928 MAIN 2 - 2" X6" BAN
2	05/20/2004	08/09/2004	LRMXB	97			Wilmarth St	Attleboro	MA	5580529-1				REPLACE MAIN IN AREA OF LEAKAGE - C
2	04/26/2004	05/13/2004	RTSRB	8			Wolfenden St	Attleboro	MA	5558946-1				CUT OFF 1.25" STUB SRVC THAT WAS NO
2	11/19/2004	11/20/2004	LRMXB	4			Yale St	Attleboro	MA	5750002-1	High	Bare Steel	2 "	installed on 2" handyband this mai
2	07/28/2004	08/02/2004	LRMXB				Bodwell St	Avon	MA	5640566-1				LEAK TESTED & PINPOINTED LEAK REPAI
2	11/23/2004	12/03/2004	LRSXB	3			Bruce St	Avon	MA	5752919-1				removed leaking cc with 3' of 1/2"
1	11/23/2004	11/21/2004	CDSXB	173			E Spring St	Avon	MA	5753001-1				REPAIRED BROKEN 1/2" PP SERIVE WITH
2	05/03/2004	06/08/2004	LRMXB				Gill St	Avon	MA	5565232-1	Intermedt	Bare Steel	2 "	leak tested and pinpointed leak. fo
1	09/30/2004	09/30/2004	CDSXB	21			Granite St	Avon	MA	5697238-1				CUT BACK 8' OF STEEL INSTALLED 8' O
1	09/13/2004	09/13/2004	CDMXB	76			Highland St	Avon	MA	5680091-1				INSTALLED TWO 2" DRESSERS AND INSTA
1	07/21/2004	07/21/2004	CDSXB	500			Page St	Avon	MA	5634757-1				REPLACED HIT SERVICE
1	06/11/2004	06/11/2004	CDSXB	82			South St	Avon	MA	5600411-1				REPAIRED BROKEN PIPE WITH PERMA SER
2	04/09/2004		LRSF	13			Apache Rd	Bellingham	MA	5546779-1				
1	03/12/2004	03/12/2004	CDSXB	19			Harper Blvd	Bellingham	MA	5522635-1				Located and raised c.cock, rewrappe
2	11/04/2004	11/17/2004	LRMXB				Hartford Ave	Bellingham	MA	5735335-1				repaired leaking grease riser on va
2	11/29/2004	12/17/2004	LRMXB				Hartford Ave	Bellingham	MA	5756279-1				installed 2 4" pc's and replaced 4"

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
1	01/10/2004	01/10/2004	LRSFB	17			N Main St	Bellingham	MA	5467154-1				Replace regulator on AL 800 Meter a
1	12/10/2004	12/10/2004	CDMXB	1201			Old Bridge	Bellingham	MA	5768881-1				installed 2 - 2" dressers & a 2' x
1	02/19/2004	02/19/2004	CDSXB	1602			Old Bridge Ln	Bellingham	MA	5503477-1				repaired broken svc with permaset c
1	02/20/2004	02/20/2004	CDSXB	1603			Old Bridge Ln	Bellingham	MA	5504350-1				repaired broken svc-hit with jack h
2	02/04/2004	06/30/2004	SRERB	105			Plymouth Rd	Bellingham	MA	5491105-1				renewed service with 1/2" pp from t
1	06/02/2004	05/30/2004	LRSFB	19			Roberta Ln	Bellingham	MA	5591847-1				REPAIRED LEAKING FIT.
2	03/09/2004	04/02/2004	LRSFB	2			S Maple St	Bellingham	MA	5519647-1				Replaced HP cock and reducer.
2	06/03/2004	07/17/2004	LRMXB	84			Auburn St	Bridgewater	MA	5593242-1	Intermedt	Bare Steel	1 1/2 "	install 1.5 x 6 clamp
1	11/20/2004	11/20/2004	LRMXB				Bedford St	Bridgewater	MA	5750972-1				replaced 5' of 2" bare steel with 5
2	10/21/2004	10/20/2004	LRSFB	859			Bedford St	Bridgewater	MA	5720037-1				completed by # 0702 see ticket 9493
1	01/21/2004	01/21/2004	LRSFB	1345			Bedford St	Bridgewater	MA	5478393-1				change leaking hpc
1	05/24/2004	05/23/2004	LRSXB	17			Blueberry Knls	Bridgewater	MA	5583404-1				replaced a leaking permaset couplin
2	02/27/2004	07/06/2004	LRMXB				Broad St	Bridgewater	MA	5510554-1	Intermedt	Bare Steel	4 "	made repair with 4 x 6 handi band c
2	01/29/2004	04/08/2004	LRMXB	136			Broad St	Bridgewater	MA	5485845-1				NIPPLE LEAKING INSTALL 6" SERV SEAL
1	04/21/2004	04/29/2004	SRECB	136			Broad St	Bridgewater	MA	5554955-1				4/21/04 renew leaking service from
2	04/30/2004	04/30/2004	LRMXB	136			Broad St	Bridgewater	MA	5563447-1	High	Bare Steel	6 "	install 6" clamp with 2" oulet 6"x
2	04/15/2004	06/14/2004	LRMXB	103			Center St	Bridgewater	MA	5551314-1				negative % at curb cock
1	12/30/2004	12/30/2004	LRMXB				Central Sq	Bridgewater	MA	5784543-1				VALVE LEAKING, USED VAL TEX TO LUBE
2	04/15/2004	05/19/2004	LRMXB	35			Country Dr	Bridgewater	MA	5551310-1				TIGHTEN AND DOPE TEE CAP ON SERVICE
2	08/31/2004	09/14/2004	LRMXB	70			Dean St	Bridgewater	MA	5669280-1	Intermedt	Bare Steel	2 "	REPAIRED LEAKING VALVE CLASS 1 WHEN
1	11/09/2004	11/09/2004	LRMXB				Grove St	Bridgewater	MA	5739605-1				GREASED 6" VALVE
2	03/26/2004	04/20/2004	LRSXB	464			High St	Bridgewater	MA	5534220-1	Intermedt	Bare Steel	4 "	TEE & FLO LIMITOR LEAKING REPLACE T
2	04/26/2004	05/24/2004	SRERB	479			High St	Bridgewater	MA	5558762-1				renew tee to curb cock pin old tee
2	01/29/2004	01/30/2004	LRSXB	1084			High St	Bridgewater	MA	5485608-1				replaced 1' of ritted pipe on riser
2	05/13/2004	07/15/2004	SRERB	25			Lantern Ln	Bridgewater	MA	5575026-1				renew leaking service from main to
1	07/26/2004	07/23/2004	LRMXB	355			Laurel St	Bridgewater	MA	5638856-1				REPAIR LEAKING TEE TO HOUSE 355
2	05/03/2004	07/15/2004	LRMXB	47			Lawrence Ave	Bridgewater	MA	5565253-1	Intermedt	Bare Steel	2 "	install clamp
1	05/13/2004	05/13/2004	LRMXB	32			Leonard St	Bridgewater	MA	5574995-1	Intermedt	Bare Steel	2 "	CUT OFF AND PINNED F.L. LEAKING TEE
2	09/30/2004		LRSF	40	41		Meadow Ln	Bridgewater	MA	5697708-1				
1	03/10/2004	03/10/2004	RTSNB	55			Miranda Way	Bridgewater	MA	5520646-1				Cut off leaking stub.
2	05/17/2004	06/07/2004	LRMXB	111			Mount Prospect St	Bridgewater	MA	5577439-1	Intermedt	Bare Steel	2 "	install clamp
2	05/13/2004	06/09/2004	SRERB	182			Pleasant St	Bridgewater	MA	5574627-1				renew service pin old tee weld
1	09/15/2004	09/15/2004	CDMXB	734			Pleasant St	Bridgewater	MA	5682340-1				SLIDE 8" FULL SEAL CLAMP OVER HOLE
2	05/18/2004	06/17/2004	LRMXB	25			Robin Rd	Bridgewater	MA	5578603-1				grease valve flush valve operate va
2	08/03/2004	10/07/2004	LRMXB	49			South St	Bridgewater	MA	5645686-1				REPAIRED LEAKING DRESSER ON SERVIC
1	09/02/2004	09/02/2004	CDSXB	25		133	Stonemeadow Dr	Bridgewater	MA	5671750-1				REPLACE 4' OF 1/2" PP
2	03/12/2004	03/29/2004	JXXXB					Brockton	MA	5522868-1				Leak tested and pipointed leak. Fo
1	02/02/2004	02/01/2004	SRERB	29			Allen St	Brockton	MA	5489105-1	Low	Bare Steel	1 1/4 "	leak tested and pinpointed leak, f
1	02/19/2004	02/19/2004	RTSRB	22			Annis Ave	Brockton	MA	5503557-1				cut off old 1" service , not in use
1	12/22/2004	12/20/2004	JCIXB	12			Appleton St	Brockton	MA	5779236-1				AVON SEALED 4" BELL JOINT.
1	04/06/2004	04/04/2004	LRSXB	50			Ash St	Brockton	MA	5543547-1	Low	Bare Steel	1 1/4 "	leak on service. clamped 2 1 1/4" c
1	10/27/2004	10/27/2004	SRERB	43			Auburn St	Brockton	MA	5726268-1				COMPLETE SERVICE RENEWAL INSTALLED
1	10/05/2004	10/07/2004	SRERB	173			Bartlett St	Brockton	MA	5702322-1	Low	Bare Steel	1 1/4 "	CUT IN 1.25" CURB COCK. INSERTED 1.
1	07/20/2004	07/20/2004	LRSFB	12			Bassett Rd	Brockton	MA	5633436-1				REPLACED H.P.C. IN CELLAR FOR SRVC
3	05/25/2004	01/10/2005	LRMXC				Belmont Ave	Brockton	MA	5584712-1				surveyed 1/10/05 fp/sa neg called o
1	02/06/2004	02/06/2004	SRERB	44			Belmont Ave	Brockton	MA	5493555-1				renewed 1 1/4" with 1" pp - install
2	01/08/2004	01/20/2004	JCIXB	217			Belmont Ave	Brockton	MA	5464677-1				sealed 4" joint
1	05/12/2004	05/12/2004	JXXXB	806			Belmont St	Brockton	MA	5573467-1				LEAK TESTED & PINPOINTED LEAK. FOUN
1	05/06/2004	05/06/2004	JXXXB	808			Belmont St	Brockton	MA	5568846-1				LEAK TESTED & PINPOINTED LEAK. FOUN
1	02/03/2004	02/04/2004	MRPEB				Blaine St	Brockton	MA	5490204-1				Take out 4" cast iron 4 way tee and
1	08/02/2004	08/02/2004	LRMXB	18			Boyden St	Brockton	MA	5644737-1				LEAK TESTED & PINPOINTED LEAK. INST

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
1	08/09/2004	08/09/2004	LRSXB	39			Boyden St	Brockton	MA	5650913-1				Replaced 1' of 1/2" p.p. Cst Ht li
2	07/29/2004	08/10/2004	JCIXB	133	135		Boylston St	Brockton	MA	5641628-1				leak tested and pinpointed leak. fo
2	01/22/2004	01/30/2004	JCIXB	149			Boylston St	Brockton	MA	5479295-1				sealed 8" joint
3	06/19/2004	08/28/2004	LRSFB	270			Boylston St	Brockton	MA	5607507-1				repaired leak on fit painted fit an
1	09/23/2004	09/23/2004	CDSXB	318			Boylston St	Brockton	MA	5690084-1				FIXED 1 1/4" PLASTIC SERVICE AND P.
1	06/29/2004	06/29/2004	CDSXB	159			Braemoor Rd	Brockton	MA	5615894-1				CUST. CUT 1/2" GAS SERVICE WITH HAN
1	07/14/2004	07/14/2004	SRERB	31			Broad St	Brockton	MA	5628826-1				RENEWED LEAKING 1 1/4" B.S. SERVICE
1	10/28/2004	10/28/2004	CDSXB	20			Brook St	Brockton	MA	5727524-1				INSTALLED 2 2" DRESSERS 5' 2" PLAST
1	10/05/2004	10/05/2004	SRERB	60			Brook St	Brockton	MA	5702651-1				Renewed service with 1" plastic.
1	10/04/2004	10/04/2004	LRSXB	68			Brook St	Brockton	MA	5700935-1				INSTALLED 1 1/4" HANDIBAND ON CORRO
1	10/12/2004	10/12/2004	LRMXB	80			Brook St	Brockton	MA	5709146-1	Low	Bare Steel	1 1/4 "	Repaired corrosion leak on service
2	01/14/2004	01/21/2004	JCIXB	24			Bunker Ave	Brockton	MA	5471210-1				avon sealed 4" c.i. joint
2	11/23/2004	12/06/2004	LRMXB	28			Bunker Ave	Brockton	MA	5752922-1				removed one bj clamp and installed
1	08/13/2004	08/11/2004	SRERB	103			Burkeside Ave	Brockton	MA	5654792-1	Low	Bare Steel	1 1/4 "	RENEW FROM C.C. TO METER FIT INSIDE
1	01/29/2004	01/28/2004	LRMXB	35			Byron Ave	Brockton	MA	5485579-1				installed 4" servi- seal on cracked
2	03/04/2004	03/25/2004	JXXXB	55			Byron Ave	Brockton	MA	5516271-1				Leak tested and pinpointed leak, fo
1	06/21/2004	06/21/2004	LRSFB	34			Cabot St	Brockton	MA	5608331-1				repaired fit leak
1	06/16/2004	06/16/2004	CDMXB	35		1	Cappys Way	Brockton	MA	5604059-1				REPAIRED BROKEN 2" P.P. GAS MAIN WI
1	05/10/2004	05/08/2004	SRERB	63			Carl Ave	Brockton	MA	5571489-1	Low	Bare Steel	1 1/4 "	Renew service tee to meter.
2	02/18/2004	02/24/2004	LRMXB	14			Carroll Ave	Brockton	MA	5502524-1	Low	Bare Steel	1 1/2 "	leak tested and pipointed leak- fou
1	05/14/2004	05/14/2004	LRMXB	35			Cary St	Brockton	MA	5576028-1	High	Bare Steel	6 "	CLAMP 6" MAIN.
2	07/06/2004	07/05/2004	LRMXB	85			Cary St	Brockton	MA	5621390-1	Intermedt	Bare Steel	6 "	INSTALLED 6" HANDY BAND ON B.S. MAI
2	10/18/2004	10/25/2004	LRMXB				Center St	Brockton	MA	5715299-1				found and raised 2 valves and greas
2	03/05/2004	05/12/2004	JXXXB	555			Center St	Brockton	MA	5517266-1				LEAK TESTED & PINPOINTED LEAK. FOUN
2	05/20/2004	06/05/2004	LRMXB	555			Center St	Brockton	MA	5580538-1				SEE WO#5517266 FOR DETAILS (BELL JO
2	03/01/2004	03/01/2004	JCIXB	172			Chestnut St	Brockton	MA	5512417-1				leak tested and pinpointed leak, fo
2	09/20/2004	09/22/2004	RTSRB				Clarence St	Brockton	MA	5686240-1	Low	Bare Steel	2 "	CUT OFF OLD 1 1/4" STUB GOING DOWN
2	11/02/2004	11/06/2004	JXXXB	12			Clarence St	Brockton	MA	5732359-1				repaired leaking bell joint took of
1	11/09/2004	11/06/2004	LRSXB	12			Clarence St	Brockton	MA	5739497-1				TIGHTENED NIPPLE ON SWING TEE INTO
1	10/23/2004	10/23/2004	SRERB	26			Clarence St	Brockton	MA	5722426-1				INSERTED SERVICE FROM MAIN TO INSID
1	10/22/2004	10/22/2004	CDMXB	28			Clarence St	Brockton	MA	5721072-1				RAN NEW PLASTIC SERIVE FOR TEE HPC
2	09/21/2004	10/02/2004	SRERB	50			Clarence St	Brockton	MA	5687762-1	Low	Bare Steel	1 1/4 "	renewed service tee house using 60'
1	09/20/2004	09/20/2004	CDSXB	52			Clarence St	Brockton	MA	5686528-1				HIT SERVICE. RENEWED TEE TO C.C. WI
2	03/08/2004	05/06/2004	SRERB	49			Cleveland Ave	Brockton	MA	5519043-1				leak tested and pinpointed leak. fo
2	09/17/2004	09/27/2004	JXXXB				Clifton Ave	Brockton	MA	5684569-1				installed two 12" boots one 8" boot
4	09/10/2004	09/08/2004	LRMXB	31			Clifton Ave	Brockton	MA	5678379-1				negative results
2	09/17/2004	09/23/2004	JCIXB	60			Clifton Ave	Brockton	MA	5684570-1				found 4 x 32 reducer leaking sealed
1	10/14/2004	09/21/2004	SRERB	60			Clifton Ave	Brockton	MA	5712290-1				RENEWED SERVICE TEE TO INSIDE & BOO
2	09/15/2004	09/20/2004	JCIXB	64			Clifton Ave	Brockton	MA	5682333-1				09/15/04 - Class 2 leak - probably
1	08/24/2004	08/24/2004	SRERB	124			Clifton Ave	Brockton	MA	5662846-1				found service leaking renewed with
1	09/21/2004	09/22/2004	CDSXB	133			Clifton Ave	Brockton	MA	5687641-1				INSTALLED 3' OF 1 1/4" P.P. AFTER S
4	07/28/2004	07/26/2004	LRMXB	33			Colonel Bell Dr	Brockton	MA	5640570-1				negative results
1	10/27/2004	10/25/2004	SRERB	5			Colonial Ter	Brockton	MA	5726501-1	Low	Bare Steel	1 1/4 "	RENEWED SERVICE CC TO HOUSE USING 2
2	03/04/2004	03/16/2004	RTSRB	154			Concord St	Brockton	MA	5516273-1				leak tested and pipointed leak, fou
1	10/12/2004	10/09/2004	SRERB	14			Condon St	Brockton	MA	5709312-1	Low	Bare Steel	1 1/2 "	RENEW C.C. TO HOUSE.
4	06/03/2004	06/02/2004	LRMXB				Copeland St	Brockton	MA	5593337-1				neg results
1	03/10/2004	03/10/2004	LRSFB	828			Court St	Brockton	MA	5520376-1				repaired leaks on meter fit, relit
2	09/07/2004	08/10/2004	LRSFB	94			Cross St	Brockton	MA	5674895-1				CHANGED 1 1/4" H.P.C. AND REPIPED.
1	01/19/2004	01/17/2004	LRSFB	16			Curve Ave	Brockton	MA	5476536-1	Low	Bare Steel	1 1/4 "	installed 1 1/4 h.i.c & replaced 3/
1	02/17/2004	02/17/2004	JCIXB	34			Custer St	Brockton	MA	5501341-1				leak tested and pippointed leak, fo
1	12/29/2004	12/28/2004	LRMXB	34			Davids St	Brockton	MA	5783285-1				REPAIRED CRACKED CAST IRON MAIN WIT

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
2	11/23/2004	12/10/2004	LRSFB	12			Della Ave	Brockton	MA	5753025-1				LOCATED AND RAISED CC AND INSTALLED
2	06/04/2004	06/24/2004	LRSXB	524			E Ashland	Brockton	MA	5594400-1				REMOVED KAROTEST C.C. FLO LIMITER T
3	04/20/2004	08/04/2004	LRSFB	531			East St	Brockton	MA	5554033-1				REPAIRED LEAKS BELOW H.P.C.
2	03/02/2004	03/10/2004	JCIXB				Echo St	Brockton	MA	5514069-1				leak tested and pipointed leak, fou
1	09/29/2004	09/29/2004	SRERB	86			Echo St	Brockton	MA	5696016-1	Low	Bare Steel	3 "	Installed 1 1/4" curb cock o.k. Ins
2	06/23/2004	07/19/2004	LRMXB	52			Edgar St	Brockton	MA	5610377-1	Intermedt	Bare Steel	2 "	leak tested and pinpointed leak. fo
2	04/22/2004	05/19/2004	JXXXB	38			Ellsworth Ave	Brockton	MA	5556254-1				SEAL ONE 6" JOINT.
1	03/04/2004	03/03/2004	LRSXB	10			Ellsworth St	Brockton	MA	5515880-1				Replace 1 1/4 HPC and swing fit.
1	06/17/2004	06/17/2004	SRERB	29			Emmet St	Brockton	MA	5605617-1	Low	Bare Steel	1 1/4 "	RENEWED SERVICE C.C. TO END W/ 1" P
2	02/17/2004	02/23/2004	JCIXB	88			Emmet St	Brockton	MA	5501662-1				sealed 6" joint.
2	02/27/2004	03/22/2004	JXXXB				Fairmount Ave	Brockton	MA	5510633-1				Leak tested and pinpointed leak, fo
1	05/28/2004	05/28/2004	LRSFB	4			Fairmount Ave	Brockton	MA	5588476-1	Low	Bare Steel	1 1/4 "	REPAIRED LEAK ON INSIDE FIT.
2	01/12/2004	01/20/2004	LRMXB	33			Fenway Cir	Brockton	MA	5468834-1				loaking at poss loc tightened up st
1	07/23/2004	07/23/2004	CDSXB	9			Fieldstone Dr	Brockton	MA	5636879-1				REPAIRED HIT 1/2" P.P. SERVICE.
1	12/10/2004	12/10/2004	RTSRB	112			Florence St	Brockton	MA	5768865-1				cut service off of main wall leak.
2	01/07/2004	01/23/2004	JCIXB				Forest Ave	Brockton	MA	5463403-1				avon sealed 6" bell joint
2	02/10/2004	02/23/2004	JCIXB				Forest Ave	Brockton	MA	5496222-1				repaired leak using 1-6" avon seal
2	03/04/2004	04/09/2004	JXXXB				Forest Ave	Brockton	MA	5516277-1				leak tested and pinpointed leak. fo
2	02/04/2004	02/12/2004	SRERB	265			Forest Ave	Brockton	MA	5491420-1				renew 1 1/4' bs service- w/ 1" pp
2	03/04/2004	04/16/2004	JXXXB	380			Forest Ave	Brockton	MA	5516281-1				LEAK TESTED & PINPOINTED LEAK. FOUN
1	09/08/2004	09/08/2004	CDSXB				Forest Rd	Brockton	MA	5676286-1				INSTALLED 2 - 2" CLAMPS. SKETCH ON
1	08/12/2004	08/12/2004	RTSNB	128			Forest St	Brockton	MA	5653894-1	Low	Bare Steel	1 1/2 "	Cut in c.c. and cut service off @ c
2	07/20/2004	08/03/2004	JXXXB	82			Foster St	Brockton	MA	5633369-1				REMOVED LEAKING MECHANICAL COUPLING
2	01/22/2004	02/09/2004	SRERB	46			Frankton Ave	Brockton	MA	5479302-1				Renewed 1 1/4" steel service with
3	01/22/2004	03/21/2005	JXXXB				French Ave	Brockton	MA	5479307-1				encapsulated 2- 4" ci joints. leaki
1	02/17/2004	02/17/2004	JCIXB	71	73		French Ave	Brockton	MA	5501307-1				Avon sealed 6" bell joint street to
1	01/29/2004	01/29/2004	LRMXB	7			Garden Rd	Brockton	MA	5485582-1				installed 4" full seal CI on main i
1	10/14/2004	10/14/2004	SRERB	23			Gardner Ave	Brockton	MA	5711912-1	Intermedt	Bare Steel	1 1/4 "	RENEWED CURB COCK TO END WITH 100 P
3	10/15/2004	10/16/2004	LRSFB	35			Glendale Ave	Brockton	MA	5713270-1				REPAIRED LEAK ON OUTSIDE METER FIT.
2	01/08/2004	01/22/2004	JCIXB				Goddard Rd	Brockton	MA	5464682-1				sealed 2-4" joints also installed 4
2	02/04/2004	02/17/2004	JCIXB				Grafton St	Brockton	MA	5491422-1				sealed 2 8" bell joints and soap te
1	02/09/2004	02/08/2004	SRERB	11			Grafton St	Brockton	MA	5495074-1	Low	Bare Steel	1 "	inserted service with 5" pp per W>
1	09/07/2004	09/07/2004	JCIXB	25			Grafton St	Brockton	MA	5674787-1				INSTALLED AVON SEAL BOOT ON 4" C.I.
1	02/18/2004	02/17/2004	RTSRB	53			Grafton St	Brockton	MA	5502291-1				Cut off at main.
1	02/23/2004	02/17/2004	LRMXB	55			Grafton St	Brockton	MA	5506057-1				Repaired crack with servi seal 4" C
1	08/24/2004	08/24/2004	LRSFB	77			Grafton St	Brockton	MA	5662872-1				repaired inside fit leak
4	07/01/2004	06/25/2004	LRMXC	243			Grafton St	Brockton	MA	5618444-1				negative results
1	09/27/2004	09/27/2004	SRERB	302			Grafton St	Brockton	MA	5693459-1				INSTALLED 1 1/4" CURB COCK IN LAWN.
1	09/14/2004	09/13/2004	LRSFB	65			Grant Ave	Brockton	MA	5681262-1				REMADE FIT.
1	01/22/2004	01/22/2004	SRERB	274			Green St	Brockton	MA	5479148-1				found 2" service leaking to # 271,
2	02/06/2004	02/12/2004	SRERB	275	277		Green St	Brockton	MA	5493833-1				renewed svc across street installed
2	03/04/2004	03/04/2004	SRERB	282			Green St	Brockton	MA	5516027-1				leak tested and pinpointed leak, fo
1	04/27/2004	04/27/2004	LRSFB	25			Greenbriar Rd	Brockton	MA	5559980-1				REPLACED H.P.C. & METER FIT & REG.
1	11/12/2004	11/12/2004	RTSRB	30			Greenfield	Brockton	MA	5743108-1	Low	Bare Steel	2 "	CUT OFF HIT TUB SERVICE WITH 1 1/4"
2	03/04/2004	03/16/2004	JXXXB	30			Hampden Ave	Brockton	MA	5516289-1				Leak tested and pinpointed leak, fo
3	07/17/2004	08/04/2004	LRSFB	35			Harold St	Brockton	MA	5631940-1				FOUND RISER LEAKING, CUT DOWN & RE-
1	03/10/2004	03/10/2004	LRSXB	34			Harvard St	Brockton	MA	5520793-1				Repaired pp svc where kinked.
1	07/30/2004	07/30/2004	SRERB	18			Hazel St	Brockton	MA	5642982-1	Low	Bare Steel	1 1/4 "	CUT IN 1 1/4" C.C. AND INSERTED 1"
2	02/24/2004	02/25/2004	SRERB	79			Herrod Ave	Brockton	MA	5507100-1				installed 6" servi seal clamp onCI
2	02/23/2004	02/26/2004	JCIXB	88	90		Highland St	Brockton	MA	5506131-1				sealed 4" CI joint.
2	02/23/2004	03/01/2004	JCIXB	104			Highland St	Brockton	MA	5506213-1				sealed leaking 4" joint.

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
2	01/23/2004	02/11/2004	SRERB	107			Highland St	Brockton	MA	5480259-1				leak tested and pinpointed leak. fo
1	08/17/2004	08/13/2004	LRSFB	130			Highland St	Brockton	MA	5657111-1				replaced inside swivel fit and inst
2	03/12/2004	03/30/2004	JXXXB	186			Highland St	Brockton	MA	5522909-1				leak tested and pinpointed leak. fo
1	02/05/2004	02/05/2004	LRSXB	67			Highland Ter	Brockton	MA	5492674-1				replaced service seal clamp and fit
1	07/22/2004	07/22/2004	RTSRB	95			Hillberg Ave	Brockton	MA	5635759-1	Low	Bare Steel	1 1/4 "	CUT OFF SRVC - BROKEN IN STREET - P
1	12/17/2004	12/17/2004	RTSRB	101			Hillberg Ave	Brockton	MA	5775040-1	Low	Bare Steel	1 1/4 "	cut off 1 1/4" service at 4" ci mai
1	03/01/2004	03/01/2004	LRMXB	132			Hillberg Ave	Brockton	MA	5512595-1				leak tested and pinpointed leak, fo
1	07/15/2004	07/15/2004	SRERB	72			Hillside Ave	Brockton	MA	5630071-1	Low	Bare Steel	1 1/4 "	RENEWED PIPE FROM C.C. TO METER FIT
1	07/08/2004		LRSF	68			Hollis St	Brockton	MA	5623997-1				
1	07/01/2004	07/01/2004	SRERB	199			Hovendon Ave	Brockton	MA	5618202-1	Low	Bare Steel	1 1/4 "	RENEW SERVICE FROM CURB COCK INTO H
2	02/13/2004	02/14/2004	SRERB	20			Howard Sq	Brockton	MA	5499546-1				renewed service P.I. 4" servi seal
2	02/27/2004	03/16/2004	LRMXB	78			Huntington St	Brockton	MA	5510560-1				Drilled holes and tested, ery sligh
2	03/29/2004	06/15/2004	JCIXB	78			Huntington St	Brockton	MA	5536219-1				leak tested and pinpointed leak. fo
1	08/11/2004	08/11/2004	LRMXB	51			Irving St	Brockton	MA	5652651-1	Intermedt	Bare Steel	1 1/4 "	Installed 1 1/4" handiband clamp.
3	07/28/2004	10/01/2004	LRSFB	40		0	Ithaca Rd	Brockton	MA	5640828-1	Intermedt	Bare Steel	3/4 "	greased hp cock soap test meter fit
1	12/16/2004	12/16/2004	SRERB	25			James St	Brockton	MA	5773925-1				cut in curb cock and insert with 1"
1	01/05/2004	01/04/2004	SRERB	31			Johnson St	Brockton	MA	5460953-1	Low	Bare Steel	1 1/4 "	renewed from c.c. to house, susing
4	01/12/2004	01/01/2004	SRERB	8			Juneau Rd	Brockton	MA	5468220-1				Renewed service from cc to house wi
2	09/22/2004	09/25/2004	LRMXB	40			Juneau Rd	Brockton	MA	5689181-1				REPAIR LEAKING VALVE.
1	06/16/2004	06/16/2004	SRERB	24			Keith Ave	Brockton	MA	5604341-1	Low	Bare Steel	1 1/4 "	INSTALLED 1 1/4" C.C. AND RENEWED S
1	06/23/2004	06/23/2004	LRSFB	30			Keswick Rd	Brockton	MA	5610497-1				Repair fit leak.
1	07/09/2004	07/09/2004	SRERB	29			Leavitt St	Brockton	MA	5625094-1	Low	Bare Steel	1 1/4 "	Installed 1 1/4" c.c. & insert to i
1	08/03/2004	08/02/2004	SRERB	46			Leavitt St	Brockton	MA	5645701-1	Low	Bare Steel	1 1/4 "	RENEW GAS SERVICE C.C. TO HOUSE.
1	02/02/2004	02/02/2004	JCIXB	22			Legion Pky	Brockton	MA	5489358-1				dug out leaking 12" bell joint, 4 c
2	03/05/2004	03/12/2004	LRMXB	22			Legion Pky	Brockton	MA	5517256-1				12" split servi sealed by Old Keyst
2	02/24/2004	03/15/2004	JXXXB				Lenox St	Brockton	MA	5506895-1				Leak tested and pipointed leak, fou
1	06/30/2004	06/30/2004	LRSXB	28			Leyden St	Brockton	MA	5616722-1	Intermedt	Bare Steel	1 1/4 "	CUT IN 1 1/4" COMPRESSION CURB COCK
2	10/28/2004	11/16/2004	LRMXB	130			Liberty St	Brockton	MA	5727638-1	Intermedt	Bare Steel	6 "	2 existing 6" clamps were leaking.
2	02/03/2004	02/15/2004	LRMXB	30			Linwood St	Brockton	MA	5490427-1	Low	Bare Steel	2 "	repaired 2 leaks using 2-2" handy b
4	11/10/2004	11/30/2004	LSMXB				Main Leak Survey	Brockton	MA	5740871-1				
4	11/10/2004		LSMX				Main Leak Survey	Brockton	MA	5740871-3				
4	11/10/2004		LSMX				Main Leak Survey	Brockton	MA	5740871-5				
2	09/29/2004	09/30/2004	JCIXB				Main St	Brockton	MA	5695858-1				INSTALLED ONE 12" AVON BOOT.
1	09/17/2004	09/17/2004	LRSFB	157			Main St	Brockton	MA	5684445-1				REPLACED RISER.
1	08/05/2004	08/05/2004	JCIXB	335			Main St	Brockton	MA	5648298-1				LEAK TESTED & PINPOINTED LEAK. FOUN
1	10/08/2004	10/08/2004	LRSXB	1085			Main St	Brockton	MA	5707013-1				SHORTEN LEAKING STUB INSTALLED CC O
2	10/13/2004	11/01/2004	JCIXB	1108			Main St	Brockton	MA	5710651-1				leak tested and pinpointed leak. fo
1	09/13/2004	09/13/2004	LRMXB				Manomet St	Brockton	MA	5679905-1	Intermedt	Bare Steel	2 "	LEAK TESTED & PINPOINTED LEAK. FOUN
2	09/27/2004	09/30/2004	LRMXB				Manomet St	Brockton	MA	5693604-1	Intermedt	Bare Steel	2 "	installed 5 2" handy band clamps on
2	02/05/2004	03/03/2004	LRMXB	151			Manomet St	Brockton	MA	5492612-1	Intermedt	Bare Steel	6 "	installed 6" handi band clamp.
2	01/07/2004	01/23/2004	LRMXB	153			Manomet St	Brockton	MA	5463378-1	Intermedt	Bare Steel	2 "	leak tested and pinpointed leak, fo
1	05/25/2004	05/25/2004	CDMXB	43			Massasoit Ave	Brockton	MA	5584591-1				CUT OUT SMALL HOLE & PUT DRESSER CO
1	07/21/2004	07/20/2004	SRERB	29			May Ave	Brockton	MA	5634776-1	Low	Bare Steel	1 1/4 "	RENEW FROM P.L. TO CELLAR, PER SUPE
1	07/19/2004	07/19/2004	LRSFB	15			Mellen St	Brockton	MA	5632595-1				REPLACED LEAKING SHUT OFF INSIDE.
2	08/23/2004	09/23/2004	JCIXB				Montello St	Brockton	MA	5662124-1				avon sealed 12" joint
1	10/28/2004	10/28/2004	LRSFB	148			Montello St	Brockton	MA	5727721-1				SHUT GAS OFF REPAIRED LEAK BELOW HP
1	12/18/2004	12/16/2004	JCIXB	583			Montello St	Brockton	MA	5775992-1				Put 12" boot on 12" joint, it was 1
1	12/22/2004	12/16/2004	JXXXB	585			Montello St	Brockton	MA	5779234-1				12" boot on 12" main.
2	03/02/2004	04/07/2004	JXXXB	847			Montello St	Brockton	MA	5514091-1				removed leaking clamp sealed 12" jo
2	03/02/2004	04/07/2004	SRERB	908			Montello St	Brockton	MA	5514089-1				leak tested & pinpointed leak. foun
1	03/29/2004	03/29/2004	LRSFB	11			Moraine St	Brockton	MA	5535988-1				Repair fit leak.

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
2	10/28/2004	11/09/2004	JCIXB	58			Moraine St	Brockton	MA	5727634-1				encapsulated 4" joint leaking.
2	03/04/2004	04/15/2004	SRERB	12			Morrison Rd	Brockton	MA	5516291-1				cut off service and welded.inserted
1	07/12/2004	07/12/2004	SRERB	27			Moulton St	Brockton	MA	5626629-1				RENEWED SERVICE TEE TO INSIDE WITH
2	03/04/2004	03/30/2004	JXXXB				Myrtle St	Brockton	MA	5516293-1				leak tested and pinpointed leak. fo
1	07/28/2004	07/28/2004	SRERB	97			Myrtle St	Brockton	MA	5640808-1				RENEWED SVC FROM MAIN TO INSIDE HOU
1	02/18/2004	02/18/2004	LRSFB	119			Myrtle St	Brockton	MA	5502377-1				fixed small crack on inside fit.
2	03/04/2004	04/16/2004	JXXXB	144			Myrtle St	Brockton	MA	5516295-1				sealed 6" joint
1	02/10/2004	02/10/2004	SRERB	4			N Arlington St	Brockton	MA	5496806-1	Low	Bare Steel	1 1/4 "	found service leaking, renewed comp
1	02/19/2004	02/19/2004	LRSXB	4			N Arlington St	Brockton	MA	5503626-1				purged from previous class one leak
2	01/23/2004	01/29/2004	JCIXB	11			N Arlington St	Brockton	MA	5480267-1				Installed 4" PLCS kit on leaking be
2	03/12/2004	04/06/2004	SRERB	12			N Arlington St	Brockton	MA	5522905-1				inserted service back inside with 1
1	04/22/2004	04/22/2004	RTSRB	10			N Belcher Ave	Brockton	MA	5555934-1				CUT OFF NON USER AT 4" C.I. LONG SI
1	05/07/2004	05/07/2004	SRERB	998			N Main St	Brockton	MA	5569972-1	Low	Bare Steel	1 1/4 "	LEAK TESTED & PINPOINTED LEAK. fOUN
1	07/19/2004	07/19/2004	SRERB	593			N Montello St	Brockton	MA	5632818-1	Low	Bare Steel	1 1/4 "	RENEW FROM P.L. TO RISER. PUT RISER
1	02/02/2004	02/04/2004	LRMXB				N Bassett Rd	Brockton	MA	5489363-1				found 19% at foundation and 45% 15
1	02/20/2004	02/02/2004	LRMXB				N Bassett Rd	Brockton	MA	5504513-1				Leak tested and pinpointed leak, fo
1	11/26/2004	11/10/2004	LRMXB				N Cary St	Brockton	MA	5755224-1				REPAIRED 2 INCH C.S. VALVE LEAKING,
2	01/07/2004	01/31/2004	JCIXB				N Main St	Brockton	MA	5463431-1				avon sealed 12" bell joint
2	02/27/2004	04/12/2004	JCIXB				N Main St	Brockton	MA	5510591-1				removed leaking old split sleeve fr
2	02/03/2004	02/11/2004	JCIXB	324	330		N Main St	Brockton	MA	5490403-1				Avon sealed 1-4" joint
2	03/02/2004	04/08/2004	JXXXB	798	810		N Montello St	Brockton	MA	5514076-1				CLAMPED LEAKING 8" C.I. JOINT.
2	02/03/2004	02/10/2004	JCIXB				Nason St	Brockton	MA	5490437-1				found bell joint leaking, sealed jo
2	08/17/2004	09/15/2004	LRMXB				Oak Hill Way	Brockton	MA	5657024-1				Greased valve o.k. No readings or s
3	10/30/2004		LRSF	135			Oak Hill Way	Brockton	MA	5730268-1				
2	02/09/2004	02/19/2004	LRSFB	100			Oak St	Brockton	MA	5495335-1				greased 1 1/4 H.P.C. to fix leak.
1	05/14/2004	05/14/2004	RTSNB	770			Oak St	Brockton	MA	5575877-1				SHUT OFF VALVE AND CUT SRVC BACK FO
2	02/11/2004	02/17/2004	LRSFB				Oakdale St	Brockton	MA	5497381-1				replaced leaking valve inside
1	08/27/2004	08/28/2004	SRERB	22			Oakdale St	Brockton	MA	5666888-1	Intermedt	Bare Steel	1 1/4 "	renewed leaking 1 1/4 bare steel p
2	01/12/2004	01/26/2004	JCIXB				Oakland Ave	Brockton	MA	5468815-1				SEALED 2-4" JOINTS C. MATHEWS WORKI
2	01/12/2004	01/26/2004	JCIXB				Oakland Ave	Brockton	MA	5468828-1				leak tested and pinpointed leak, fo
1	02/09/2004	02/07/2004	RTMXB	16			Oakland Pl	Brockton	MA	5495071-1				cut off 18" of 2" WI Main with 3/
1	02/26/2004	02/26/2004	LRSFB	887			Old Ash St	Brockton	MA	5509583-1				Neg. leak -svc. man repaired heater
1	06/11/2004	06/11/2004	SRERB	33	35		Oneida Ave	Brockton	MA	5600472-1				RENEWED SRVC FROM TEE TO INSIDE WIT
1	05/27/2004	05/26/2004	RTSRB	12			Packard St	Brockton	MA	5587303-1				cut off 1 1/4" service at main & in
1	01/27/2004	01/27/2004	SRERB	78			Packard Way	Brockton	MA	5483331-1	Low	Bare Steel	1 1/4 "	RENEWED SERVICE USING 34' 1' P.P.
1	10/07/2004	10/07/2004	SRERB	133			Packard Way	Brockton	MA	5705872-1	Low	Bare Steel	1 1/4 "	CUT IN 1.25 CURB COCK. INSERTED 1.0
1	02/26/2004	02/26/2004	LRMXB	19			Palmer St	Brockton	MA	5509863-1				found 4" C.I. cracked, installed 4"
2	03/11/2004	03/15/2004	LRMXB	529			Pearl St	Brockton	MA	5521920-1				Greased valve.
1	06/15/2004	06/15/2004	CDSXB	1014			Pearl St	Brockton	MA	5602937-1				REPAIRED HIT SERVICE.
2	02/27/2004	03/30/2004	JXXXB				Perkins Ave	Brockton	MA	5510645-1				Sealed 4" joint.
2	09/22/2004	11/01/2004	LRMXB				Perkins Ave	Brockton	MA	5689180-1				found cracked main and avon boot le
1	01/20/2004	01/21/2004	JCIXB	31			Perkins Ave	Brockton	MA	5477133-1				leak tested and pinpointed leak, fo
2	12/23/2004	01/04/2005	RTSRB	67			Perkins Ave	Brockton	MA	5780060-1				found old stub leaking cut off at m
1	12/06/2004	12/05/2004	SRERB	17			Pine St	Brockton	MA	5764345-1				RE-NEWED MAIN TO ORIGINAL C.C. REPL
2	06/15/2004	07/06/2004	LRMXB	671			Plain	Brockton	MA	5603120-1				clamped 6" main using 1 6" handy ba
1	07/28/2004	07/28/2004	LRMXB	671			Plain	Brockton	MA	5640733-1				installed 6" clamp
2	07/20/2004	07/26/2004	LRMXB	671			Plain	Brockton	MA	5633373-1	Intermedt	Bare Steel	6 "	leak tested and pinpointed leak. fo
2	01/08/2004	02/24/2004	LRMXB	671			Plain St	Brockton	MA	5464612-1		Bare Steel	6 "	installed 2 6x9 handi band clamps.
2	08/13/2004	01/31/2005	LRMXB	671			Plain St	Brockton	MA	5654639-1				cancel - main abandoned
1	11/30/2004	11/30/2004	RTSNB	708			Plain St	Brockton	MA	5757756-1	Intermedt	Bare Steel	6 "	found tee leaking. cut off at main.
1	11/13/2004	11/09/2004	CDMXB				Pleasant St	Brockton	MA	5744191-1				INSTALLED 2" HANDY BAND ON 2" WI

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
2	11/08/2004	01/07/2005	SRERB	331			Pleasant St	Brockton	MA	5738584-1				renewed svc with 1 1/4" pp insert b
2	12/14/2004	12/22/2004	SRERB	385			Pleasant St	Brockton	MA	5771599-1				renewed service from tee to cc whe
1	12/09/2004	12/09/2004	SRERB	461	463		Pleasant St	Brockton	MA	5768030-1	Low	Bare Steel	1 1/4 "	wall leak. cut in curb cock at prop
1	11/16/2004	11/16/2004	RTSRB	530		0	Pleasant ST	Brockton	MA	5746109-1				Cut off stub srvc at main with 1" p
1	11/13/2004	11/12/2004	CDSXB	555			Pleasant St	Brockton	MA	5744177-1				CUT OFF STUB SERVICE AT MAIN & INST
1	11/13/2004	12/26/2004	RTSNB	587			Pleasant St	Brockton	MA	5744173-1	Low	Bare Steel	1 1/4 "	Repaired broken, inactivated servic
2	02/24/2004	03/15/2004	SRERB	9			Prospect Ave	Brockton	MA	5506890-1				Renewed 2" B.S. service, also seale
1	12/17/2004	12/17/2004	LRMXB	21			Provost St	Brockton	MA	5775050-1				install new permaset curb cock
1	05/03/2004	05/03/2004	LRSFB	10			Raymond Rd	Brockton	MA	5565405-1				rebuilt meter fit located and raise
1	02/19/2004	02/19/2004	CDSXB	253			Richmond St	Brockton	MA	5503350-1				repaired 1/2" pp broken service rep
1	08/28/2004	08/24/2004	SRERB	30			River St	Brockton	MA	5667847-1	Low	Bare Steel	2 "	Renew service main to house 14 ft 1
4	02/02/2004	03/01/2004	LSSXB				Service Leak Survey	Brockton	MA	5489068-1				
1	07/13/2004	07/13/2004	LRSFB	150			Short St	Brockton	MA	5627603-1				REPLACED METER FIT.
1	12/15/2004	12/15/2004	CDMXB	10			Silver Rd	Brockton	MA	5772636-1				Broken main. Installed one 4' x 12'
1	12/02/2004	12/02/2004	CDSXB	37			Silver Rd	Brockton	MA	5760320-1	Low	Bare Steel	1 1/4 "	cut off old 1 1/4" service using 1
2	03/05/2004	03/26/2004	JXXXB	15			Skinner St	Brockton	MA	5517258-1				Leak tested and pipointed leak, fou
1	11/04/2004	11/04/2004	CDSXB	346			Spring St	Brockton	MA	5735253-1				FOUND 2" STUB SRVC BROKEN AT MAIN.
2	12/08/2004	12/08/2004	LRMXB	93			Summer St	Brockton	MA	5766502-1	Intermedt	Bare Steel	6 "	leak tested & pinpointed leak. foun
2	12/07/2004	12/14/2004	LRMXB	112			Summer St	Brockton	MA	5765632-1	Intermedt	Bare Steel	8 "	leak tested and pinpointed leak. fo
1	12/03/2004	12/03/2004	LRMXB	123			Summer St	Brockton	MA	5762344-1	High	Bare Steel	6 "	installed one 6" handy band
2	02/24/2004	04/12/2004	JXXXB				Sycamore Ave	Brockton	MA	5506898-1				leak tested and pinpointed leak fou
2	03/08/2004	03/30/2004	JXXXB	18			Sycamore St	Brockton	MA	5519052-1				Sealed 3-4" joints.
3	01/13/2004	03/05/2004	LRSFB	215			Thatcher St	Brockton	MA	5469925-1				repaired lock on riser
2	06/18/2004	07/02/2004	JCIXB	59			Thorney Lea Ter	Brockton	MA	5606720-1				leak tested and pinpointed leak. fo
4	06/03/2004	06/01/2004	LRMXB	68			Thorny Lea Ter	Brockton	MA	5593333-1				neg results
2	05/15/2004	05/12/2004	SRERB	15			Torrey St	Brockton	MA	5576876-1	Low	Bare Steel	2 "	RENEWED FROM CURB IN, MUST RENEW AT
2	03/10/2004	05/05/2004	MRPEB	586			Torrey St	Brockton	MA	5520613-1	Intermedt	Bare Steel	6 "	Installed 21-6" p.c.'s, made 6" pla
2	05/10/2004	05/13/2004	JXXXB				Track St	Brockton	MA	5571458-1				LEAK TESTED & PINPOINTED LEAK. FOUN
1	09/28/2004	09/28/2004	LRSFB	224			Tribou St	Brockton	MA	5694678-1				installed new hpc and refit pipe an
2	02/03/2004	02/10/2004	JCIXB	47			Tripp Ave	Brockton	MA	5490433-1				leak tested and pipointed leak, fou
1	07/16/2004	07/16/2004	SRERB	57			Verne St	Brockton	MA	5630987-1	Low	Bare Steel	1 1/4 "	INSERTED 1 1/4" B.S. WITH 1" P.P. F
1	06/24/2004	06/24/2004	LRSFB	12	14		Vesey St	Brockton	MA	5611878-1				REPAIR LEAK AT H.P.C.
1	06/25/2004	06/25/2004	SRERB	12	14		Vesey St	Brockton	MA	5612964-1	Low	Bare Steel	1 1/4 "	RENEW FROM C.C. TO CELLAR WITH 15'
2	08/11/2004	08/23/2004	JXXXB	166			W Chestnut St	Brockton	MA	5652681-1				leak tested and pinpointed leak. re
1	10/13/2004	10/12/2004	CDSXB	970			W Chestnut St	Brockton	MA	5710622-1				REPAIR BROKEN 1 1/4" PLASTIC SERVIC
2	02/10/2004	02/11/2004	LRMXB	530			W Elm St	Brockton	MA	5496199-1				fouund cracked main on 4" CI, repai
1	02/02/2004	02/02/2004	LRMXB	564			W Elm St	Brockton	MA	5488934-1				leak tested and pinpointed leak, fo
1	05/14/2004	05/14/2004	LRMXB				W Chestnut St	Brockton	MA	5576146-1	Intermedt	Bare Steel	6 "	LEAK ON 6" MAIN, USED 1 - 6" X 6" B
2	08/13/2004	08/18/2004	JXXXB	150			W Chestnut St	Brockton	MA	5654798-1				leak tested and pinpointed leak. fo
2	02/05/2004	02/09/2004	LRSFB	234			W Elm St	Brockton	MA	5492496-1				repaired leak on riser.
2	02/06/2004	02/19/2004	RTSRB	468			W Elm St	Brockton	MA	5493835-1				sealed 1-6" joint and also cut off
1	08/18/2004	02/19/2004	JCIXB	468			W Elm St	Brockton	MA	5658225-1				see wo 5493835 for details 1-6" be
2	05/12/2004	05/18/2004	SRERB	359			Warren Ave	Brockton	MA	5573537-1				INSERTED OLD 1 1/4" SRVC WITH 1" P.
2	05/12/2004	05/17/2004	JCIXB	411			Warren Ave	Brockton	MA	5573542-1				FOUND SEALED BELL JOINT LEAKING. RE
2	05/10/2004	05/17/2004	SRERB	438			Warren Ave	Brockton	MA	5571456-1				RENEWED SRVC TO 436-438 WITH 1" P.P
2	05/12/2004	05/19/2004	SRERB	486			Warren Ave	Brockton	MA	5573546-1				RENEWED SERVICE TEE TO C.C.
1	10/18/2004	10/17/2004	RTSRB	551			Warren Ave	Brockton	MA	5715293-1	Low	Bare Steel	1 1/2 "	FOUND 1 1/2 PIPE LEAKING CUT OFF &
2	09/14/2004	10/23/2004	JXXXB				West St	Brockton	MA	5681249-1				removed existing (leaking) encapula
2	05/10/2004	05/27/2004	JCIXB	24			Weston St	Brockton	MA	5571703-1				LEAK TESTED & PINPOINTED LEAK. FOUN
2	01/12/2004	01/19/2004	JCIXB	15			Wheeler Ave	Brockton	MA	5468889-1				leak tested and pinpointed leak, fo
2	01/12/2004	02/05/2004	JXXXB	95			Wheeler Ave	Brockton	MA	5468896-1				leak tested and pipointed leak, fou

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
2	02/23/2004	02/25/2004	SRERB	38			Wilmington St	Brockton	MA	5506318-1				Renewed and relocated old leaking s
2	06/30/2004	07/22/2004	LRMXB	346			Winter St	Brockton	MA	5617028-1				leak tested and pinpointed leak. fo
2	11/22/2004	12/04/2004	SRERB	200	206		Woodard Ave	Brockton	MA	5751824-1				renew leaking service from main to
2	12/16/2004	01/03/2005	SRERB	220			Woodard Ave	Brockton	MA	5773830-1				renewed service with 1/2" pp elimin
2	03/08/2004	04/10/2004	SRERB	99			Woodland Ave	Brockton	MA	5519054-1				installed 4" servi seal at main. re
1	07/28/2004	07/28/2004	LRSFB	4			Woodside Ave	Brockton	MA	5640571-1				RAISED CURB BOX FOR REPAIR OF INSID
1	12/28/2004	12/28/2004	LRSXB	5	6		Brayton Cir	Canton	MA	5782521-1				LEAK ON NUTS OF COMP CURB COCK TIGH
1	12/22/2004	12/24/2004	LRSXB	9			Brayton Cir	Canton	MA	5779312-1				REPAIRED LEAK AT COMPRESSION CC
2	01/29/2004	02/17/2004	LRMXB	30			Brooksweld Rd	Canton	MA	5485848-1	Intermedt	Bare Steel	2 "	installed 2"x6" band clamp
2	07/06/2004	07/24/2004	LRMXB	36			Brooksweld Rd	Canton	MA	5621699-1	Intermedt	Bare Steel	2 "	INSTALLED 9 2" CLAMPS ON BS MAIN
2	07/29/2004	07/30/2004	LRMXB	36			Brooksweld Rd	Canton	MA	5641629-1				4 2 x 6 clamps and 9 others existin
1	09/23/2004	09/20/2004	LRSFB	119			Capper Dr	Canton	MA	5690001-1				LEAK AT RISER ON TEE FIXED & RELIT
3	09/14/2004	10/25/2004	LRSFB	64			Cedarcrest Rd	Canton	MA	5681257-1				new pipe work and new meter fit ins
1	02/06/2004	02/06/2004	LRSXB	138			Chapman St	Canton	MA	5493660-1				removed kero test, curb cock instal
1	03/24/2004	03/24/2004	LRSFB	12			Charles Dr	Canton	MA	5532035-1				Replaced inside swing fit.
3	03/12/2004	03/25/2004	LRSFB	11			Country Ln	Canton	MA	5522557-1				Located, blew out, raised curb box
1	03/01/2004	03/01/2004	LRSFB	7			Cynthia Rd	Canton	MA	5512756-1				Repaired fit leak located and raise
2	01/29/2004	04/20/2005	LRMXB	21			Cynthia Rd	Canton	MA	5485847-1				installed 2 inch handiband clamp on
2	12/09/2004	12/18/2004	SRERB	1			Dewitt Ave	Canton	MA	5767963-1	Intermedt	Bare Steel	1 1/2 "	renewed service to #1 dweitt ave. f
1	03/29/2004	03/29/2004	LRSFB	39			Elm St	Canton	MA	5536082-1				Located, dug and raised c.c. box an
1	03/17/2004	03/17/2004	LRSFB	14			Fencourt Rd	Canton	MA	5526359-1				located and raised c.c. box, change
1	03/29/2004	03/27/2004	LRSFB	10			Greenbriar Rd	Canton	MA	5535721-1				Redo fit (inside fit).
2	09/03/2004	09/14/2004	LRMXB	14			Greenbriar Rd	Canton	MA	5673163-1				INSTALLED 2" X 6" HANDIBAND CLAMP O
1	03/30/2004	03/30/2004	LRSFB	8			Historical Way	Canton	MA	5537128-1				Located raised curb cock box, repai
2	08/17/2004	08/20/2004	LRMXB	15			Kempley St	Canton	MA	5657020-1				removed and replaced 1 1/4 band cla
2	10/18/2004	10/20/2004	LRSFB	8			Kings Rd	Canton	MA	5715292-1				replaced leaking fit
1	04/06/2004	04/06/2004	LRSFB	29			Kings Rd	Canton	MA	5543455-1				repaired inside fit leak
2	04/07/2004	04/07/2004	LRSFB	34			Kings Rd	Canton	MA	5544487-1				replace hpc and meter fit and vent
1	03/25/2004	03/24/2004	LRSFB	4			Kirby Dr	Canton	MA	5532839-1				Repaired inside fit leak.
2	07/22/2004	07/26/2004	LRMXB	6			Lawrence St	Canton	MA	5635864-1	Intermedt	Bare Steel	2 "	FOUND WELDED PIN FROM OLD CUT OFF L
1	12/22/2004	12/19/2004	LRMXB	90			Lawrence St	Canton	MA	5779239-1	Intermedt	Bare Steel	2 "	INSTALLED 2" HANDY BAND ON BS MAIN
2	04/21/2004	07/06/2004	LRSXB	195			Lawrence St	Canton	MA	5554953-1	Intermedt	Bare Steel	2 "	found tee to #195 leaking. pinned o
1	04/21/2004	04/18/2004	LRSXB	211			Lawrence St	Canton	MA	5554858-1	Intermedt	Bare Steel	1 "	REPLACED LEAKING CC 18" 1/2" PP ONE
1	02/27/2004	02/27/2004	LRSFB	7			Lexington St	Canton	MA	5510845-1				blew out C.B. and replaced inside s
1	04/09/2004	04/09/2004	LRSFB	2			Marilyn Dr	Canton	MA	5546801-1				repaired leaking fits
1	03/19/2004	03/19/2004	LRSFB	114			Mechanic St	Canton	MA	5528439-1				Located raised, blew out c. cock, c
2	04/13/2004	04/13/2004	LRSFB	205			Mechanic St	Canton	MA	5549070-1				REPAIRED LEAKING FIT
2	11/22/2004	11/27/2004	LRMXB				Neponset St	Canton	MA	5751831-1	Intermedt	Bare Steel	3 "	greased valve
2	08/18/2004	08/24/2004	SRERB	137			Norfolk St	Canton	MA	5658140-1	Intermedt	Bare Steel	2 "	renewed serv from tee to prop line
1	02/11/2004	02/11/2004	LRSFB	27			Old Coach Rd	Canton	MA	5497413-1				changed fit, repaired leaks, locate
1	05/06/2004	05/06/2004	CDSXB	15			Old Meadow Ln	Canton	MA	5568857-1				REPAIR 1/2" PP BORKEN SERVICE
1	03/26/2004	03/26/2004	LRSFB	1			Patriots Dr	Canton	MA	5534369-1				Located raised box and blew out, ch
1	04/06/2004	04/05/2004	LRSFB	35			Patriots Dr	Canton	MA	5543347-1				repaired inside fit leak
1	04/01/2004	03/31/2004	LRSFB	7			Paul St	Canton	MA	5539067-1				
1	03/19/2004	03/18/2004	LRSFB	15			Paul St	Canton	MA	5528231-1				Found and repaired c.c. box, repai
1	03/24/2004	03/24/2004	LRSFB	18			Paul St	Canton	MA	5531856-1				Replaced inside swing fit.
4	08/30/2004	08/25/2004	LRMXB	750			Pleasant St	Canton	MA	5668286-1				negative results
1	04/06/2004	04/05/2004	LRSFB	1177			Pleasant St	Canton	MA	5543434-1				replaced inside swing fit
1	03/18/2004	03/18/2004	LRSFB	1209			Pleasant St	Canton	MA	5527687-1				Located and raised curb box on repa
2	01/29/2004	02/05/2004	LRMXB	33			Ponkapoag Way	Canton	MA	5485852-1	Intermedt	Bare Steel	2 "	installed 2-2"x6" band clamp
1	07/26/2004	07/26/2004	CDSXB	935			Randolph St	Canton	MA	5638514-1				CONTRACTOR DIGGING FOR WATER CAME A

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
2	12/20/2004	12/21/2004	LRSXB	12			Royal Ave	Canton	MA	5776586-1				kerotest curb cock leak and tate ou
1	03/26/2004	03/26/2004	LRSFB	6			Shepard Way	Canton	MA	5534132-1				Located raised c. box changed fit,
1	02/13/2004	02/13/2004	LRSFB	3			Shore Dr	Canton	MA	5499345-1				found repaired cc box, replaced ins
3	04/06/2004		LRSF	128			Spring Ln	Canton	MA	5543559-1				
1	06/07/2004	06/07/2004	SRERB	35			Sutcliffe Ave	Canton	MA	5596081-1	Intermedt	Bare Steel	2 "	RENEWED SERVICE FROM TEE TO HOUSE
2	04/16/2004	05/19/2004	LRMXB	120			Tolman St	Canton	MA	5552208-1	Intermedt	Bare Steel	1 1/2 "	REPLACED 8' OF 2' PLASTIC MAIN
1	04/10/2004	04/10/2004	LRSFB	12			Traverse St	Canton	MA	5547490-1	Intermedt	Bare Steel	1 "	repaired fit leak
1	03/24/2004	03/23/2004	LRSFB	197			Turnpike St	Canton	MA	5531786-1				Replaced inside swing fit andinstal
1	03/25/2004	03/24/2004	LRSFB	214			Turnpike St	Canton	MA	5532840-1				Repaired inside fit leak.
1	12/18/2004	12/18/2004	LRSXB	105			Walnut St	Canton	MA	5775954-1				replaced 1" kero test cc with 1" st
2	08/30/2004	11/09/2004	LRMXB				Washington	Canton	MA	5668294-1	High	Bare Steel	3/4 "	clamp blowing needed to replace sav
2	01/29/2004	02/17/2004	LRMXB				Washington St	Canton	MA	5485854-1	Intermedt	Bare Steel	3 "	replaced 2- 3"x6" handy band clamps
2	03/24/2004	04/24/2004	LRMXB				Washington St	Canton	MA	5532296-1	Intermedt	Bare Steel	3 "	install 2 3 x 6 clamp restoration c
2	03/24/2004	01/04/2005	LRMXB				Washington St	Canton	MA	5532302-1				found 1" purge nipple leaking. remo
1	04/24/2004	04/24/2004	CDSXB				Washington St	Canton	MA	5557907-1				REPAIRED BROKEN 1 1/4" PP SERVICE W
2	03/09/2004	03/09/2004	LRSFB	158			Washington St	Canton	MA	5519486-1				locate and raise c.c. box, shut off
4	07/02/2004	06/30/2004	LRMXB	510			Washington St	Canton	MA	5619656-1				neg results
1	01/30/2004	01/30/2004	LRMXB	538		0	Washington St	Canton	MA	5486991-1	Intermedt	Bare Steel	1 1/4 "	found 1" 1/4" c lamp double rubber
1	05/07/2004	05/07/2004	CDSXB	610			Washington St	Canton	MA	5569911-1	Intermedt	Bare Steel	4 "	CHECKED 4" BS PIPE EXPOSED BY CONTR
2	06/14/2004	06/08/2004	LRSFB	622			Washington St	Canton	MA	5602235-1				LEAK ON METER FIT FIXED
2	05/18/2004	05/15/2004	LRMXB	626			Washington St	Canton	MA	5578563-1	Intermedt	Bare Steel	4 "	INSTALLED 2 HB CLAMPS INSTALLED 2 F
2	06/08/2004	06/06/2004	LRMXB	632			Washington St	Canton	MA	5597154-1	Intermedt	Bare Steel	4 "	PUT FULL SEAL CLAMP ON 4" MAIN 1 LE
2	01/23/2004	01/23/2004	LRMXB	634			Washington St	Canton	MA	5480010-1	Intermedt	Bare Steel	4 "	replaced bolts on 4" dressed to sto
2	04/20/2004	05/01/2004	LRMXB	700			Washington St	Canton	MA	5553975-1	High	Bare Steel	4 "	install 2 4" clamps
2	11/23/2004	02/03/2005	RTSRB	833			Washington St	Canton	MA	5752926-1	Intermedt	Bare Steel	3/4 "	cut off 1" bs stub
1	02/02/2004	02/02/2004	LRSXB	960			Washington St	Canton	MA	5488871-1				contractor hit nipple on meter fit.
2	02/23/2004	03/26/2004	LRSXB	2222			Washington St	Canton	MA	5506202-1				Repaired leak at curb cock on servi
1	05/04/2004	05/03/2004	SRERB	2346			Washington St	Canton	MA	5566337-1	Intermedt	Bare Steel	1 "	reneweed svc cc into house. flowlim
1	01/15/2004	01/14/2004	LRSXB	2500			Washington St	Canton	MA	5472400-1	Intermedt	Bare Steel	1 1/2 "	Installed 1 1/2 handy band on servi
1	10/20/2004	10/20/2004	CDSXB	130			Westchester Dr	Canton	MA	5718542-1				REPAIRED 1/2" PP WITH PERMASET COUP
3	04/06/2004	01/20/2005	LRSFB	33			Wheeler Cir	Canton	MA	5543560-1				REPAIRED FIT LEAK LOCATED CURB COCK
1	07/09/2004	07/08/2004	LRSXB	55	59		Will Dr	Canton	MA	5625181-1				INSTALLED CLAMP ON RISER BELOW SHUT
1	03/18/2004	03/18/2004	LRSFB	10			Woodlock Rd	Canton	MA	5527256-1				Located curb cock, changed fit, lef
1	03/23/2004	03/23/2004	LRSFB	12			Woodlock Rd	Canton	MA	5530829-1				Changed inside fit, located blew ou
1	11/13/2004	11/11/2004	CDSXB	5			York Brook Rd	Canton	MA	5744176-1				REPLACE 4' OF .50 PLASTIC PIPE
2	08/09/2004	08/14/2004	SRERB	395			York St	Canton	MA	5650695-1	Intermedt	Bare Steel	2 "	put tee on side of main
1	03/02/2004	03/02/2004	LRSFB	429			York St	Canton	MA	5514078-1				changed fit inside, located, raised
1	04/22/2004	04/22/2004	LRMXB	71			Forest St	Dighton	MA	5555951-1	Intermedt	Bare Steel	2 "	Leak tested & pinpointed leak. foun
1	11/10/2004	11/10/2004	LRSFB	316			Main St	Dighton	MA	5741049-1				dug cur box to shut off curb cock t
1	10/26/2004	10/26/2004	LRSFB	88			Abrams Hill Rd	Duxbury	MA	5725097-1	Intermedt	Bare Steel	1 "	TOOK APART STREET ELBOW & NIPPLE RE
2	02/27/2004	03/03/2004	LRMXB	137			Abrams Hill Rd	Duxbury	MA	5510545-1	Intermedt	Bare Steel	1 1/2 "	installed 1- 1 1/2"x6" handi band c
2	02/19/2004	03/03/2004	LRMXB	53			Arrowhead Rd	Duxbury	MA	5503497-1	Intermedt	Bare Steel	2 "	installed and clamped 1 2"x6" hb an
1	08/26/2004	08/26/2004	LRSFB	7			Bay Ave	Duxbury	MA	5665821-1				REPAIRED LEAKING ELBOW ON THREADS R
1	11/23/2004	11/18/2004	CDSXB	25			Bay Rd	Duxbury	MA	5753009-1				REPAIRED BROKEN SERVICE 4' 1 1/4" P
2	02/19/2004	05/25/2004	LRMXB	154			Bay Rd	Duxbury	MA	5503498-1	Intermedt	Bare Steel	1 1/2 "	installed 4 1 1/2" x 6" clamps 5/25
1	02/19/2004	02/19/2004	LRMXB	405			Bay Rd	Duxbury	MA	5503480-1	Intermedt	Bare Steel	2 "	Install 2x6 clamp (couldn't stop le
2	02/19/2004	05/05/2004	LRMXB	52			Bayview Rd	Duxbury	MA	5503491-1	Intermedt	Bare Steel	2 "	install clamp
2	08/24/2004	10/06/2004	LRMXB	146			Crescent St	Duxbury	MA	5662610-1	Intermedt	Bare Steel	2 "	dug up street under minded by hand
2	07/20/2004	08/18/2004	LRMXB	35			Depot St	Duxbury	MA	5633376-1				REPAIRED ANODE - REPAIRED LEAKING C
1	04/08/2004	04/08/2004	SRERB	32			Linden Ln	Duxbury	MA	5545842-1	Intermedt	Bare Steel	1 1/2 "	inserted .50 pp from ;main to insid
2	07/12/2004	12/21/2004	LRMXB	5			Lovers Ln	Duxbury	MA	5626720-1	Intermedt	Bare Steel	1 1/2 "	installed 1 handiband clamp on bare

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
1	06/11/2004	06/11/2004	RTSNB	64			Saint George St	Duxbury	MA	5600596-1				TEMP CUT OFF LEAKING 1.25 PP SERVIC
2	02/27/2004	04/13/2004	LRMXB	12			Samoset Rd	Duxbury	MA	5510737-1	Intermedt	Bare Steel	1 1/2 "	installed 1 11/2" x 6" handi band c
1	01/28/2004	01/28/2004	LRSFB	59			Standish St	Duxbury	MA	5485068-1				locate and repair c.c. box, remade
1	04/06/2004	04/05/2004	CDMXB				Stetson Pl	Duxbury	MA	5543296-1	Intermedt	Bare Steel	1 1/4 "	thread and cap leaking stub main to
1	05/20/2004	05/20/2004	CDSXB	346			Summer St	Duxbury	MA	5580585-1				repaired 1/2" service with 4" of 1/
2	03/09/2004	05/04/2004	RTSRB	35			Taylor St	Duxbury	MA	5519695-1	Intermedt	Bare Steel	8 "	cut off and pinned leaking stub at
1	11/02/2004	11/02/2004	CDMXB				Tremont St	Duxbury	MA	5732270-1	Intermedt	Bare Steel	1 1/2 "	PINNED WELDED -STUB!
1	03/02/2004	02/26/2004	LRSXB	104			Tremont St	Duxbury	MA	5514128-1	Intermedt	Bare Steel	4 "	REPLACE LEAKING TEE. PLURGE IN FRON
1	02/23/2004	02/23/2004	LRMXB	113			Tremont St	Duxbury	MA	5506059-1	Intermedt	Bare Steel	4 "	installed 1 4"x6" hts.
1	04/09/2004	04/09/2004	LRMXB	393			Tremont St	Duxbury	MA	5546636-1	Intermedt	Bare Steel	4 "	install 4 x 6 clamp
1	09/14/2004	09/14/2004	CDSXB	620			Tremont St	Duxbury	MA	5681381-1				REPAIRED HIT 1/2" PP SERVICE
2	08/31/2004	09/11/2004	LRMXB	14			Adams Ln	East Bridgewater	MA	5669281-1				REPLACED LEAKING REG ON FARM TAP FO
2	08/09/2004	08/21/2004	LRMXB				Bedford St	East Bridgewater	MA	5650694-1				dug 4" valve and creased and instal
2	03/26/2004	04/05/2004	LRMXB				Elm St	East Bridgewater	MA	5534097-1	Intermedt	Bare Steel	8 "	INSTALLED 6X8 HANDI BAND CLAMP
2	06/03/2004	06/29/2004	LRMXB				Elm St	East Bridgewater	MA	5593280-1				leak tested and pinpointed leak. fo
2	09/08/2004	09/14/2004	LRMXB				Matfield St	East Bridgewater	MA	5675942-1				INSTALLED TWO 4" CUP CLAMPS ON 4" M
1	09/13/2004	09/13/2004	LRSFB	470			N Central St	East Bridgewater	MA	5680308-1				REPAIRED LEAKS ON TEE INSIDE
2	06/03/2004	10/13/2004	LRSXB	176			Pine St	East Bridgewater	MA	5593320-1				REPAIR LEAK ON SERVICE (1 1/4" PLUG
1	08/17/2004	08/17/2004	LRMXB	50			Spear Ave	East Bridgewater	MA	5657183-1	Intermedt	Bare Steel	2 "	LEAK TESTED & PINPOINTED LEAK FOUND
1	01/24/2004	01/24/2004	LRSXB	720			Summer St	East Bridgewater	MA	5481232-1	Intermedt	Bare Steel	8 "	REPLACED .50 P.P. GOING INTO FLOW L
1	11/03/2004	11/04/2004	LRSFB	265			Union St	East Bridgewater	MA	5733658-1				INSTALLED NEW POSILOCK OLD POSILOCK
1	02/03/2004	02/02/2004	LRSXB	75			Washington St	East Bridgewater	MA	5490280-1				replaced regulator on tap
measures														
1	02/02/2004	02/03/2004	LRSXB	78			Washington St	East Bridgewater	MA	5488869-1				replaced regulator on frm tap
2	07/09/2004	07/14/2004	LRMXB				Water St	East Bridgewater	MA	5624958-1	Intermedt	Bare Steel	2 "	installed one 2 x 6 hb clamp on mai
2	08/17/2004	08/17/2004	LRMXB				Water St	East Bridgewater	MA	5657292-1	Intermedt	Bare Steel	2 "	installed 2 2 x 6 handi band clamps
2	11/16/2004	08/18/2004	LRMXB				Water St	East Bridgewater	MA	5746603-1	Intermedt	Bare Steel	2 "	INSTALLED 3 2 X 6 HANDI BAND CLAMPS
2	11/17/2004	11/24/2004	LRMXB				Water St	East Bridgewater	MA	5747447-1	Intermedt	Bare Steel	2 "	clamp on 2" main
1	06/23/2004	06/23/2004	LRMXB				Baldwin St	Easton	MA	5610529-1	Intermedt	Bare Steel	2 "	installed 2 x 6 clamp (seam) main
4	07/06/2004	07/02/2004	LRMXB	28			Baldwin St	Easton	MA	5621698-1				negative results
1	08/17/2004	08/16/2004	LRMXB	50			Center St	Easton	MA	5657109-1	Intermedt	Bare Steel	2 "	INSTALLED 3 2" CLAMPS ON BS MAIN
2	12/28/2004	01/03/2005	LRSXB	56			Center St	Easton	MA	5782206-1	High	Bare Steel	2 "	pinned service tee and installed ne
2	04/20/2004	05/28/2004	LRMXB	125			Center St	Easton	MA	5554046-1	Intermedt	Bare Steel	2 "	leak tested and pinpointed leak. fo
1	08/24/2004	08/24/2004	CDSXB	43		30	Concerto Ct	Easton	MA	5662674-1				FOUND 1/2" PP BROKEN BY EXCAVATOR.
1	08/27/2004	08/27/2004	CDSXB	3			Deer Run Rd	Easton	MA	5666960-1				CONTRACTOR CUT 1/2" PP SVC WITH POS
2	05/28/2004	06/09/2004	SRERB	131			Depot	Easton	MA	5588500-1	Intermedt	Bare Steel	2 "	leak tested and pinpointed leak. fo
1	01/15/2004	01/12/2004	LRSXB	670			Depot St	Easton	MA	5472443-1				Replacekerotest C.C. with new one.
2	08/18/2004	09/13/2004	LRSXB	47			Galahad Way	Easton	MA	5657991-1				TEMP REPAIRED LEAK ON SERVICE TO HO
4	07/02/2004	06/29/2004	LRMXB				Jenny Lind@williams	Easton	MA	5619657-1				negative results
4	06/16/2004	06/15/2004	LRMXC	2			Kerrin Marie Way	Easton	MA	5604262-1				negative results
1	11/18/2004	11/18/2004	CDSXB	14		16	Littlefield Ln	Easton	MA	5749059-1				FOUND 1/2" PP BROKEN IN 1 1/4 PP S
1	11/04/2004	11/04/2004	CDMXB	100			Lothrop St	Easton	MA	5735200-1				INSTALLED 6' OF 2" PP AND TWO DRESS
1	12/07/2004	12/07/2004	CDSXB	100			Lothrup St	Easton	MA	5765152-1				REMOVED 5' SECTION OF DAMAGE 2" PP
2	10/13/2004	11/02/2004	LRMXB	24			Main St	Easton	MA	5710652-1	Intermedt	Bare Steel	1 "	leak tested and pinpointed leak, fo
1	06/28/2004	06/25/2004	LRSFB	312			Main St	Easton	MA	5614833-1				REPLACE 3/4" HPC ON BY PASS LINE OF
4	08/30/2004	08/19/2004	LRMXB	134			Pine St	Easton	MA	5668284-1				negative results
2	10/12/2004	10/21/2004	LRMXB	149			Pine St	Easton	MA	5709358-1				put repair clamp on 4" bare steel m
1	02/12/2004	02/12/2004	SRERB	12			Pleasant St	Easton	MA	5498423-1	Intermedt	Bare Steel	1 1/4 "	tested leak and pinpointed leak, fo
2	09/16/2004	09/25/2004	LRMXB				Rockland St	Easton	MA	5683549-1				REPAIR LEAKING VALVE
2	06/30/2004	08/03/2004	LRMXB	30			Seaver St	Easton	MA	5616912-1	Intermedt	Bare Steel	2 "	FOUND LEAK ON 2" BS MAIN CLAMPED WI
1	05/18/2004	05/18/2004	CDSXB				Symphony Dr	Easton	MA	5578482-1				REPAIRED 1/2" PP SERVICE WITH 4' OF
2	10/05/2004	11/03/2004	LRMXB	40			Turnpike St	Easton	MA	5702493-1	High	Bare Steel	1 1/2 "	installed one 1 1/2" handyband on 1

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
1	04/09/2004	04/09/2004	LRSFB	192			Turnpike St	Easton	MA	5546685-1				CUT DOWN RISER, RETHREADED, PU BAC
4	06/17/2004	06/16/2004	LRMXB	489			Turnpike St	Easton	MA	5605359-1				negative results
2	02/12/2004	02/20/2004	LRMXB	570			Turnpike St	Easton	MA	5498577-1	Intermedt	Bare Steel	2 "	Installed 1 2x6 handi band clamp
2	03/18/2004	04/07/2004	LRMXB	570			Turnpike St	Easton	MA	5527769-1	Intermedt	Bare Steel	2 "	INSTALLED TWO HANDY BAND
2	04/09/2004	04/07/2004	LRMXB	570			Turnpike St	Easton	MA	5546726-1	Intermedt	Bare Steel	2 "	INSTALLED ONE HAND BAND
2	04/06/2004	06/02/2004	LRMXB				Washington St	Easton	MA	5543615-1	Intermedt	Bare Steel	4 "	LEAK TESTED & PINPOINTED LEAK FOUND
											Intermedt	Bare Steel	2 "	
1	06/04/2004	06/02/2004	LRMXB				Washington St	Easton	MA	5594293-1	Intermedt	Bare Steel	4 "	INSTALLED 2 - 4" PC'S & CLOSED 2" V
3	10/18/2004	01/11/2005	LRMXC				Washington St	Easton	MA	5715289-1				surveyed 1/11/05 fp/sa neg called o
1	10/20/2004	10/20/2004	LRSXB	320			Washington St	Easton	MA	5718538-1				COMP CC LEAKING TIGHTENED STOPPED L
1	11/23/2004	11/23/2004	LRMXB	320			Washington St	Easton	MA	5752706-1	Intermedt	Bare Steel	4 "	REPAIRED LEAK WITH 4 X 6 HANDI BAND
2	08/19/2004	09/17/2004	LRMXB				Carpenter St	Foxboro	MA	5659388-1				PEENED 2" WELD ON TEE & STOPPED LEA
2	02/03/2004	02/02/2004	LRMXB	328			Central Ave	Foxboro	MA	5489956-1	Intermedt	Bare Steel	6 "	installed 1-6 " handiband clamp
1	07/08/2004	07/08/2004	RTSNB				Central St	Foxboro	MA	5623995-1	Intermedt	Bare Steel	3/4 "	Cut back old stub for contractor. j
2	08/24/2004	09/11/2004	SRERB	38			Central St	Foxboro	MA	5662638-1				inserted leaking 3/4 cs service wit
1	08/23/2004	08/23/2004	CDSXB	46			Central St	Foxboro	MA	5662020-1				WELDED STEEL PIN AT MAIN. CUT OFF 1
1	09/01/2004	09/01/2004	RTSRB	70			Central St	Foxboro	MA	5670383-1				CUT OFF HIT STUB. PINNED AT MAIN.
2	09/09/2004	09/11/2004	SRERB	83			Central St	Foxboro	MA	5677297-1				renewed service tee to riser
2	03/26/2004	04/07/2004	LRMXB	310			Central St	Foxboro	MA	5534096-1	Intermedt	Bare Steel	6 "	installed 6" handiband on main
1	07/07/2004	07/07/2004	RTSRB	355			Central St	Foxboro	MA	5622634-1	Intermedt	Bare Steel	6 "	PINNED LEAKING STUB @ MAIN. MAIN IS
2	11/09/2004		LRSF	247			Cocasset St	Foxboro	MA	5739495-1				
1	12/27/2004	12/22/2004	LRSXB	8			Commercial St	Foxboro	MA	5781591-1				Tightened 1 1/2" compression curb c
1	02/10/2004	02/11/2004	LRMXB	79			Cross St	Foxboro	MA	5496420-1				installed 2" pc and 2" fit and rep
2	05/05/2004	09/07/2004	SRERB	45			Granite St	Foxboro	MA	5567688-1	Intermedt	Bare Steel	3 "	renewed service tee to house flowli
2	02/06/2004	02/06/2004	LRSFB	85			Granite St	Foxboro	MA	5493435-1				replaced h.p. cock and meter fit
1	10/04/2004	10/03/2004	CDSXB	14			Kathy Dr	Foxboro	MA	5700542-1				REPAIRED 1/2" P.P. SERVICE 1 ' OF 1
2	09/10/2004	03/30/2005	MRPEB				Liberty St	Foxboro	MA	5678386-1	Intermedt	Bare Steel	2 "	INSERTED 1.25 P.P. THROUGH 2" B.S.
1	09/15/2004	09/15/2004	LRSFB	7			Linda St	Foxboro	MA	5682139-1				Repaired leaking fits. Located, rai
2	09/08/2004	11/22/2004	LRMXB				Main St	Foxboro	MA	5675954-1	High	Bare Steel	2 "	installed 2" handy band clamp. leak
1	11/18/2004	11/18/2004	CDSXB	106			Main St	Foxboro	MA	5748929-1	Intermedt	Bare Steel	3/4 "	REPAIRED SERVICE FOR NEUCO.
2	05/05/2004	06/29/2005	LRMXB	114			Main St	Foxboro	MA	5567655-1	Intermedt	Bare Steel	6 "	REPAIRED LEAK ON CLAMP - COMPLETED
2	05/13/2004	05/14/2004	LRMXB	114			Main St	Foxboro	MA	5574999-1	Intermedt	Bare Steel	6 "	INSTALLED 6" FULL SEAL CLAMP.
2	09/08/2004	09/13/2004	LRMXB	114			Main St	Foxboro	MA	5675943-1	Intermedt	Bare Steel	6 "	INSTALLED ONE 6" FULL SEAL CLAMP OV
2	10/22/2004	01/12/2005	LRMXB	114			Main St	Foxboro	MA	5721460-1				main abandoned on 1/4/05. leak was
2	04/30/2004	05/01/2004	LRMXB	116			Main St	Foxboro	MA	5563379-1	Intermedt	Bare Steel	6 "	installed 2 6" full seals and 6" ha
2	09/24/2004	09/26/2004	SRERB	227			Main St	Foxboro	MA	5691601-1	Intermedt	Bare Steel	6 "	CUT OFF TEE & WELDED PIN. INSTALLED
4	08/30/2004	08/25/2004	LRMXB	4			Maple Ln	Foxboro	MA	5668287-1				negative results
1	04/27/2004	04/27/2004	RTSRB	1			Mechanic St	Foxboro	MA	5559975-1	Intermedt	Bare Steel	4 "	CONTRACTOR HIT, NOT MARK, STUB NOT
1	10/19/2004	10/19/2004	RTSNB	30	32		Mechanic St	Foxboro	MA	5716647-1				CUT OFF SERVICE AT LOT LINE TAKING
1	03/05/2004	03/05/2004	CDSXB	87			Mechanic St	Foxboro	MA	5517121-1				Repaired by (2) 1" perma sets and 3
2	05/27/2004	06/14/2005	LRMXB	191			Mechanic St	Foxboro	MA	5586921-1	Intermedt	Bare Steel	4 "	installed #2 4" x 6" handiband clam
2	10/14/2004	10/14/2004	LRMXB				North St	Foxboro	MA	5711756-1				repaired leak with 1 full seal and
2	10/22/2004	11/04/2004	LRMXB				North St	Foxboro	MA	5721454-1	High	Bare Steel	6 "	INSTALLED 6" FULL SEAL CLAMP ON MAI
2	12/11/2004	12/14/2004	LRMXB				North St	Foxboro	MA	5769783-1	Intermedt	Bare Steel	6 "	repaired leak with 6 x 6 handiband.
2	07/22/2004	07/22/2004	LRMXB	80			North St	Foxboro	MA	5635926-1	High	Bare Steel	6 "	Repair with one 6" clamp.
2	07/22/2004	10/16/2004	LRMXB	106			North St	Foxboro	MA	5635924-1				installed one 6" handy band
2	09/08/2004	02/03/2005	LRMXB	153			North St	Foxboro	MA	5675951-1	High	Bare Steel	6 "	could not find leak needs to be rer
1	09/14/2004	09/14/2004	LRSFB	180			North St	Foxboro	MA	5681398-1				REPLACED HIGH PRESSURE COCK AND MET
2	12/14/2004	12/16/2004	LRMXB	195			North St	Foxboro	MA	5771185-1				dug hole did not find leak.rerun ba
2	11/26/2004	11/27/2004	LRMXB	63			Oak St	Foxboro	MA	5755281-1	Intermedt	Bare Steel	4 "	installed 1 full seal clamp on bare
2	09/03/2004	09/11/2004	LRMXB				Opp 330 Central St	Foxboro	MA	5673165-1	High	Bare Steel	6 "	repaired leak install one handi ban

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
1	03/01/2004	02/27/2004	LRSFB	34			Pine St	Foxboro	MA	5512749-1				Repaired inside swing fit.
1	04/22/2004	04/22/2004	LRMXB				Rockhill St	Foxboro	MA	5555867-1				LEAK ON DRESSER. INSTALL 1 - 3" X 6
4	09/21/2004	10/28/2004	LRSFB	8			Samson Rd	Foxboro	MA	5687346-1				repaired fit leak below hpc
2	07/09/2004	07/10/2004	LRSXB	16			School St	Foxboro	MA	5624986-1				found cap leaking, repaired by rele
2	05/27/2004	08/14/2004	SRERB	116			South St	Foxboro	MA	5586943-1	Intermedt	Bare Steel	3 "	renewed 1" yellow wrap service tee
2	10/01/2004	02/02/2005	LRMXB	24			Union	Foxboro	MA	5698925-1				leak repaired under another wo# 555
1	07/09/2004	07/07/2004	RTMXB	48			Washington St	Foxboro	MA	5625232-1				Installed new end cap 55' from old
1	08/12/2004	08/12/2004	LRSXB	62			Beaver St	Franklin	MA	5653787-1	Intermedt	Bare Steel	3 "	CUT OFF STUB SERVICE TEE - PINNED A
1	12/20/2004	12/20/2004	LRSFB	166			Beech St	Franklin	MA	5776881-1				repaired fit leak
1	08/05/2004	08/05/2004	SRERB	95			Bent St	Franklin	MA	5648301-1				INSERTED 1/2" P.P. FORM C.C. TO RIS
3	01/02/2004	03/18/2004	LRSFB	397			Brenda Ln	Franklin	MA	5458973-1				Replaced 3/4" HPC.
2	08/13/2004	09/17/2004	SRERB	22			Brook St	Franklin	MA	5654796-1				RENEW SERVICE PLASTIC INSERT FROM T
1	03/01/2004	03/02/2004	LRMXB	28			Brook St	Franklin	MA	5512842-1				installed 2-3" pc's and 2" pc and c
1	05/25/2004	05/25/2004	LRSFB	7			Burning Tree Rd	Franklin	MA	5584718-1				repaired leak at h.p.c.
2	07/01/2004	10/06/2004	SRERB	9	11		Chestnut St	Franklin	MA	5618055-1				INSTALLED NEW SERVICE TEE O.K. INSE
1	06/25/2004	05/05/2005	LRMXB	11			Chestnut St	Franklin	MA	5612854-1	Intermedt	Bare Steel	3 "	fix 3" leak on pipe test both ways
2	07/01/2004	10/05/2004	LRMXB	33			Chestnut St	Franklin	MA	5618054-1	Intermedt	Bare Steel	3 "	repaired leak with 3 x 6 handiband
1	08/24/2004	08/24/2004	LRSFB	4			Colt Rd	Franklin	MA	5662875-1				METER AND FIT WERE ALMOST IMPOSSIBL
2	06/23/2004	10/29/2004	LRMXB	33			Corbin St	Franklin	MA	5610378-1	Intermedt	Bare Steel	2 "	three clamps on 2" steel main. pipe
1	09/23/2004	09/23/2004	LRMXB				Cottage St	Franklin	MA	5690037-1				DUG UP PATCH. INSTALLED VENT BOX. M
1	08/10/2004	08/10/2004	CDSXB	19			Cottage St	Franklin	MA	5651648-1				REPAIRED BROKEN 1/2 " PP SERVICE
1	05/26/2004	05/25/2004	SRERB	59			Cottage St	Franklin	MA	5585685-1				WELDED PIN IN BROKEN TEE & RENEWED
1	08/03/2004	08/03/2004	LRMXB	79			Cottage St	Franklin	MA	5645709-1	Intermedt	Bare Steel	4 "	INSTALLED 4" X 6" CLAMP.
1	08/26/2004	08/26/2004	LRMXB	93			Cottage St	Franklin	MA	5665480-1		Bare Steel	3/4 "	INSTALLED 3/4" X 6" HANDIBAND CLAMP
1	05/12/2004	05/12/2004	CDSXB	109			Cottage St	Franklin	MA	5573574-1				CUT 1/2" P.I. & PRESSURE TEST AFTER
3	02/13/2004	08/16/2004	LRSFB	92			Crescent St	Franklin	MA	5499267-1	High	Bare Steel	3/4 "	LOCATED C.C. INSTALLED TWO METER FI
2	12/23/2004	01/03/2005	LRSXB	10			Dawn Marie Cir	Franklin	MA	5780058-1				repaired leak on service
2	05/21/2004		LRSF	110			Dean Ave	Franklin	MA	5581750-1				
1	08/17/2004	08/14/2004	LRMXB	113			Dean Ave	Franklin	MA	5657116-1	Intermedt	Bare Steel	3 "	installed 3" clamp on BS Main
1	04/21/2004	04/20/2004	RTSRB	181			E Central St	Franklin	MA	5554840-1	Intermedt	Bare Steel	3 "	CUT OFF OLD 3/4" SERVICE AT MAIN.
1	05/19/2004	05/19/2004	CDSXB	355			E Central St	Franklin	MA	5579723-1				REPAIRED 1 14" P.P. SERVICE WITH 3"
1	12/16/2004	12/16/2004	SRERB	11			East St	Franklin	MA	5773906-1		Bare Steel	3/4 "	renew service cc to house using 24'
4	09/02/2004	08/31/2004	LRMXB	53			Fales St	Franklin	MA	5671703-1				negative results
2	02/04/2004	04/06/2005	LRMXB	5			Fisher St	Franklin	MA	5491430-1				see wo# 5525579 main abandoned
2	12/08/2004	04/06/2005	LRMXB	60	62		Fisher St	Franklin	MA	5766379-1				main abandoned see wo 5525579
2	03/25/2004	03/26/2004	LRSFB	21			Forge Park	Franklin	MA	5533211-1				Repaired leak at riser 1 1/4" H.P.C
2	06/14/2004	06/22/2004	LRSFB	5			Gatehouse Ln	Franklin	MA	5602256-1				CHECKED 12 MTR MANIFOLD, REPAIRED L
2	08/31/2004	09/10/2004	SRERB	6			Haverstock Rd	Franklin	MA	5669282-1				renewed with 1/2"N PP TESTS CC FLOW
2	09/22/2004	10/01/2004	LRMXB	11			Haverstock Rd	Franklin	MA	5689183-1				2" clamp on main coat steel main
1	09/03/2004	09/03/2004	LRSXB	18			Haverstock Rd	Franklin	MA	5673153-1				PUT 1' CLAMP ON 1" C.S. PIPE, CORRO
3	07/19/2004	07/28/2004	LRSFB	31			Hayward St	Franklin	MA	5632710-1				REPAIRED LEAK ON H.P.C.
2	12/23/2004	01/03/2005	LRMXB				Hillside Ave	Franklin	MA	5780059-1	Intermedt	Bare Steel	2 "	install six 2" x 6" clamps on main.
3	05/13/2004	10/26/2004	LRMXB				Hillside Rd	Franklin	MA	5574571-1	Intermedt	Bare Steel	2 "	installed 4 2" clamps on main. very
1	07/19/2004	07/19/2004	LRSFB	15			Hunters Run	Franklin	MA	5632413-1				REPAIRED FIT LEAK AT H.P.C.
1	08/17/2004	08/17/2004	LRSFB	25			Kenwood Cir	Franklin	MA	5657097-1				replaced leaking fits on service
2	05/11/2004		LRSF	40			Kenwood Cir	Franklin	MA	5572633-1				
1	02/02/2004	02/03/2004	LRMXB	701			King St	Franklin	MA	5488881-1				1 4"x6" clamp on 4" C.S. main
1	06/29/2004	06/29/2004	CDSXB	492			Lincoln	Franklin	MA	5615861-1				REPAIRED LINE WITH 8' OF 1/2" P.P.
2	04/06/2004	08/10/2004	LRMXB				Lincoln St	Franklin	MA	5543600-1	Intermedt	Bare Steel	6 "	INSTALLED 6" HANDIBAND ON MAIN. MAI
4	08/18/2004	08/16/2004	LRMXB				Lincoln St	Franklin	MA	5658055-1				negative results
1	10/26/2004	10/26/2004	CDSXB				Lincoln St	Franklin	MA	5724739-1				HIT SERVICE O.K. TEE ON MAIN NEED T

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
2	11/22/2004	03/15/2005	LRMXB				Lincoln St	Franklin	MA	5751836-1	Intermedt	Bare Steel	6 "	install 6" handiband on steel main
2	01/28/2004	02/06/2004	LRSFB	555			Lincoln St	Franklin	MA	5484858-1				cut riser and rethread 20 installed
2	02/06/2004	02/19/2004	RTSRB	555			Lincoln St	Franklin	MA	5493838-1				sealed 1-6" joint and also cut off
1	08/18/2004	02/19/2004	JCIXB	555			Lincoln St	Franklin	MA	5658227-1				SEE WO 5493838 FOR DETAILS
2	03/12/2004	03/22/2004	LRMXB	657			Lincoln St	Franklin	MA	5522821-1	Intermedt	Bare Steel	6 "	Installed (2) 6"x6" handy band cla
1	11/22/2004	02/03/2005	LRMXB	660			Lincoln St	Franklin	MA	5751867-1	Intermedt	Bare Steel	6 "	installed 6" handi band clamp on 6"
1	06/03/2004	06/03/2004	SRERB	68			Main St	Franklin	MA	5593305-1				RENEWED SRVC TEE TO C.C. W/ 1/2' P.
2	09/02/2004	09/13/2004	LRMXB	2			Mill River Cir	Franklin	MA	5671704-1				REPLACED O RING ON TEE TO HOUSE #1.
1	07/21/2004	07/21/2004	CDSXB	224			Oak St	Franklin	MA	5634517-1				REPLACED 5' OF 4" PLASTIC USING 2 -
2	01/07/2004	01/10/2004	LRMXB	354			Oak St	Franklin	MA	5463422-1				BLEW OUT VALVE BOX, GREASED VALVE &
2	08/31/2004	09/10/2004	LRMXB	110			Park Rd	Franklin	MA	5669555-1				installed 1 two inch handy band
2	02/10/2004	02/20/2004	LRMXB	97			Pine Ridge Dr	Franklin	MA	5496207-1				Installed 2"x 6" band clamp on main
1	12/09/2004	12/09/2004	LRMXB	75			Pleasant St	Franklin	MA	5767664-1	Intermedt	Bare Steel	3 "	Repaired leak with handiband clamp.
1	08/25/2004	08/25/2004	LRMXB	92			Pleasant St	Franklin	MA	5664007-1				clamped leaking service for water d
1	04/10/2004	04/10/2004	LRMXB	197			Pond St	Franklin	MA	5547493-1				installed 4" handi band on C.S. mai
2	10/28/2004	10/28/2004	LRMXB	38			Ruggles St	Franklin	MA	5727470-1				found nothing. backhoe broke down
2	11/22/2004	11/27/2004	LRMXB	46			Ruggles St	Franklin	MA	5751839-1	Intermedt	Bare Steel	2 "	installed 2 x 12 full seal 2 2 x 6
1	06/08/2004	06/08/2004	SRERB	6			Shady Ln	Franklin	MA	5596911-1				renewed service c.c. to inside.
2	09/16/2004	09/30/2004	LRSFB	33			Skyline Dr	Franklin	MA	5683294-1				new meter fit and new pipe to hse
1	09/07/2004	09/05/2004	LRMXB	23			Summer St	Franklin	MA	5674914-1	Intermedt	Bare Steel	2 "	INSTALLED 2 HANDIBANDS ON 2" B.S. M
2	09/30/2004	10/12/2004	LRMXB				Wachusett St	Franklin	MA	5697736-1	Intermedt	Bare Steel	4 "	THREE 4" CLAMPS ON MAIN.
1	06/04/2004	06/03/2004	LRMXB	9			Washington St	Franklin	MA	5594371-1				INSTALLED 3/4" FULL SEAL ON SERVICE
1	06/07/2004	06/07/2004	SRERB	9		0	Washington ST	Franklin	MA	5595972-1	Intermedt	Bare Steel	4 "	RENEWED SERVICE MAIN TO INSIDE.
											Intermedt	Bare Steel	3/4 "	
1	04/20/2004	04/20/2004	CDSXB	12			Washington St	Franklin	MA	5554036-1	Intermedt	Bare Steel	4 "	REPAIRED SERVICE. FOUND CORROSION H
2	09/28/2004	09/27/2004	LRMXB	33	35		Washington St	Franklin	MA	5694681-1	Intermedt	Bare Steel	4 "	INSTALLED 4" CLAMP ON MAIN.
2	10/19/2004	10/22/2004	LRMXB	35			Washington St	Franklin	MA	5716484-1	Intermedt	Bare Steel	4 "	put clamp on old 4" steel gas main
3	11/22/2004	04/19/2005	LRMXC	41			Washington St	Franklin	MA	5751832-1				rechecked 4/19/05 neg mobil mf/sa
4	09/30/2004	09/13/2004	LRMXB	784			Washington St	Franklin	MA	5697729-1				negative results
1	09/10/2004	09/10/2004	LRSFB	12			Harvard St	Halifax	MA	5678857-1				locate cc turn off replaced various
1	11/03/2004	11/03/2004	CDSXB				Holmes St	Halifax	MA	5733814-1				REPAIRED SERVICE AT WATER PUMPING S
2	03/23/2004	03/24/2004	LRMXB	420			Plymouth St	Halifax	MA	5530735-1				Dug up, greased and operated leakin
1	03/26/2004	03/26/2004	LRSXB	430			Plymouth St	Halifax	MA	5534244-1				Repair leak at dresser.
2	01/07/2004	02/12/2004	LRSFB	470			Plymouth St	Halifax	MA	5463495-1				change leaking hpc, 4 repair fit 1
3	03/15/2004	04/02/2004	LRSFB	470			South St	Halifax	MA	5524213-1				repair leak and raised meter
2	04/27/2004	05/21/2004	LRSFB	36			B St	Hanover	MA	5559951-1				LEAK ON METER FIT REPAIRED
1	08/09/2004	07/28/2004	LRSFB	36			B St	Hanover	MA	5650918-1				REPAIR FIT LEAK
1	04/27/2004	04/28/2004	LRSFB	56			B St	Hanover	MA	5559830-1				REPAIRED FIT LEAK
2	03/08/2004	04/12/2004	TIEPEB	159			Broadway	Hanover	MA	5519048-1				tied service over to 8" cs long sid
1	11/22/2004	11/22/2004	LRMXB	1544			Broadway	Hanover	MA	5752020-1	Intermedt	Bare Steel	3 "	REPAIRED TEE ON MAIN BY WELDING TEE
1	04/14/2004	04/14/2004	LRMXB				Brook Cir	Hanover	MA	5550375-1				INSTALLED 1 2" X 6" HB BEHIND VALVE
1	04/16/2004	04/15/2004	LRSXB				Brook Cir	Hanover	MA	5552341-1				REPAIRED LEAK ON WELD
2	03/29/2004	03/29/2004	LRMXB	287			Cedar St	Hanover	MA	5535719-1				Installed one 1 1/4"x6" H.B.
1	01/15/2004	01/14/2004	LRSFB	392			Hanover St	Hanover	MA	5472675-1				Rpair inside fit leak
1	11/03/2004	11/03/2004	LRMXB	1102			Hanover St	Hanover	MA	5733802-1				FOUND PLASTIC TEE CAP LEAKING REMOV
1	08/26/2004	08/26/2004	LRMXB	1448			Hanover St	Hanover	MA	5665446-1	Intermedt	Bare Steel	2 "	installed 2 HB clampsd on bare stee
2	11/05/2004	11/15/2004	LRMXB	537			Main St	Hanover	MA	5736304-1				found leaks on main. installed 3 ha
1	08/18/2004	08/18/2004	CDSXB	1320			Main St	Hanover	MA	5658195-1				REPARIED 1 1/4" SERVICE 3' 1 1/4' P
2	11/24/2004	12/30/2004	LRSXB	124			Olde Forge Rd	Hanover	MA	5753833-1				removed kerotest cc 2' 1/2"pp. 2 1/
2	12/14/2004	01/07/2005	SRERB	82			Pleasant St	Hanover	MA	5771260-1	Intermedt	Bare Steel	3 "	cut off & pinned leaking service re
1	12/14/2004	12/12/2004	LRSFB	171			Plymouth Rd	Hanover	MA	5771385-1				LOCATED & RAISED CC BOX REPAIRED LE

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
2	01/12/2004	01/28/2004	LRSXB	183	185		Washington St	Hanover	MA	5468783-1	Intermedt	Bare Steel	2 "	install 3 2x6 clamps and replace 1
2	02/24/2004	03/01/2004	LRMXB	183	185		Washington St	Hanover	MA	5506893-1	Intermedt	Bare Steel	2 "	installed 2 2"x6" h.p. clamps.
2	01/28/2004	01/28/2004	LRMXB	185			Washington St	Hanover	MA	5484938-1	Intermedt	Bare Steel	2 "	installed 3 2x6 clamps and replaced
1	05/14/2004	05/13/2004	LRMXB	195			Washington St	Hanover	MA	5576092-1	Intermedt	Bare Steel	2 "	INSTALLED FOUR CLAMPS ON MAIN
1	04/28/2004	04/28/2004	CDSXB	1771			Washington St	Hanover	MA	5561388-1				CUT OFF & PINNED TEE INSTALLED PUNC
2	01/07/2004	01/20/2004	LRSFB	1985			Washington St	Hanover	MA	5463461-1				REPAIR FIT LEAK
1	01/28/2004	01/27/2004	SRERB	594			Whiting St	Hanover	MA	5484484-1				replaced broken mueller c.c., renew
1	04/27/2004	04/27/2004	CDMXB	369			Winter St	Hanover	MA	5560023-1				REPLACE 13' OF 3" CS PIPE INSTALLED
2	06/17/2004	06/22/2004	LRMXB	297			County Rd	Hanson	MA	5605605-1				tighten bolts on reg. didn't shut o
2	10/01/2004	10/21/2004	LRMXB	306			County Rd	Hanson	MA	5698931-1				dug up farm tar reg gasket leaking
2	07/12/2004	08/09/2004	LRMXB	454			E Washington	Hanson	MA	5626751-1	Intermedt	Bare Steel	8 "	INSTALLED 1 8" FULL SEAL
1	01/13/2004	01/12/2004	LRMXB	122			E Washington St	Hanson	MA	5469509-1	Intermedt	Bare Steel	4 "	CLAMP 4" MAIN CLAMP 1 CLAMP
2	08/23/2004	12/03/2004	LRMXB	314			High St	Hanson	MA	5661745-1				repair of wo 5661742 eliminated thi
2	06/17/2004	06/27/2004	LRMXB	334			High St	Hanson	MA	5605508-1				installed 2 4 x 6 handi band clamps
1	07/30/2004	07/30/2004	LRMXB	334			High St	Hanson	MA	5643036-1				TIGHTEN LEAKING CLAMP ON 4" WELD 45
2	08/23/2004	09/01/2004	LRMXB	334			High St	Hanson	MA	5661742-1	Intermedt	Bare Steel	4 "	installed 1 full seal clamp on 4" b
2	01/12/2004	01/17/2004	LRMXB				King St	Hanson	MA	5468734-1	Intermedt	Bare Steel	3 "	Repaired leak using 1-3" handy band
1	06/28/2004	06/27/2004	RTSNB	999			Main St	Hanson	MA	5614829-1				OWNER OF BLDG HIT SERVICE WHILE LAN
2	06/15/2004	07/27/2004	LRMXB	1287			Main St	Hanson	MA	5603125-1	Intermedt	Bare Steel	6 "	tighten 6" cover on leaking pc
2	06/30/2004	07/08/2004	LRMXB	308			Maquan St	Hanson	MA	5616916-1	Intermedt	Bare Steel	3 "	installed 4 3" handiband clamps
1	09/16/2004	09/16/2004	LRSFB	456			Maquan St	Hanson	MA	5683574-1				LOCATED CC REPARIED INSIDE FIT LEAK
2	02/10/2004	02/18/2004	LRSFB	11			Meetinghouse Ln	Hanson	MA	5496206-1				change leaking hpc.
2	05/24/2004	06/02/2004	LRMXB	38			Park St	Hanson	MA	5583690-1	Intermedt	Bare Steel	1 1/2 "	installed 1 11/2" x 6" hb clamp
1	05/21/2004	05/20/2004	LRMXB	39			Park St	Hanson	MA	5581732-1	Intermedt	Bare Steel	1 1/2 "	INSTALLED 5 1 1/2" CLAMPS IN 4' ARE
2	06/17/2004	07/01/2004	LRMXB	220			Phillips St	Hanson	MA	5605607-1				installed 1 2 x 6 clamp
2	06/17/2004	06/25/2004	LRMXB	52			Pierce Ave	Hanson	MA	5605513-1	Intermedt	Bare Steel	1 1/2 "	intalled 11/2" x 6" hb clamps
1	12/15/2004	12/15/2004	LRSFB	132			Reed St	Hanson	MA	5772804-1				REPAIRED FIT LEAK
2	01/22/2004	04/20/2004	LRMXB				School St	Hanson	MA	5479312-1	Intermedt	Bare Steel	1 1/2 "	REPLACE LEAKING VALVE WITH 2 1/2" P
2	03/26/2004	04/20/2004	RTSRB	32			School St	Hanson	MA	5534222-1	Intermedt	Bare Steel	3/4 "	CUT OFF & PINNED 1" STUB & PINNED P
2	10/28/2004	11/26/2004	LRSFB	26			Squantum Ave	Hanson	MA	5727877-1				REPAIRED LEAKING GREASE PLUG ON HPC
2	07/12/2004	07/12/2004	LRSFB	564			State St	Hanson	MA	5626640-1				REMADE GAS FIT
2	12/04/2004	12/04/2004	LRMXB	122			W Washington St	Hanson	MA	5763344-1	Intermedt	Bare Steel	8 "	REPAIR SMALL LEAK ON MAIN SHOULD BE
1	12/06/2004	12/06/2004	LRMXB	122			W Washington St	Hanson	MA	5764115-1				installed 1 full seal. 8" clamp on
1	01/05/2004	01/02/2004	LRSXB	168			Winter St	Hanson	MA	5461033-1				Remove flow limitor at C.C.
1	12/27/2004	12/25/2004	LRMXB	168			Winter St	Hanson	MA	5781585-1	Intermedt	Bare Steel	1 "	REPLACED VENT ON FARM TAP REG BLEW
1	03/11/2004	03/11/2004	LRMXB	602			Winter St	Hanson	MA	5521414-1	Intermedt	Bare Steel	8 "	Installed full seal clamp 8" BS mai
1	10/05/2004	10/05/2004	CDSXB	5			High St	Holbrook	MA	5702673-1	Intermedt	Bare Steel	6 "	
1	08/10/2004	08/10/2004	CDSXB	34			Kalmia Rd	Holbrook	MA	5651797-1				CONTRACTOR PULLED SVC FOR COMP TEE
1	08/24/2004	08/24/2004	CDSXB	36			Kalmia Rd	Holbrook	MA	5662949-1				SMALL LEAK ON CAMP NOT FLOW LIMT TE
1	08/25/2004	08/25/2004	CDSXB	36			Kalmia Rd	Holbrook	MA	5664000-1				RENEWED SERVICE FROM TEE TO EXISTIN
1	04/27/2004	04/25/2004	SRERB	188			N Franklin St	Holbrook	MA	5559701-1				RENEW MAIN TO HOUSE
1	06/01/2004	06/01/2004	LRSFB	174			Pine St	Holbrook	MA	5590286-1				WELDEN ON 1" PIPE TO REPLACE LEAKIN
1	12/11/2004	12/08/2004	CDSXB	5			Platts St	Holbrook	MA	5769754-1				INSTALLED 2 1/2" PERMASETS PRESSURE
2	04/30/2004	05/11/2004	LRSFB	78			S Franklin St	Holbrook	MA	5563446-1				redoped 3/4" hpc
1	08/19/2004	08/19/2004	CDSXB	153			S Franklin St	Holbrook	MA	5659120-1				REPLACED SMALL PEICE OF 1.25 PP HIT
1	01/12/2004	01/12/2004	LRMXB	263			S Franklin St	Holbrook	MA	5468746-1		Bare Steel	6 "	leak tested and pinpointed leak, fo
1	07/06/2004	08/05/2004	LRSFB	912			S Franklin St	Holbrook	MA	5621702-1				REPAIRED LEAKS AT METER FIT
1	02/20/2004	02/20/2004	SRERB	140			South St	Holbrook	MA	5504280-1				replaced 50' of .50 pp.
1	10/26/2004	10/26/2004	CDMXB	175			South St	Holbrook	MA	5724744-1				INSTALLED 1 FULL SEAL DRESSER & 1 H
2	11/29/2004	12/29/2004	LRMXB	175			South St	Holbrook	MA	5756415-1				MAIN REPLACED & RETIRED (12/29/04).
2	12/14/2004	12/29/2004	LRMXB	200			South St	Holbrook	MA	5771252-1				main replaced & retired (12/29/04).

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
1	08/25/2004	08/25/2004	LRMXB	246			South St	Holbrook	MA	5664248-1	Intermedt	Bare Steel	6 "	REPLACED LEAKING CLAMP
1	10/16/2004	10/16/2004	LRSFB	263			South St	Holbrook	MA	5714492-1				REPAIRED LEAK BY CHANGEING POSI-LOC
2	11/09/2004	11/09/2004	LRMXB				Spring St	Holbrook	MA	5739601-1				LEAK ON HIGH VOLUME TEE ON CAP HIGH
1	04/27/2004	04/26/2004	LRMXB	3			Spring St	Holbrook	MA	5559698-1	Intermedt	Bare Steel	6 "	REPAIR LEAK WITH ONE 6" CLAMP
1	04/27/2004	04/27/2004	LRMXB	3			Spring St	Holbrook	MA	5559974-1	Intermedt	Bare Steel	6 "	LEAK TESTED & PINPOINTED LEAK FOUND
1	06/09/2004	06/09/2004	LRMXB	3			Spring St	Holbrook	MA	5598007-1	Intermedt	Bare Steel	6 "	INSTALL 2 6X6 CLAMPS PLURGE 23' APA
1	06/11/2004	06/11/2004	LRMXB	3			Spring St	Holbrook	MA	5600449-1	Intermedt	Bare Steel	6 "	INSTALLED 3 6" X 6" HB GOT CALLED A
1	06/19/2004	06/19/2004	LRMXB	3			Spring St	Holbrook	MA	5607534-1	Intermedt	Bare Steel	6 "	INSTALLED 6" HANDI BAND PURGE FROM
1	06/22/2004	06/22/2004	LRMXB	3			Spring St	Holbrook	MA	5609255-1				SET UP 3 PURGE PIPES TO GET GAS OUT
1	10/14/2004	10/14/2004	CDSXB	6			Spring St	Holbrook	MA	5711923-1				REPARIED SERVICE WITH PERMASET
1	10/12/2004	10/12/2004	CDSXB	25			Spring St	Holbrook	MA	5709149-1				REPAIRED SERVICE WITH 4' OR 50 PLAS
1	10/12/2004	10/12/2004	CDSXB	27			Spring St	Holbrook	MA	5708797-1				REPAIRED SERVICE WITH 4 ' 50 PLASTI
1	04/06/2004	04/05/2004	CDSXB	46			Upland St	Holbrook	MA	5543308-1				REPLACE 4' OF 1/2" PP HIT BY CONTRA
1	05/10/2004	05/09/2004	LRSXB	79			Weston Ave	Holbrook	MA	5571475-1	High	Bare Steel	2 "	clamp service
1	04/07/2004	04/06/2004	CDMXB	13			Harding St	Lakeville	MA	5544422-1				Replace 20" of plastic pipe with 2-
1	06/19/2004	06/19/2004	CDMXB	36			Main St	Lakeville	MA	5607553-1				REPAIR BROKEN PURGE NIPPLE.
2	08/11/2004	08/20/2004	LRMXB	10			Taunton St	Lakeville	MA	5652683-1				
1	08/12/2004	09/21/2004	SRERB	87			Angell St	Mansfield	MA	5653788-1				RENEW SERVICE TEE TO METER.
2	08/31/2004	09/09/2004	LRMXB	49			Cottage St	Mansfield	MA	5669554-1				repaired leak using 2-2 handy ban
1	09/20/2004	09/20/2004	SRERB	42			Draper Ave	Mansfield	MA	5686162-1				INSERTED WITH NEW .50 P.P.
1	06/11/2004	06/11/2004	MRPEB	801			East St	Mansfield	MA	5600610-1				REPAIRED HIT 4" P.P. MAIN.
4	07/28/2004	07/27/2004	LRMXB	32			Fairfield Park	Mansfield	MA	5640569-1				negative results
2	01/29/2004	02/07/2004	LRSXB	2			Jacob Dr	Mansfield	MA	5485833-1				removed leaking kero test c.c.
2	10/21/2004	10/29/2004	LRMXB	12			Kingman	Mansfield	MA	5720040-1				entire main replaced & abandoned. s
2	10/01/2004	10/29/2004	LRMXB				Kingman Ave	Mansfield	MA	5698936-1				entire main replaces & abandoned. s
2	05/25/2004	07/27/2004	LRMXB	708	710		N Main St	Mansfield	MA	5584756-1	Intermedt	Bare Steel	4 "	leak tested and pinpointed leak. fo
2	06/18/2004	07/19/2004	LRMXB				Thompson St	Mansfield	MA	5606722-1	Intermedt	Bare Steel	2 "	found valve leaking repacked valve
2	10/21/2004	10/21/2004	LRSXB	550			Ware St	Mansfield	MA	5720043-1				remove kero test curb cock
2	06/15/2004	07/22/2004	LRMXB	28			Warren Ave	Mansfield	MA	5603126-1	Intermedt	Bare Steel	2 "	replaced 2" clamp
1	08/30/2004	08/30/2004	LRMXB	67			Warren Ave	Mansfield	MA	5668468-1	Intermedt	Bare Steel	2 "	LEAK TESTED & PINPOINTED LEAK. FOUN
1	11/02/2004	11/02/2004	CDMXB				West St	Mansfield	MA	5732349-1				HIT MAIN CUT OUT PIECES OF 2" MAIN
2	09/01/2004	09/10/2004	LRMXB	186			West St	Mansfield	MA	5670345-1				repaired leak using 2 2" handy ban
1	09/07/2004	09/07/2004	CDMXB	390			West St	Mansfield	MA	5674638-1				SHUT OFF GAS @ VALVE TO 4" P.P. SER
2	05/25/2004	07/28/2004	LRMXB	381			Willow St	Mansfield	MA	5584656-1	Low	Bare Steel	2 "	leak tested and pinpointed leak. fo
2	05/25/2004	06/05/2004	LRMXB	395			Willow St	Mansfield	MA	5584674-1	High	Bare Steel	2 "	repair leak with one 2" clamp.
2	10/18/2004	11/02/2004	LRMXB	395		0	Willow ST	Mansfield	MA	5715300-1				placed two handi band clamps on 2"
1	06/23/2004	06/23/2004	LRSFB	21			10th Rd	Marshfield	MA	5610349-1				REPAIRED LEA ON RISER REPLACE FIT D
1	05/08/2004	05/08/2004	LRMXB	30			9th Rd	Marshfield	MA	5570873-1	Intermedt	Bare Steel	1 1/2 "	ISNTALLED 1 HP CLAMP ON MAIN WATER
4	05/10/2004	05/10/2004	SRERB	33			9th Rd	Marshfield	MA	5571788-1	Intermedt	Bare Steel	1 1/2 "	RENEWED LEAKING SERV TO HOUSE 33 FR
1	10/08/2004	10/14/2004	LRSFB	12			Atlantic St	Marshfield	MA	5707011-1				GREASED HPC OK
2	10/07/2004	11/08/2004	LRMXB	3			Barna Rd	Marshfield	MA	5705449-1	Intermedt	Bare Steel	2 "	installed 1 handyband clamp on 2" b
1	05/21/2004	05/21/2004	LRSFB	138			Bay Ave	Marshfield	MA	5581833-1				REPLACE LEAKING FIT
2	07/20/2004	07/24/2004	LRMXB	76			Bayberry Rd	Marshfield	MA	5633372-1	Intermedt	Bare Steel	3 "	INSTALL 2 3X6 CLAMPS
1	01/21/2004	01/21/2004	LRSFB	255			Canal St	Marshfield	MA	5478016-1				REPAIR FIT LEAK
1	12/22/2004	12/22/2004	LRSFB	122			Careswell St	Marshfield	MA	5778991-1				INSTALLED NEW POSI LOCK & HIGH PRES
2	07/20/2004	08/10/2004	SRERB	166			Careswell St	Marshfield	MA	5633366-1				RENEWED LEAKING SERVICE TEE TO HOUS
2	11/17/2004	11/17/2004	LRMXB	627			Careswell St	Marshfield	MA	5747480-1	High	Bare Steel	4 "	installed new flowlimiter tee at ma
2	06/24/2004	07/30/2004	LRMXB	23			Carlton Rd	Marshfield	MA	5611475-1	Intermedt	Bare Steel	1 1/2 "	installed 11/2" x 6" handiband clam
1	05/17/2004	05/17/2004	LRSFB	21			Chickatawbut Ave	Marshfield	MA	5577633-1				replaced leaking fit
4	06/17/2004	06/16/2004	LRMXC	32			Chickatawbut Ave	Marshfield	MA	5605354-1				neg results
1	08/13/2004	08/13/2004	CDMXB				Clipper Cir	Marshfield	MA	5654652-1				REPLACE 8' OF 2" PP WITH 8' OF PRE

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
2	08/23/2004	10/18/2004	LRMXB	115			Columbia Rd	Marshfield	MA	5661738-1				REPLACED LEAKING CLAMP AREA CLEAR
1	09/30/2004	09/30/2004	LRSFB	18			Cove St	Marshfield	MA	5697454-1				REPLACE HPC & MTR FIT TO REPAIR LEA
2	08/16/2004	08/19/2004	LRMXB				Dog Ln	Marshfield	MA	5656045-1	Intermedt	Bare Steel	2 "	installed 9 hb clamps on main need
2	07/30/2004	08/03/2004	LRMXB				Dog Ln @ Deerhill	Marshfield	MA	5642809-1	Intermedt	Bare Steel	2 "	INSTALLED 3 2 " X 6" HB CLAMPS
2	08/07/2004	08/04/2004	LRMXB	15			Dundee Dr	Marshfield	MA	5650205-1	Intermedt	Bare Steel	2 "	INSTALLED 4 2" CLAMPS MAIN VERY POO
2	02/24/2004	02/28/2004	LRMXB	184			Elm St	Marshfield	MA	5506902-1	Intermedt	Bare Steel	3 "	installed 3 3"x6" hb clamps.
2	07/02/2004	08/02/2004	LRMXB	210			Elm St	Marshfield	MA	5619483-1	Intermedt	Bare Steel	3 "	installed 1 3 x 6 hb on 7/9/04
inst														
2	07/01/2004	07/12/2004	LRMXB	157			Emery Rd	Marshfield	MA	5618043-1	Intermedt	Bare Steel	1 1/2 "	install 2 1.5 x 6 clamps. main very
1	07/12/2004	07/12/2004	LRSFB	36			Everson Rd	Marshfield	MA	5626822-1				REMADE LEAKING FIT
1	02/02/2004	01/31/2004	LRSXB	80			Everson Rd	Marshfield	MA	5489307-1				3/4 jumper loose at tee (fix ok no
1	08/30/2004	08/30/2004	LRSFB	21			Farragut Rd	Marshfield	MA	5668470-1				riser and posi lock nipple rotted a
2	09/21/2004	09/21/2004	LRMXB				Field St	Marshfield	MA	5687796-1				REPAIRED LEAK ON 2" DRESSER TIGHTEN
2	06/15/2004	06/14/2004	LRMXB	12			Foster Ave	Marshfield	MA	5603067-1				REPAIRED PUNCTURED 2" PP MAIN WITH
2	03/31/2004	04/09/2004	LRMXB	35			Foster Ave	Marshfield	MA	5538129-1	Intermedt	Bare Steel	2 "	installed 2" handi band clamp on B
2	08/09/2004	08/09/2004	LRSFB	56			Foster Ave	Marshfield	MA	5650947-1				LOCATE & RAISE CC BOX TO GRAD MARKE
2	06/30/2004	07/10/2004	LRMXB	158			Foster Ave	Marshfield	MA	5617030-1	Intermedt	Bare Steel	2 "	replace leaking tee install clamp
1	08/02/2004	07/31/2004	SRERB	32		136	Foxhill Cir	Marshfield	MA	5644740-1				REPLACE 24" OF 1/2" PLASTIC PRE TES
2	09/07/2004	09/17/2004	LRSFB	43			Gilbert St	Marshfield	MA	5674883-1				LOCATED CC BOX RAISED REPLACE 1" HP
1	09/02/2004	09/02/2004	CDSXB				Grandview Ave	Marshfield	MA	5671710-1	Intermedt	Bare Steel	1 1/2 "	ISNTALLED 1 HB CLAMP ON MAIN - MAIN
1	09/13/2004	09/13/2004	CDMXB				Grandview Ave	Marshfield	MA	5679928-1				INSTALLED CLAMP
2	04/16/2004	04/06/2004	SRERB	45			Hatch St	Marshfield	MA	5552141-1	Intermedt	Bare Steel	1 1/2 "	renew leaking serv from main to ris
1	09/15/2004	09/15/2004	LRMXB				Juniper Rd	Marshfield	MA	5682141-1				INSTALLED 3 HANDI BANDS
2	12/27/2004	12/31/2004	LRMXB	36			Landing Rd	Marshfield	MA	5781506-1				leak at dresser
1	10/06/2004	10/06/2004	LRSFB	16			Leland Rd	Marshfield	MA	5703921-1				INSTALLED NEW RISE & MTR FIT
1	08/28/2004	08/28/2004	CDSXB	81			Leland Rd	Marshfield	MA	5667845-1				REPAIRED HIT AT RISER INSTALLED 1/2
2	01/05/2004	01/13/2004	LRMXB	54			Macker Ter	Marshfield	MA	5461223-1				main abandoned 1-12-04
2	01/12/2004	01/14/2004	LRSFB	94			Marginal St	Marshfield	MA	5468275-1				Replaced tran. nipple and fit
1	11/04/2004	11/04/2004	LRSFB	9			Marion St	Marshfield	MA	5735226-1				REPAIRED LEAK ON RISER REPLACE WITH
1	06/08/2004	06/08/2004	SRERB	12			Massasoit Ave	Marshfield	MA	5596976-1				INSTALL 1" CC WITH FL & INSERT TO O
2	03/16/2004	03/19/2004	LRMXB	77			Nevada St	Marshfield	MA	5525594-1				Greased operated leaking valve mark
1	05/17/2004	05/10/2004	LRMXB	30			Ninth Rd	Marshfield	MA	5577778-1				SEE WO 5571788
2	11/17/2004	11/23/2004	LRMXB				Ocean St	Marshfield	MA	5747452-1				found 2" steel dresser nut loose an
1	08/06/2004	08/06/2004	LRSFB	218			Ocean St	Marshfield	MA	5649189-1				LOCATE & RAISED CC BOX TO GRADE MAR
2	06/28/2004	06/28/2004	LRSFB	226			Ocean St	Marshfield	MA	5614964-1				REPLACE RISER AND FIT
2	01/26/2004	01/28/2004	LRSFB	308			Ocean St	Marshfield	MA	5482563-1				repaired a leak on a riser
2	05/27/2004	05/27/2004	LRSFB	439			Ocean St	Marshfield	MA	5587360-1				REPAIRED LEAK ON RISER CUT & RE THR
2	03/02/2004	03/04/2004	LRSFB	809			Ocean St	Marshfield	MA	5513699-1				change hpc, left off.
1	07/12/2004	07/12/2004	LRSFB	1081			Ocean St	Marshfield	MA	5626642-1				REPLACE LEAKING FIT
2	09/10/2004	10/01/2004	LRSFB	44			Olympia Rd	Marshfield	MA	5678775-1				replaced 1" hpc relight pilots
1	10/14/2004	10/14/2004	LRSFB	634			Plain St	Marshfield	MA	5712260-1				LOCATE CC TURN OFF OK REPAIR LEAK B
2	05/19/2004	05/28/2004	LRSFB	330			Plymouth Ave	Marshfield	MA	5579555-1				REPLACE LEAKING FIT
2	12/20/2004	01/05/2005	LRMXB	495			Plymouth Ave	Marshfield	MA	5776604-1				tighten leaking 2" dresser on Hutch
1	07/06/2004	07/06/2004	LRMXB	75			Preston Ter	Marshfield	MA	5621372-1	Intermedt	Bare Steel	1 1/2 "	CUT OFF LEAKING TEE INSTALLED CLAMP
2	06/30/2004	07/10/2004	LRMXB	190			Saginaw Ave	Marshfield	MA	5617054-1	Intermedt	Bare Steel	2 "	install 2 x 6 clamp
1	06/22/2004	06/22/2004	LRMXB	23			Shawmut Ave	Marshfield	MA	5609190-1	Intermedt	Bare Steel	1 1/2 "	INSTALLED 1 1 1/2" X 6" HB CLAMP M
2	11/08/2004	11/10/2004	LRMXB	44			Shirley St	Marshfield	MA	5738569-1	High	Bare Steel	1 "	installed 1 1/2pc too fix leak on d
											High	Bare Steel	1 "	
1	09/07/2004	09/11/2004	LRSFB	34			Sixth Rd	Marshfield	MA	5674894-1				LOCATED CC BOX RAISED CHANGE HPC -
2	04/26/2004	06/02/2004	LRMXB				Summer St	Marshfield	MA	5558758-1	Intermedt	Bare Steel	3 "	install clamp
1	04/29/2004	04/29/2004	LRSFB	16			Summer St	Marshfield	MA	5562339-1				REPAIRED LEAK AT RISER REPLACED POS
1	04/30/2004	04/30/2004	LRMXB	16			Summer St	Marshfield	MA	5563396-1				REMOVE 1/2" CC & 1/2" LEAKING DRESS

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
2	03/18/2004	03/18/2004	LRSFB	816			Webster St	Marshfield	MA	5527462-1				Locate and riased c.c. box to grade
2	03/05/2004	03/13/2004	SRERB	17			Winston Rd	Marshfield	MA	5517276-1				Renew leaking servi seal pin old te
2	05/28/2004	06/28/2004	LRMXB	11			Adams St	Medfield	MA	5588504-1	Intermedt	Bare Steel	2 "	replaced 2 x 6 full seal and 2 x 3
2	05/28/2004	06/28/2004	LRMXB	31			Adams St	Medfield	MA	5588503-1	Intermedt	Bare Steel	2 "	installed 2 x 6 handiband. please r
2	08/09/2004	08/10/2004	LRSFB	35			Brook St	Medfield	MA	5651022-1	Intermedt	Bare Steel	3/4 "	RAISED CURB BOX AND REPLACED 3/4" H
1	10/22/2004	10/22/2004	LRMXB				Cottage St	Medfield	MA	5721546-1	Intermedt	Bare Steel	3 "	REPAIRED LEAK INSTALLED 3" CLAMP AN
1	12/28/2004	12/18/2004	LRSFB	14			Flintlocke Ln	Medfield	MA	5782270-1				BLEW OUT C.B. & REMADE INSIDE FIT.
2	10/28/2004	10/29/2004	LRMXB	18			Frairy St	Medfield	MA	5727472-1				leak on 2" steel main next to valve
1	10/08/2004	10/06/2004	RTSRB	82			Harding St	Medfield	MA	5707004-1				CUT OFF SERVICE @ MAIN, PINNED. SEE
1	11/09/2004	11/06/2004	SRERB	62			High St	Medfield	MA	5739489-1				INSERTED SERVICE FROM PROPERTY LINE
1	12/15/2004	12/15/2004	LRSXB	133			High St	Medfield	MA	5772986-1	High	Bare Steel	4 "	REPAIRED LEAK ON SERVICE TEE ON MAI
1	03/22/2004	03/20/2004	LRMXB	71			Pleasant St	Medfield	MA	5529772-1	High	Bare Steel	2 "	Repaired leak at cap on flow limite
2	03/31/2004	04/09/2004	LRMXB	71			Pleasant St	Medfield	MA	5538134-1	Intermedt	Bare Steel	2 "	installed 2" x 6" band clamp on mai
2	04/20/2004	04/28/2004	LRMXB	71			Pleasant St	Medfield	MA	5554025-1	Intermedt	Bare Steel	2 "	installed 2" handi band
2	03/31/2004	04/05/2004	LRMXB	91			Pleasant St	Medfield	MA	5538153-1	Intermedt	Bare Steel	2 "	installed 2" handi band on main
1	01/26/2004	02/18/2004	LRMXB	24			Pound St	Medfield	MA	5482220-1				blew out valve and greased
2	04/16/2004	05/12/2004	LRMXB	10			Pueblo Rd	Medfield	MA	5552200-1				GREASED VALVE.
1	06/28/2004	06/26/2004	LRSFB	14			Pueblo Rd	Medfield	MA	5614818-1				RE-CUT AND THREADED RISER. INSTALLE
1	01/24/2004	01/24/2004	LRSFB	88			South St	Medfield	MA	5481112-1				helped John Dodd make leak repairs
1	07/21/2004	07/21/2004	CDMXB	118			South St	Medfield	MA	5634596-1				INSTALLED 6" OF 2" B.S. PRE TEST PI
1	07/26/2004	07/21/2004	SRERB	118			South St	Medfield	MA	5638852-1				RENEWED SERVICE TEE TO C.C. WITH 1/
1	08/25/2004	08/25/2004	CDSXB	133			South St	Medfield	MA	5664244-1				REPAIR 1/2" P.P. SERVICE. INSTALLED
3	02/05/2004	04/15/2005	LRSXC	140			South St	Medfield	MA	5492622-1				rechecked 4/15/05 neg mobil & barte
1	02/03/2004	02/03/2004	SRERB	142			South St	Medfield	MA	5490431-1				leak at c.c. install ft. of 1/2" pl
2	01/29/2004	03/19/2004	LRSXB	133			Spring St	Medfield	MA	5485860-1	Intermedt	Bare Steel	4 "	tighten bolts on 4" full seal and 4
2	01/05/2004	01/06/2004	LRMXB	12			Vinald Rd	Medfield	MA	5461040-1				Took out 20' of Main, took CARO 12
2	05/17/2004	06/22/2004	LRMXB				Brigham St	Medway	MA	5577432-1	Intermedt	Bare Steel	2 "	installed 3 2" handy bands
2	05/03/2004	06/18/2004	SRERB	16			Cottage St	Medway	MA	5565241-1	High	Bare Steel	2 "	renewal 1/2" plastic pipe curb cock
2	06/18/2004	09/08/2004	LRMXB	8			Country Ln	Medway	MA	5606723-1	High	Bare Steel	2 "	installed 2 two inch handibands on
1	04/09/2004	04/09/2004	SRERB	44			Gorwin Dr	Medway	MA	5546784-1				INSERTED STEEL SERVICE W/ 1/2" PLAS
2	07/29/2004	08/06/2004	LRMXB	10			Guernsey St	Medway	MA	5641630-1	Intermedt	Bare Steel	2 "	INSTALLED 2" X 6" CLAMP.
3	12/30/2004	01/03/2005	LRSFB	3			Harding Rd	Medway	MA	5784458-1				REPLACED ROTTED & LEAKING METER FIT
2	01/27/2004	02/04/2004	LRMXB				Highland St	Medway	MA	5483380-1	Intermedt	Bare Steel	3 "	installed 3"x6" band clamp on main
2	04/20/2004	01/04/2005	LRMXB	102			Holliston St	Medway	MA	5554030-1				installed 1 4" handyband clamp on 1
4	07/08/2004	07/07/2004	LRMXB	1			Kenart Rd	Medway	MA	5624044-1				negative results
1	10/02/2004	10/04/2004	LRMXB				Lincoln & Wellington	Medway	MA	5699932-1				Installed 2 - 2" p.c.'s and replace
1	04/14/2004	04/14/2004	LRSFB	600			Mahan Cir	Medway	MA	5550165-1				made repairs to fit at riser
1	01/15/2004	01/14/2004	LRMXB	100			Main St	Medway	MA	5472301-1				clamp 2" main and whap pipe
2	05/17/2004	02/14/2005	LRMXB	232			Main St	Medway	MA	5577421-1				installed 1 1/2" clamp & 2" clamp o
2	05/17/2004	08/07/2004	LRMXB	235			Main St	Medway	MA	5577424-1	Intermedt	Bare Steel	4 "	INSTALLED 2 - 4" HANDI BAND CLAMPS.
2	10/18/2004	11/01/2004	SRERB	267		0	Main ST	Medway	MA	5715304-1	High	Bare Steel	4 "	did complete renewal on 3/4" servic
1	05/12/2004	05/12/2004	LRMXB	101			Maple Ln	Medway	MA	5573857-1	Intermedt	Bare Steel	3 "	INSTALLED 3" CLAMP ON B.S. MAIN & P
2	08/18/2004	09/20/2004	LRMXB	101			Maple Ln	Medway	MA	5657994-1				REPAIRED W/ LEAK 5669286, PER T. CO
2	01/16/2004	02/25/2004	LRMXB	11			Maple St	Medway	MA	5473949-1	Intermedt	Bare Steel	3 "	installed 3" handy band .
2	08/31/2004	09/20/2004	LRMXB	19			Maple St	Medway	MA	5669286-1	Intermedt	Bare Steel	3 "	3" MAIN REPLACED TWO 3" CLAMPS ON M
2	11/18/2004	11/19/2004	LRMXB	20			Maple St	Medway	MA	5748740-1	Intermedt	Bare Steel	3 "	INSTALLED NEW TEE ON 3" MAIN WITH F
1	07/16/2004	07/15/2004	LRMXB	101			Maple St	Medway	MA	5631046-1	Intermedt	Bare Steel	3 "	LEAK ON 3" MAIN. INSTALL 4 BAND CLA
2	08/03/2004	09/20/2004	LRMXB	101			Maple St	Medway	MA	5645646-1				REPAIRED W/ LEAK ORDER 5669286 PER
2	12/03/2004	02/14/2005	LRMXB	41			Milford St	Medway	MA	5762387-1				raised vale box to grade and grease
2	05/18/2004	05/26/2004	LRMXB	3			Oakland St	Medway	MA	5578586-1	Intermedt	Bare Steel	3 "	installed 3" handy band needs to be
2	11/24/2004	12/04/2004	LRMXB	9			Oakland St	Medway	MA	5753834-1	Intermedt	Bare Steel	3 "	installed 1 3 x 6 handi band clamp

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
2	05/19/2004	02/02/2005	LRMXB	11			Oakland St	Medway	MA	5579548-1	Intermedt	Bare Steel	3 "	install 2 handi bands on main. see
2	11/17/2004	12/04/2004	LRMXB				Summer St	Medway	MA	5747455-1				exposed valve box greased leaking v
2	05/05/2004	10/18/2004	LRMXB				Village St	Medway	MA	5567689-1				leaking at petes plug
10/13/04 - 3'														
2	05/17/2004	06/02/2004	LRMXB	30			Wellington St	Medway	MA	5577413-1	Intermedt	Bare Steel	3 "	installed 4 handi bands
2	07/20/2004	08/21/2004	SRERB	89			Farm St	Millis	MA	5633413-1				need op to do tee to cc. renewed cc
1	07/12/2004	07/12/2004	RTSNB	154			Farm St	Millis	MA	5626641-1				CUT OFF 1/2" P.P. @ CURB COCK TEMPO
2	05/20/2004		LRSF	9			Independence Ln	Millis	MA	5580800-1				
1	02/09/2004	02/03/2004	LRSXB	810			Main St	Millis	MA	5495451-1				replaced kero test curb with 1" per
2	07/14/2004		LRSF	1370			Main St	Millis	MA	5628650-1				
1	02/03/2004	02/03/2004	LRSXB	16			Milliston St	Millis	MA	5489989-1				removed kero test, repaired b4 1" p
1	11/26/2004	11/24/2004	LRMXB	206			Dedham St	Norfolk	MA	5755302-1				REPAIR LEAKING GAS VALVE.
1	08/09/2004	08/09/2004	CDSXB	39			Massachusetts Ave	Norfolk	MA	5650916-1				REPAIRED HIT 2" P.P. MAIN WITH 2' 2
3	08/06/2004	02/23/2005	LRSFB	10			Stillwell Ave	Norfolk	MA	5649310-1				repaired small leak on fit
1	01/28/2004	01/27/2004	LRMXB	90			Bay Rd	Norton	MA	5484482-1				leak repaired by standby crew no w
2	08/23/2004	09/11/2004	LRMXB				Dean St	Norton	MA	5662104-1				Work valve, grease valve.
1	12/17/2004	12/17/2004	RTSRB	95			E Main St	Norton	MA	5775108-1				CUT OFF OLD STUB AT MAIN.
3	07/20/2004	09/13/2004	LRSFB	171			Godfrey Dr	Norton	MA	5633431-1				REPAIR FIT LEAK, PAINT FIT.
2	01/31/2004	01/31/2004	LRMXB				Hill St	Norton	MA	5487918-1	Intermedt	Bare Steel	4 "	reoaired small leak at 4" valve and
1	06/28/2004	06/28/2004	SRERB	11			Howard St	Norton	MA	5614967-1	High	Bare Steel	1 "	RENEWAL FULL SERVICE. WELD PUNCTURE
1	09/13/2004	09/12/2004	LRSFB	12			Knollwood St	Norton	MA	5679935-1				REPAIR H.P. FIT.
2	07/28/2004	08/06/2004	LRMXB				Maple St	Norton	MA	5640547-1				GREASED VALVE, STOPPED LEAK. BROKE
2	10/05/2004	10/20/2004	LRMXB				Norton Glen Rd	Norton	MA	5702501-1				installed 1" stee dresser and 18" o
2	06/28/2004	09/14/2004	LRSFB	406			Old Colony Rd	Norton	MA	5614840-1				REPLACE H.P.C. & REPAIR FIT, PAINT.
2	08/23/2004	08/23/2004	LRSFB	141			Plain St	Norton	MA	5662019-1				REPAIRED FIT LEAK.
1	04/12/2004	04/09/2004	LRSXB	7			Robin Cir	Norton	MA	5548250-1				REMOVED KERO-TEST C.C. & REPLACED W
2	08/18/2004	08/23/2004	LRMXB	76			S Worcester St	Norton	MA	5658145-1				old weld was leaking. had welder re
2	08/24/2004	09/07/2004	LRMXB	284			S Worcester St	Norton	MA	5662635-1	Intermedt	Bare Steel	8 "	installed handi band clamp
2	07/28/2004	08/07/2004	LRMXB				S Worcester St	Norton	MA	5640557-1				TIGHTEN DRESSER SAVER NIPPLE SMALL
2	01/05/2004	01/13/2004	LRMXB	83			S Worcester St	Norton	MA	5461100-1	Intermedt	Bare Steel	8 "	instld 1 8/12 full seal clamp
2	06/08/2004	07/23/2004	LRMXB	35			W Main	Norton	MA	5596792-1	Intermedt	Bare Steel	6 "	leak tested pinpointed leak. found
4	09/30/2004	09/16/2004	LRMXB	30			W Main St	Norton	MA	5697725-1				negative results
2	03/24/2004	04/09/2004	LRMXB	153			W Main St	Norton	MA	5532294-1	Intermedt	Bare Steel	6 "	repaired leak using 2 6" handiband
2	04/16/2004	05/03/2004	LRMXB	153			W Main St	Norton	MA	5552193-1	Intermedt	Bare Steel	6 "	replaced 6 x 6 clamp
2	03/01/2004	03/02/2004	LRSXB	155			W Main St	Norton	MA	5512917-1	Intermedt	Bare Steel	6 "	installed 2- 6x6 handi band clamps.
2	09/13/2004	09/13/2004	LRMXB	217			W Main St	Norton	MA	5679876-1				CLAMPED MAIN, USING 1 - 6" FULL SEA
1	09/13/2004	09/12/2004	LRSFB	260			W Main St	Norton	MA	5679940-1				REMADE H.P. FIT.
2	01/05/2004	01/13/2004	LRSXB	267			W Main St	Norton	MA	5461176-1				REPLACED LEAKING KEROTEST C.C. WITH
2	08/19/2004	08/24/2004	SRERB	97			W Main St	Norton	MA	5659395-1	High	Bare Steel	3/4 "	renewed service tee to house using
											High	Bare Steel	6 "	
2	08/24/2004	09/07/2004	LRMXB	278			Worcester St	Norton	MA	5662636-1	Intermedt	Bare Steel	8 "	installed full seal clamp
1	09/10/2004	09/10/2004	CDSXB	4			Captain Vinal Way	Norwell	MA	5678858-1				CHECKED SERVICE HIT & TEE & CC BANG
1	09/14/2004	09/15/2004	CDSXB	9			Captain Vinal Way	Norwell	MA	5681366-1				REPLACE 2' OF .50" PP USED 2 1/2" P
2	06/03/2004	06/04/2004	LRMXB	41			Dana Rd	Norwell	MA	5593255-1	Intermedt	Bare Steel	2 "	install 2 2x6 clamps
4	06/10/2004	06/09/2004	LRMXC	41			Dana Rd	Norwell	MA	5599326-1				negative leak results
1	06/29/2004	06/28/2004	LRSXB	23			Donovan Farm Rd	Norwell	MA	5615653-1				REPLACED 2' OF .50 PP INSTALLED 2 .
1	05/07/2004	05/07/2004	LRMXB	36			Franklin Rd	Norwell	MA	5569974-1	Intermedt	Bare Steel	2 "	replace leaking tee to house 36, pi
2	04/26/2004	05/12/2004	LRMXB	86			High St	Norwell	MA	5558950-1	Intermedt	Bare Steel	2 "	INSTALL 5 2 X 6 CLAMPS & PLURGE NOT
2	07/07/2004	08/07/2004	LRMXB	184			High St	Norwell	MA	5622810-1	Intermedt	Bare Steel	2 "	INSTALLED 2 2" CLAMPS
2	02/12/2004	02/17/2004	LRSFB	78			Main St	Norwell	MA	5498579-1				change hpc and fitting.
1	04/29/2004	04/29/2004	CDSXB	163			Main St	Norwell	MA	5562253-1				INSTALLED2 1 1/4 PERMASET'S & 1' OF
2	01/26/2004	01/28/2004	LRSFB	46			Riverside Dr	Norwell	MA	5482418-1				repair fit leak

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
2	10/06/2004	10/06/2004	LRMXB				Samuel Woodworth Rd	Norwell	MA	5704039-1				GREADED VALVE AND STOPPED LEAK
2	10/08/2004	10/16/2004	SRERB	94			Till Rock Ln	Norwell	MA	5706958-1				RENEW LEAKING SERV HOUSE 94 FROM AI
2	10/12/2004	10/29/2004	LRSFB	466			Washington St	Norwell	MA	5709186-1				installed 1 1/4" cc ok repaired var
2	05/20/2004	05/21/2004	LRMXB				Wilder Rd	Norwell	MA	5580624-1	Intermedt	Bare Steel	2 "	INSTALL CLAMPS
2	10/01/2004	10/25/2004	LRMXB	7		0	Wilder RD	Norwell	MA	5698954-1				installed 1 handiband clamp on bare
2	01/30/2004	02/11/2004	LRMXB	61			Wilder Rd	Norwell	MA	5486902-1	Intermedt	Bare Steel	2 "	install 2 " clamp next to dresser,
2	10/28/2004	10/28/2004	LRMXB				Adams Ave	Pembroke	MA	5727720-1				REPAIRED VALVE GREASED
1	02/05/2004	02/05/2004	LRMXB	41			Allen St	Pembroke	MA	5492663-1				installed 1 " x 6" h.b.
2	12/22/2004	12/19/2004	LRMXB	120			Center St	Pembroke	MA	5779384-1	Intermedt	Bare Steel	4 "	INSTALLED 2 -4" CLAMPS ON BARE STEE
1	05/26/2004	05/26/2004	CDSXB	290			Center St	Pembroke	MA	5585319-1				SQUEEZED OFF & INSTALLED 2 1 1/4" P
1	10/02/2004	10/02/2004	LRSFB	76			Elm St	Pembroke	MA	5699890-1				REPLACE LEAKING FIT
2	09/20/2004	09/20/2004	LRSFB	256			Forest St	Pembroke	MA	5686287-1				LOCATED CC BOX REPAIRED CHANGED CAN
3	01/21/2004	03/24/2004	LRSFB			0	Kilcommons DR	Pembroke	MA	5478051-1				Changed HPC 1 1/4 of fit leak on me
1	09/08/2004	09/08/2004	SRERB	265			Mattakeesett St	Pembroke	MA	5676391-1	Intermedt	Bare Steel	1 "	RENEWED SERVICE FROM TEE TO INSIDE
3	01/26/2004	03/08/2004	LRSFB	300			Oak	Pembroke	MA	5482318-1				Replace HPC 1 1/4 and new reg. lock
1	06/03/2004	06/03/2004	CDSXB				Old Church St	Pembroke	MA	5593196-1				REPAIRED HIT 2" SERVICE INSTALLED 2
1	12/03/2004	12/03/2004	CDSXB	117			Old Church St	Pembroke	MA	5762129-1				REPLACED 1 1/4 PREFAB RISER ONLY IN
2	03/04/2004	03/23/2004	LRMXB				Oldham St	Pembroke	MA	5516301-1				Pin leaking Petes plug.
1	11/15/2004	11/11/2004	RTSRB	246			Plymouth St	Pembroke	MA	5745199-1	Intermedt	Bare Steel	5 "	CUT OFF STUB SERVICE AT MAIN & WELD
2	11/30/2004	12/04/2004	LRMXB	13			Pondview Ave	Pembroke	MA	5758062-1	Intermedt	Bare Steel	1/2 "	installed one 1" hb clamp on leakin
2	03/08/2004	03/12/2004	LRSFB	55			Puritan Rd	Pembroke	MA	5519018-1				Change leaking fit.
1	10/14/2004	10/14/2004	CDSXB	24			Redwood Cir	Pembroke	MA	5712267-1				REPLACE BROKEN SERV TEE & TIE IN GA
1	10/23/2004	10/14/2004	CDMXB	24			Redwood Cir	Pembroke	MA	5722558-1				REPAIR BROKEN 2" PP MAIN
2	05/20/2004	06/05/2004	LRMXB	13			School St	Pembroke	MA	5580552-1	Intermedt	Bare Steel	2 "	installs 2 x 6 clamp (note seams on
2	03/16/2004	04/10/2004	SRERB	33			Water St	Pembroke	MA	5525614-1	Intermedt	Bare Steel	4 "	cut off & pinned leaking service in
1	05/21/2004	05/21/2004	LRSFB	18			Woodbine Ave	Pembroke	MA	5581779-1				REPLACE LEAKING FIT
2	03/09/2004	04/15/2004	LRMXB	26			Yale Rd	Pembroke	MA	5519698-1				instaqlled 2 x 6 clamp 4 x 6 hot
1	06/19/2004	06/19/2004	LRSXB	59			Acorn Dr	Randolph	MA	5607531-1				repair leaking cc
2	01/27/2004	02/02/2004	LRMXB				Adelaide St	Randolph	MA	5483394-1	Intermedt	Bare Steel	1 1/4 "	installed 1.25 clamp on B.S. main 2
1	12/22/2004	12/22/2004	RTSRB	4			Adelaide St	Randolph	MA	5779018-1	Intermedt	Bare Steel	1 1/4 "	CUT OFF 1" BS SERVICE
PLASTIC SERVI														
4	06/07/2004	06/08/2004	SRERB	78			Belcher St	Randolph	MA	5596163-1	Intermedt	Bare Steel	1 "	renewed service from cc to house an
1	11/24/2004	11/22/2004	LRSXB	28			Bossi Ave	Randolph	MA	5753808-1				REPAIR LEAKING CC
2	01/29/2004	02/10/2004	LRMXB				Canton St	Randolph	MA	5485863-1				found compression c. cock leaking,
2	01/16/2004	01/17/2004	LRMXB				Carleton Ave	Randolph	MA	5474413-1	Intermedt	Bare Steel	1 1/2 "	installed 3-1/2x6" handy band clamp
2	01/05/2004	01/20/2004	SRERB	12			Charles St	Randolph	MA	5461189-1	Intermedt	Bare Steel	1 1/4 "	inserted(1/2 plastic)service tee to
2	01/27/2004	02/20/2004	LRMXB	168			Chestnut St	Randolph	MA	5483626-1	Intermedt	Bare Steel	2 "	tightened bolts or exsisting 2" ful
1	05/21/2004	05/21/2004	LRSFB	14			Clark St	Randolph	MA	5581907-1				LOCATED CC AND REPAIR INSIDE FIT LE
1	02/24/2004	02/24/2004	LRSFB	31			Clark St	Randolph	MA	5507157-1				located cc repaired leak below HPC
1	12/14/2004	12/12/2004	SRERB	14			Connolly St	Randolph	MA	5771376-1				RENEW FROM CC TO HOUSE WITH 1/2" P
2	01/29/2004	02/13/2004	LRMXB				Crawford St	Randolph	MA	5485866-1				installed 2" handy band clamp.
1	05/03/2004	04/30/2004	LRSFB	5			Crawford St	Randolph	MA	5565236-1				REPAIRED INSIDE FIT LEAK
1	06/04/2004	06/02/2004	LRSFB	46			E Druid Hill Ave	Randolph	MA	5594373-1				REPLACED 3/4" HPC AND NIPPLE REPAIR
1	06/25/2004	06/24/2004	LRMXB	27			Ely St	Randolph	MA	5612853-1	Intermedt	Bare Steel	1 1/4 "	REPAIR LEAKS WITH 3 1 1/4" CLAMPS
1	05/06/2004	05/06/2004	LRSFB	32			Fitch Ter	Randolph	MA	5568919-1				REPAIRED LEAKING INSIDE METER FIT
1	06/29/2004	06/28/2004	LRMXB	47			Fitch Ter	Randolph	MA	5615641-1				TIGHTENED DRESSOR TO STOP LEAK
1	03/16/2004	03/15/2004	LRMXB	38			Glovers Brook Rd	Randolph	MA	5525109-1				Tightend compression, not on dresse
1	02/03/2004	02/02/2004	LRMXB				Gordan St	Randolph	MA	5490411-1				installed 4- 1 1/2 handband clamps
2	01/27/2004	02/02/2004	LRMXB				Gordon St	Randolph	MA	5483623-1	Intermedt	Bare Steel	1 1/2 "	installed 4- 1 1/2 6 handband clamp
2	01/22/2004	01/29/2004	LRMXB	243			Highland Ave	Randolph	MA	5479266-1	Intermedt	Bare Steel	1 1/2 "	found 2 leaks, repaired by 2- 1 1/
2	11/02/2004	11/04/2004	LRSXB	4			Hill Park Ter	Randolph	MA	5732358-1				removed kero test curb cock and rep
1	02/25/2004	02/24/2004	LRSXB	62			Himoor Cir	Randolph	MA	5507894-1				leak on customer pipe cut off at in

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
1	06/14/2004	06/13/2004	LRSFB	2			Imrie St	Randolph	MA	5602200-1				REPLACE HP & TIE BACK INTO HOUSE PI
4	06/16/2004	06/15/2004	LRMXC	22			Kingcrest Ter	Randolph	MA	5604230-1				negative results
2	06/01/2004	06/01/2004	LRSFB	23			Kingcrest Ter	Randolph	MA	5590613-1				LOCATE RAISED CC BOX REPAIRED LEAK
1	05/27/2004	05/26/2004	LRSFB	9			Madison Ave	Randolph	MA	5587315-1				replaced inside swing fit
2	06/15/2004	06/18/2004	LRMXB				Maple Cir	Randolph	MA	5603127-1	Intermedt	Bare Steel	1 1/2 "	tighten clamp (small leak) water ta
2	01/05/2004	02/23/2004	LRMXB	4			Maple Cir	Randolph	MA	5461196-1	Intermedt	Bare Steel	1 1/2 "	Installed 2 band clamps, (2 holes).
2	11/29/2004	11/19/2004	LRMXB	21			Maple St	Randolph	MA	5756652-1				FROM WOMS 4472188 - FOUND LEAK ON M
2	06/03/2004	06/25/2004	LRSFB	12			Mill St	Randolph	MA	5593140-1				REPLACED HPC
2	10/01/2004	10/07/2004	LRMXB	18			Milton Ter	Randolph	MA	5698955-1	Intermedt	Bare Steel	2 "	INSTALLED 2 IN HANDI BAND ON MAIN R
2	10/21/2004	11/08/2004	LRMXB	18			Milton Ter	Randolph	MA	5720045-1	Intermedt	Bare Steel	2 "	2" clamp on main
1	06/09/2004	06/09/2004	LRSFB	22			Milton Ter	Randolph	MA	5598274-1				REPAIR INSIDE FIT LEAK
1	09/24/2004	09/24/2004	CDSXB	4			N Harriette St	Randolph	MA	5691339-1				REPAIRED HIT SERVICE TESTED RE CONN
1	04/23/2004	04/17/2004	LRMXB	7			N Harriette St	Randolph	MA	5556949-1	Intermedt	Bare Steel	1 1/4 "	INSTALLED 1 1 1/4 X 6" BAND CLAMP
3	04/16/2004	06/01/2004	LRMXB	11			N Harriette St	Randolph	MA	5552152-1	Intermedt	Bare Steel	1 1/4 "	installed 1 11/4" x 6" clamp
2	05/13/2004	05/06/2004	LRSXB	12			N Harriette St	Randolph	MA	5575095-1				FOUND CAP ON TEE TO # 12 LEAKING RE
1	09/27/2004	09/23/2004	CDSXB	17			N Harriette St	Randolph	MA	5693458-1	Intermedt	Bare Steel	1 1/2 "	INSTALLED A 1 1/2" HALD CLAMP AND S
1	05/10/2004	05/10/2004	LRSFB	536			N Main St	Randolph	MA	5571685-1				REPAIRED LEAK BELOW HPC
1	06/02/2004	06/03/2004	LRSFB	729			N Main St	Randolph	MA	5591948-1				repaired inside fit leak. repaired
1	10/14/2004	10/14/2004	LRSFB	818			N Main St	Randolph	MA	5711917-1				REPAIR FIT LEAK AND PIPE WORK
1	02/26/2004	02/26/2004	LRMXB	968			N Main St	Randolph	MA	5509702-1	Intermedt	Bare Steel	1 1/2 "	found 2 seperate leaks repaired by
2	11/22/2004	11/29/2004	LRMXB	23		0	Niles RD	Randolph	MA	5751871-1				greased 2" valve at 23 Niles road.
2	01/22/2004	02/25/2004	LRMXB				North St	Randolph	MA	5479272-1	Intermedt	Bare Steel	3 "	2 holes replaced 1986, clamp first
4	08/30/2004	08/26/2004	LRMXB	239			North St	Randolph	MA	5668269-1				negative results
2	05/27/2004	11/26/2004	LRMXB	468			North St	Randolph	MA	5587392-1				found no readings abovbe 1% in fron
4	06/16/2004	06/15/2004	LRMXC	664			North St	Randolph	MA	5604221-1				negative results
2	01/27/2004	02/25/2004	LRMXB				Oak St	Randolph	MA	5483387-1				located and riased valve blew out,
1	05/14/2004	05/14/2004	LRSFB	9			Phyllis Dr	Randolph	MA	5576069-1				INSTALLED HPC & REPAIRED FIT LEAK
2	01/22/2004	02/04/2004	LRMXB	14			Plain St	Randolph	MA	5479289-1	Intermedt	Bare Steel	2 "	installed 2" clamp on B.S. main
2	03/10/2004	03/12/2004	LRSFB	87			Pond Ln	Randolph	MA	5520724-1				repaired leak at meter fit.
2	06/17/2004	06/18/2004	LRMXB	5			Pond St	Randolph	MA	5605610-1				DUG VALVE & GREASED VALVE WILL NOT
1	05/27/2004	05/27/2004	LRSFB	73			Reed St	Randolph	MA	5587208-1	Intermedt	Bare Steel	1 "	CHANGE HP COCK & FIT
4	06/03/2004	06/01/2004	LRMXB	73			Reed St	Randolph	MA	5593328-1				neg leaks
1	01/05/2004	01/05/2004	SRERB	80			Reed St	Randolph	MA	5461140-1				Renewed SUC inside w/ 1.5 inch p.p.
2	01/16/2004	12/21/2004	LRSXB	5			Regina Rd	Randolph	MA	5473955-1				cancel - rechecked negative in area
1	06/02/2004	05/29/2004	LRSFB	12			Regina Rd	Randolph	MA	5591844-1				REPAIRED LEAKING FITS
2	12/01/2004	01/10/2005	LRSFB	18			Rockefeller St	Randolph	MA	5759062-1				DUG & REPAIRED CURB BOX-REBUILT 2 M
1	12/15/2004	12/15/2004	LRMXB	19			Rockefeller St	Randolph	MA	5772630-1	Intermedt	Bare Steel	2 "	INSTALLED 1 - 2" HANDY BAND
2	11/29/2004	12/02/2004	LRMXB	33			Rockefeller St	Randolph	MA	5756424-1	High	Bare Steel	2 "	installed 2 handy bands main should
1	09/07/2004	08/31/2004	CDSXB	232			S Main St	Randolph	MA	5674907-1				REPAIRED HIT SERVICE INSTALLED 2 1
1	09/07/2004	09/03/2004	CDSXB	232			S Main St	Randolph	MA	5674913-1				REPAIRED 1/2 SERVICE
2	03/16/2004	03/22/2004	LRMXB	22			Sarah St	Randolph	MA	5525566-1		Bare Steel	2 "	Repaired leak using 1-2" haqndy ban
2	03/12/2004	03/12/2004	LRSFB	24			Sarah St	Randolph	MA	5522528-1				Replaced H.P. cock, measures O.K.
2	05/04/2004	05/04/2004	LRSFB	15			Stacy St	Randolph	MA	5566382-1				REPAIRED LEAKS BELOW HPC & ABOVE HP
1	05/03/2004	04/30/2004	LRSFB	3			Sunset Dr	Randolph	MA	5565234-1				REPAIRED INSIDE FIT LEAK
1	10/07/2004	10/07/2004	LRSXB	70			Union St	Randolph	MA	5705651-1				REPAIRED LEAKING 1/2" PP @ FLOWLIMI
2	01/27/2004	03/23/2004	RTMXB				Vesey Rd	Randolph	MA	5483385-1	Intermedt	Bare Steel	2 "	Cut off old main 2" main, (leak app
1	05/18/2004	05/17/2004	LRSFB	17			Virginia Cir	Randolph	MA	5578372-1				REPLACED 3/4" HPC AND STREET ELBOW
1	10/04/2004	10/04/2004	CDSXB	133			Warren Ave	Randolph	MA	5700634-1				NON GAS USER PIPE WAS DEAD CUT OFF
1	10/05/2004	10/05/2004	CDMXB	88			West St	Randolph	MA	5702642-1				SQUEEZED 4" PP 7 REPLACED 4' OF 4"
2	03/05/2004	03/23/2004	LRSFB	14			Woodlawn Rd	Randolph	MA	5516993-1				Greased HPC to repair leak CGI hous
1	06/04/2004	05/31/2004	LRSFB	43			Anthony Rd	Raynham	MA	5594367-1				CUT RISER DOWN, RE-THREADED NEW FIT

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
2	06/29/2004	07/14/2004	LRSFB	770			Broadway	Raynham	MA	5615630-1				REPAIRED LEAK AT H.P.C.
2	10/21/2004	11/03/2004	LRMXB	883		0	Broadway	Raynham	MA	5720048-1				neg 11/2/04
no ethane per dan wile														
3	11/29/2004	02/15/2005	LRSFB	25			Cape Hwy	Raynham	MA	5756854-1				located dug, raised replace fit. re
1	10/13/2004	10/13/2004	LRMXB	300			Cape Hwy	Raynham	MA	5710625-1				REPLACED 1 1/4" PP CURB COCK PURPGE
2	11/29/2004	12/09/2004	LRSFB	300			Cape Hwy	Raynham	MA	5756867-1				repair fit leak paint fit
2	11/29/2004	12/08/2004	LRSFB	300			Cape Hwy	Raynham	MA	5756874-1				REPAIR FIT LEAK
2	11/29/2004	12/17/2004	LRSFB	472			Cape Hwy	Raynham	MA	5756864-1				repair fit leak paint fit
1	10/07/2004	10/07/2004	LRSFB	336			N Main St	Raynham	MA	5705868-1				REPAIRED MULTI FIT LEAK
1	10/28/2004	10/28/2004	CDSXB	1525			New State Hwy	Raynham	MA	5727885-1				REPAIRED 1.25" PP WITH 4' OF 1.25'P
1	09/10/2004	09/10/2004	RTSNB	600			South St	Raynham	MA	5678658-1				Cut off 1 1/4" p.p. service at c.c.
1	10/04/2004	10/04/2004	RTMXB	30			Sunflower Dr	Raynham	MA	5700871-1				REPAIRED 2" P.P. MAIN AFTER HIT. AB
2	11/29/2004	12/09/2004	LRSFB	1			Titicut Rd	Raynham	MA	5756812-1				repair fit leak. paint fit find and
2	11/29/2004		LRSF	104			Titicut Rd	Raynham	MA	5756843-1				
2	03/23/2004	04/02/2004	LRMXB	14			Beal Pl	Scituate	MA	5531202-1	Intermedt	Bare Steel	1 1/2 "	installed 1.50 x 6 clamp in front o
2	01/08/2004	01/26/2004	LRMXB	30			Beal Pl	Scituate	MA	5464650-1	Intermedt	Bare Steel	1 1/2 "	install 1.50 x 6 clamp
1	01/28/2004	01/27/2004	LRMXB	80			Brook St	Scituate	MA	5484569-1	Intermedt	Bare Steel	4 "	install 4x6 clamp
2	02/02/2004	02/23/2004	LRMXB	86			Brook St	Scituate	MA	5489132-1	Intermedt	Bare Steel	4 "	Install clamp.
2	09/17/2004	10/05/2004	LRSFB	4			Brookside Ln	Scituate	MA	5684423-1				removed 1 1/4 x 3/4 coupling redope
2	03/11/2004	03/24/2004	LRSFB	16			Brunswick Ext	Scituate	MA	5521574-1				Replaced riser.
4	06/17/2004	06/16/2004	LRMXB	174			Central Ave	Scituate	MA	5605357-1				negative results
1	09/22/2004	09/22/2004	CDSXB	604			Chief Justice Hwy	Scituate	MA	5689085-1				CUT OUT KINKED 1" CS REPLACED WITH
2	07/26/2004	07/31/2004	LRSFB	18			Collier Ave	Scituate	MA	5638716-1				rebuild meter fit and tie back into
2	09/14/2004	09/14/2004	LRSFB	15			Collier Rd	Scituate	MA	5681221-1				CHANGE LEAKING FIT
1	12/10/2004	12/10/2004	CDMXB				Colonial Way	Scituate	MA	5768833-1				DAMAGED 8" PLASTIC REPLACE A PIECE
1	11/29/2004	11/29/2004	CDMXB	11			Conroy Ter	Scituate	MA	5756432-1	Intermedt	Bare Steel	1 1/2 "	INSTALLED 1 1/2" PC SHORTEN MAIN PC
2	12/21/2004	12/22/2004	LRMXB	11			Conroy Ter	Scituate	MA	5778153-1	Intermedt	Bare Steel	1 1/2 "	installed 1 1/2" pc end cap shorten
2	01/05/2004	03/30/2004	LRMXB	28			Coronet Stetson Rd	Scituate	MA	5461201-1	Intermedt	Bare Steel	6 "	INSTALLED 1 6" X 6" HB
1	11/03/2004	11/03/2004	CDSXB	45			Country Way	Scituate	MA	5733815-1				1" STEEL COMPRESSION CC TIGHTEN NUT
1	04/30/2004	04/30/2004	LRSXB	59			Country Way	Scituate	MA	5563515-1	Intermedt	Bare Steel	3 "	
1	10/28/2004	10/28/2004	LRMXB	81			Country Way	Scituate	MA	5727868-1				TEMPORARY REPAIR INSTALLED 2 HANDI
1	08/31/2004	08/31/2004	LRSXB	107			Country Way	Scituate	MA	5669619-1				renewed service tee to house 70 ft
1	09/07/2004	09/02/2004	LRMXB	107			Country Way	Scituate	MA	5674923-1				installed hb clamp on main @ tee to
1	11/26/2004	11/26/2004	CDSXB	205			Country Way	Scituate	MA	5755276-1				REPLACED CURB COCK INSTALLED 3/4 DR
2	08/12/2004	08/14/2004	LRMXB	810			Country Way	Scituate	MA	5653619-1	Intermedt	Bare Steel	1 1/2 "	installed 4 1 1/2" handi band clamp
1	10/02/2004	09/30/2004	LRMXB	11			Curtis St	Scituate	MA	5699895-1	Intermedt	Bare Steel	2 "	REPAIRED LEAK ON MAIN USING 1 - 2"
2	08/30/2004	02/11/2005	RTSRB	27			Curtis St	Scituate	MA	5668487-1	Intermedt	Bare Steel	2 "	cut off & pinned leaking stub at 2"
1	11/04/2004	11/04/2004	LRMXB				Edgewood Rd	Scituate	MA	5734935-1	Intermedt	Bare Steel	3 "	INSTALLED ONE 3" HAND BAND CLAMP ON
1	11/15/2004	11/15/2004	LRMXB				Edgewood Rd	Scituate	MA	5745411-1	Intermedt	Bare Steel	3 "	INSTALLED 1 3" CLAMP NEXT TO SERVIC
1	11/16/2004	11/16/2004	SRERB	5			Edgewood Rd	Scituate	MA	5746125-1				RENEWED SERVICE TEE TO CC 30' 1/2"
1	07/29/2004	07/27/2004	LRSFB	35			Edgewood Rd	Scituate	MA	5641938-1				LOCATED & DUG CB & REPLACED SWING F
2	05/28/2004	06/08/2004	LRMXB	17			Eleventh Ave	Scituate	MA	5588502-1				INSTALL 2 1 1/2 CLAMPS
1	11/01/2004	11/01/2004	LRSXB	7			Fieldstone Rd	Scituate	MA	5731240-1				REPAIRED LEAKING DRESSER TIGHTEN NU
1	09/14/2004	09/14/2004	LRSFB	17			First Parish Rd	Scituate	MA	5681391-1				CHANGE LEAKING FIT
4	09/30/2004	09/10/2004	LRMXB				Front St	Scituate	MA	5697727-1				negative results
1	01/12/2004	01/12/2004	LRMXB	108			Front St	Scituate	MA	5468638-1				installed 3X6 clamp
1	01/13/2004	01/13/2004	LRMXB	162			Front St	Scituate	MA	5469903-1				REPAIRED LEAK ON 2" DRESSER.
STILL														
1	05/11/2004	05/11/2004	LRMXB	8			Gannett Rd	Scituate	MA	5572623-1	Intermedt	Bare Steel	3 "	INSTALLED 3 3" X 6" HB
1	08/18/2004	08/18/2004	LRSFB	12			Gannett Rd	Scituate	MA	5658254-1				REPAIR LEAK AT METER RAISE UP 12" &
1	11/08/2004	11/07/2004	LRMXB	154			Gannett Rd	Scituate	MA	5738574-1	Intermedt	Bare Steel	2 "	INSTALLED 2" X 6" HANDY BAND CLAMP
2	11/17/2004	01/27/2005	LRMXB	154			Gannett Rd	Scituate	MA	5747474-1				neg per dan wile 1/27/05 readings w

1	09/22/2004	09/22/2004	CDSXB	162	Gannett Rd	Scituate	MA	5689260-1	REPAIRED 1/2" PP SERVICE 3 PP

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
2	10/05/2004	11/23/2004	LRMXB	303			Gannett Rd	Scituate	MA	5702548-1	Intermedt	Bare Steel	3 "	installed 5 handi band and 1 full s
1	09/29/2004	09/20/2004	LRMXB				Glades Rd	Scituate	MA	5695842-1	Intermedt	Bare Steel	2 "	INSTALLED 2 2X6 HANDY BANDS ON 2" B
2	01/07/2004	01/20/2004	SRERB	13			Glades Rd	Scituate	MA	5463294-1	Intermedt	Bare Steel	2 "	cit off & pinned 1" B.S. leaking se
1	11/15/2004	11/15/2004	LRMXB	49			Glades Rd	Scituate	MA	5745313-1	Intermedt	Bare Steel	2 "	INSTALLED 2" HANDI BAND CLAMP ON MA
1	05/21/2004	05/20/2004	LRSFB	86			Glades Rd	Scituate	MA	5581605-1				REPLACED 3/4" POSI LOCK ON OUT SIDE
1	01/29/2004	01/29/2004	CDSXB	113			Glades Rd	Scituate	MA	5485714-1				repair 1/2" broken service
1	11/05/2004	11/03/2004	SRERB	163			Glades Rd	Scituate	MA	5736234-1				RENEW SERVICE FROM TEE TO CC WITH 1
1	12/09/2004	12/09/2004	LRMXB	22			Greenfield Ln	Scituate	MA	5767646-1	Intermedt	Bare Steel	1 1/2 "	REPLACED LEAKING CLAMP BETWEEN TEE
2	01/15/2004	05/12/2005	LRMXB	11			Harbor Heights Rd	Scituate	MA	5472702-1	Belt	Bare Steel	2 "	installed 1 handiband clamp on 2" b
2	10/12/2004	10/14/2004	LRSFB	235			Hatherly Rd	Scituate	MA	5709334-1				TURNED GAS OFF CC THREADED RISER IN
1	01/12/2004	01/07/2004	LRSFB	251			Hatherly Rd	Scituate	MA	5468847-1				remade gas fit locate and repair cc
1	09/30/2004	09/30/2004	LRSFB	51			Hollett St	Scituate	MA	5697488-1				REPLACED ROTTED RISE PLASTIC INSERT
1	05/25/2004	05/25/2004	SRERB	21			Jenkins Pl	Scituate	MA	5584614-1				renew leaking service from main to
2	06/10/2004	06/21/2004	LRMXB	26			Jenkins Pl	Scituate	MA	5599528-1				install clamp
1	05/26/2004	05/26/2004	RTSNB	27			Jenkins Pl	Scituate	MA	5585679-1				CUT OFF & PINNED TEE INSTALLED FL T
1	09/13/2004	09/12/2004	LRMXB				Kent St	Scituate	MA	5679965-1				GREASE VALVE PINPOINT
1	01/27/2004	01/26/2004	LRSXB	23			N River Rd	Scituate	MA	5483578-1				tightened leaking c.c. for unit 23
2	01/27/2004	01/26/2004	LRSXB	30			N River Rd	Scituate	MA	5483583-1				tighten up a leaking c.c. for unit
1	04/26/2004	04/26/2004	LRSFB	110			Oceanside Dr	Scituate	MA	5558941-1				CHANGE FIT
2	10/07/2004	10/15/2004	LRMXB	7			Roberts Dr	Scituate	MA	5705456-1				installed 2" handi band clamp
2	09/24/2004	09/25/2004	LRMXB	1			Second Ave	Scituate	MA	5691242-1				REPLACE LEAKING PP CAP ON PP TEE
1	05/14/2004	05/14/2004	LRSFB	16			Standish Ave	Scituate	MA	5576047-1				REPLACED LEAK ON RISER. WELDED NEW
1	03/23/2004	03/25/2004	LRMXB	9			Stockbridge Rd	Scituate	MA	5530741-1	Intermedt	Bare Steel	4 "	Installed 1 4"x6" handy band clamp.
1	11/22/2004	11/22/2004	CDSXB	183			Stockbridge Rd	Scituate	MA	5752023-1	Intermedt	Bare Steel	4 "	REPAIRED SERVICE TEE TO CC WITH 1"
1	05/28/2004	05/27/2004	LRMXB	187			Stockbridge Rd	Scituate	MA	5588515-1	Intermedt	Bare Steel	1 "	PINNED MAIN WITH STEEL PIN
1	03/01/2004	02/29/2004	SRERB	212			Stockbridge Rd	Scituate	MA	5512758-1				renewed tee to old c.c. with 24' of
1	05/18/2004	05/18/2004	SRERB	218			Stockbridge Rd	Scituate	MA	5578700-1	Intermedt	Bare Steel	4 "	CUT OFF AND PINNED TEE INSTALLED F.
1	11/24/2004	11/24/2004	LRMXB	225			Stockbridge Rd	Scituate	MA	5753927-1	High	Bare Steel	4 "	TEMPORARY REPAIR INSTALLED ONE INCH
1	04/06/2004	01/05/2004	RTSRB	261			Stockbridge Rd	Scituate	MA	5543427-1	Intermedt	Bare Steel	4 "	pin leaking stub.
2	03/23/2004	08/04/2004	LRMXB	9			Tichnor Ct	Scituate	MA	5531205-1	Intermedt	Bare Steel	1 1/2 "	INSTALLED 2 2X6 CLAMPS MAIN VERY PO
1	01/07/2004	01/07/2004	SRERB	156			Turner Rd	Scituate	MA	5463255-1	Intermedt	Bare Steel	3 "	renew leaking serv. from main to ri
1	09/20/2004	09/17/2004	LRMXB	6			Utility Rd	Scituate	MA	5685774-1	Intermedt	Bare Steel	1 1/2 "	INSTALLED 1 1/2 CLAMP ON BS
2	01/07/2004	01/12/2004	LRSXB	21			Washington Ln	Scituate	MA	5463297-1				Remove leaking c.c.
2	02/03/2004	02/03/2004	LRSXB	11			Wheeler Ave	Scituate	MA	5489959-1	Intermedt	Bare Steel	1 "	repaired leak at c.c.
tightend down														
2	03/26/2004	03/29/2004	LRMXB	147			Woodland Rd	Scituate	MA	5534093-1				Install 2x6 clamp.
1	12/28/2004	12/23/2004	CDSXB	74	80		Case Ave	Seekonk	MA	5782329-1				REPLACED 2' OF 1 1/4" P.P. WITH 2'
1	08/24/2004	08/20/2004	LRMXB				County St	Seekonk	MA	5662840-1				replaced 2" gate valve
1	08/20/2004	08/20/2004	LRMXB	17	19		County St	Seekonk	MA	5660438-1	Intermedt	Bare Steel	2 "	INSTALLED 3 - 2" CLAMPS ON 2" BS MA
1	06/02/2004	05/31/2004	SRERB	45			County St	Seekonk	MA	5591853-1				RENEWED SERVICE TEE TO HOUSE, 22' -
2	08/06/2004	08/20/2004	LRMXB	45			County St	Seekonk	MA	5649471-1	Intermedt	Bare Steel	2 "	dug main for leaks and found gas tr
1	06/14/2004	06/12/2004	LRSFB	80			Cypress Rd	Seekonk	MA	5602237-1				REPAIRED INSIDE FIT LEAK.
2	07/08/2004	08/06/2004	LRMXB	89			Fall River Ave	Seekonk	MA	5624041-1	Intermedt	Bare Steel	2 "	INSTALLED 2" X 6" HANDIBAND CLAMP O
1	07/07/2004	07/07/2004	LRMXB	211			Fall River Ave	Seekonk	MA	5622967-1	Intermedt	Bare Steel	4 "	INSTALLED 4' HANDY BAND CLAMP.
2	07/08/2004	08/11/2004	LRMXB	999			Fall River Ave	Seekonk	MA	5624038-1	Intermedt	Bare Steel	4 "	leak tested and pinpointed leak. fo
4	09/30/2004	09/22/2004	LRMXB	1332			Fall River Ave	Seekonk	MA	5697731-1				negative results
4	08/04/2004	08/03/2004	LRMXC	1332	1334		Fall River Ave	Seekonk	MA	5646948-1				negative results
1	05/20/2004	05/20/2004	CDMXB	54			Forest Ave	Seekonk	MA	5580755-1				REPLACED 4' OF 2" PIPE, USING TO EL
1	12/07/2004	12/07/2004	LRSFB	84			Hawthorne Dr	Seekonk	MA	5765445-1				repair fit leak.
2	01/30/2004	02/10/2004	LRSFB	165			Highland Ave	Seekonk	MA	5486684-1				repair leak on H.P.C. and fit.
2	12/14/2004	12/17/2004	LRMXB	44			Hope St	Seekonk	MA	5771276-1		Bare Steel	2 "	installed 7 2" handy band clamps al
2	02/23/2004	02/24/2004	LRMXB	115			Hope St	Seekonk	MA	5506152-1	High	Bare Steel	2 "	Clamp 2" main repair leak.

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
1	09/27/2004	09/27/2004	CDSXB	41			Jean Dr	Seekonk	MA	5693610-1				REPAIRED HIT SERVICE, USING 1' OF 1
2	01/29/2004	02/13/2004	LRMXB				Leann Dr	Seekonk	MA	5485874-1	Intermedt	Bare Steel	2 "	repair 2 leaks with clamps
2	10/18/2004	11/01/2004	LRSXB	3			Read St	Seekonk	MA	5715305-1				TOOK OUT OLD KERO TEST CC REPLACED
2	07/08/2004	08/11/2004	LRMXB	394			Taunton Ave	Seekonk	MA	5624030-1	Intermedt	Bare Steel	2 "	leak tested & pinpointed leak. foun
2	03/01/2004	03/23/2004	LRMXB	400			Taunton Ave	Seekonk	MA	5512776-1	High	Bare Steel	2 "	Repair leak with 1 2" clamp.
2	07/09/2004	09/21/2004	LRMXB	32			Ames St	Sharon	MA	5624951-1				2" CLAMP ON MAIN NEXT TO TEE AND CU
1	04/28/2004	04/28/2004	LRSFB	34			Ames St	Sharon	MA	5561390-1				REPAIR LEAK ON FIT INSIDE CHANGE HP
2	08/18/2004	09/08/2004	LRSXB	49			Arboro Dr	Sharon	MA	5657995-1				deteriorated copper line to gas lam
1	07/09/2004	07/09/2004	CDMXB				Aspen Rd	Sharon	MA	5625134-1				SQUEEDED 2" PLASTIC PIPE & REPLACED
1	05/25/2004	05/25/2004	LRSFB	535			Bay Rd	Sharon	MA	5584577-1				repaired leak below hpc
1	10/12/2004	10/09/2004	RTSNB	57			Beach Rd	Sharon	MA	5709308-1				CUT OFF LEAKING CC 1/2" PP
4	09/02/2004	08/31/2004	LRMXB	127	129		Beach St	Sharon	MA	5671701-1				negative results
2	06/17/2004	07/16/2004	LRMXB	55			Billings St	Sharon	MA	5605353-1	Intermedt	Bare Steel	2 "	repaired corrosion leak on 2" bare
2	06/30/2004	07/16/2004	LRMXB	73			Billings St	Sharon	MA	5616908-1	Intermedt	Bare Steel	1 1/4 "	repaired corrosion leak on 1 1/4" b
2	09/24/2004	11/08/2004	LRMXB	73			Billings St	Sharon	MA	5691246-1	High	Bare Steel	2 "	installed 2" handy band clamp
3	02/13/2004	03/30/2004	LRSFB	81			Bishop Rd	Sharon	MA	5499607-1				Repaired line on 3/4" H.P.
2	07/12/2004	07/14/2004	LRSFB	34			Brook Rd	Sharon	MA	5626624-1				SHUT OFF CURB COCK & CUT OUT LEAKIN
2	10/28/2004	12/04/2004	LRMXB	61			Brook Rd	Sharon	MA	5727681-1	Intermedt	Bare Steel	1 1/4 "	installed three 1 1/4"x 6" clamps o
1	08/13/2004	08/11/2004	SRERB	15			Clark Ct	Sharon	MA	5654788-1	Intermedt	Bare Steel	1 1/4 "	RENEW SERVICE FROM TEE TO CC & INST
1	12/15/2004	12/15/2004	LRSFB	33			Colburn Dr	Sharon	MA	5772815-1				INSTALLED NEW METER FIT AND HIGH PR
2	11/08/2004	11/08/2004	LRMXB	27			Cottage St	Sharon	MA	5738080-1	Intermedt	Bare Steel	2 "	2" clamps on main.
1	04/27/2004	04/26/2004	LRSFB	37			Country Ln	Sharon	MA	5559709-1				DUG & LOCATED CURB BOX & REPLACE CC
1	10/20/2004	10/20/2004	CDSXB	17			Dedham St	Sharon	MA	5718400-1				REPLACED 4' OF 1 1/4 PLASTIC PIPE A
1	02/12/2004	02/12/2004	CDMXB	108			E Foxboro St	Sharon	MA	5498322-1	Intermedt	Bare Steel	1 "	Replaced 4' 1" pipe using 2 1" dre
2	09/24/2004	11/27/2004	LRMXB				East St	Sharon	MA	5691244-1	Intermedt	Bare Steel	6 "	installed 6" handy band on bs main
2	01/07/2004	01/13/2004	LRMXB	2			East St	Sharon	MA	5463372-1	Intermedt	Bare Steel	6 "	Found 3 Leaks. Repaired B-4 (3).
3														
1	04/21/2004	04/21/2004	LRSFB	357			East St	Sharon	MA	5555078-1				REPLACE INSIDE SWING FIT
1	02/12/2004	02/12/2004	LRMXB	387			East St	Sharon	MA	5498278-1	Intermedt	Bare Steel	6 "	installed 6" full seal on bs main
4	07/01/2004	06/29/2004	LRMXC	17			Forest Rd	Sharon	MA	5618447-1				negative results
2	05/20/2004	05/03/2005	SRERB	46			Glendale Rd	Sharon	MA	5580556-1	Intermedt	Bare Steel	1 "	insert 1/2" pp into 1" steel pipe p
1	09/07/2004	09/03/2004	LRSXB	8			Grove Ave	Sharon	MA	5674899-1	Intermedt	Bare Steel	1 "	INSTALLED 1" HANDI BAND ON SERVICE
1	03/22/2004	03/20/2004	LRMXB	40			Gunhouse St	Sharon	MA	5529773-1	Intermedt	Bare Steel	1 1/2 "	
1	03/29/2004	03/29/2004	LRSFB	26			Hampton Rd	Sharon	MA	5536242-1				Dug up to install new box to shut o
2	06/10/2004	09/14/2004	LRSFB	92			Hampton Rd	Sharon	MA	5599241-1				REPAIRED LEAKING FIT
2	10/12/2004	10/18/2004	LRSXB	242			Hampton Rd	Sharon	MA	5709330-1				removed leaking karotest cc flo lim
1	02/17/2004	02/15/2004	LRSFB	26			Harold St	Sharon	MA	5501183-1				repair all leaks, repair c.c. at bo
4	07/20/2004	07/14/2004	LRMXB	26			Harold St	Sharon	MA	5633422-1				negative results
3	04/06/2004		LRSF	12			Johnson Rd	Sharon	MA	5543554-1				
1	05/04/2004	05/03/2004	LRSFB	36			Manns Hill Rd	Sharon	MA	5566331-1				LOCATED DUG RAISED & REPAIRED CURB
2	10/05/2004	10/08/2004	LRMXB	186			Maskwonicut	Sharon	MA	5702542-1	Intermedt	Bare Steel	1 1/2 "	INSTALLED 1 1/2 HANDY BAN
1	07/01/2004	09/14/2004	LRSFB	170			Maskwonicut St	Sharon	MA	5618311-1				REPLACED HIGH PRESSURE COCK AND MET
2	09/16/2004	09/22/2004	LRMXB	186			Maskwonicut St	Sharon	MA	5683550-1	Intermedt	Bare Steel	1 1/2 "	TWO CLAMP ON 1 1/2GAS MAIN
2	09/10/2004	09/12/2004	LRMXB				Massapoag Ave	Sharon	MA	5678391-1	Intermedt	Bare Steel	2 "	INSTALLED HANDY BAND CLAMP ON 2" BS
3	04/29/2004	09/15/2004	LRSFB	160			Mountain St	Sharon	MA	5562240-1				REPAIRED FIT LEAK
2	12/14/2004	12/29/2004	RTSRB	389			N Main	Sharon	MA	5771280-1				cut off 1" stub at main and fixed 1
2	12/08/2004	01/13/2005	LRMXB				N Main St	Sharon	MA	5766383-1				installed 2x6 clamp. greased valve.
2	09/03/2004	09/14/2004	LRMXB				Oak Hill Dr	Sharon	MA	5673166-1				REPAIRED LEAK ON MAIN WITH 2 X 6 HA
2	02/27/2004	03/02/2004	LRMXB				Oakhill Dr	Sharon	MA	5510743-1				installed 2"x 6" band clamp on main
2	04/20/2004	05/25/2004	LRMXB				Oakhill Dr	Sharon	MA	5554053-1				installed handiband clamp
2	09/02/2004	09/14/2004	LRMXB				Oakhill Dr	Sharon	MA	5671816-1				REPAIRED LEAKING 2" CS MAIN WITH 2
2	04/09/2004		LRSF	6			Pequot Cir	Sharon	MA	5546776-1				

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
1	02/17/2004	02/15/2004	SRERB	10			Quincy St	Sharon	MA	5501208-1	High	Bare Steel	1 "	renew c.c. to house.
2	02/17/2004	05/05/2005	SRERB	13			Robin Rd	Sharon	MA	5501667-1				renewed 1" cs service with 1/2" pi
1	08/19/2004	08/19/2004	CDSXB	110			S Main St	Sharon	MA	5659363-1				1/2" PLASTIC BROKEN AT POSI LOCK R
1	07/26/2004	07/26/2004	CDSXB	113			S Main St	Sharon	MA	5638539-1				REPAIR 1/2" SERVICE WITH 2' OF 1/2"
1	07/27/2004	07/27/2004	CDSXB	116			S Main St	Sharon	MA	5639399-1				replaced 2' of 112" pp no change in
2	05/21/2004	06/03/2004	LRSXB	156			S Main St	Sharon	MA	5581749-1				found old stub leaking ran punch do
1	05/05/2004	05/05/2004	CDMXB	224			S Main St	Sharon	MA	5567596-1	Intermedt	Bare Steel	3 "	PINNED 3" BS MAIN AFTER HIT BY OCNT
1	04/06/2004	04/05/2004	LRMXB	236			S Main St	Sharon	MA	5543372-1	Intermedt	Bare Steel	3 "	INSTALLED 3" HANDY BAND ON BS MAIN
1	04/14/2004	04/14/2004	LRSFB	415			S Main St	Sharon	MA	5550236-1				repaired inside fit leak
1	05/27/2004	05/27/2004	LRMXB	438			S Main St	Sharon	MA	5587219-1				GREASED VALVE IN STREET CALL CAME I
1	09/09/2004	09/09/2004	CDMXB	614			S Main St	Sharon	MA	5677325-1				STOPPED OFF NO BLOW TEE & REPLACED
2	06/02/2004	06/03/2004	LRMXB				S Main St	Sharon	MA	5592061-1				repaired leaking valve. still leaki
2	11/08/2004	11/12/2004	LRSXB	6			Saw Mill Pond Rd	Sharon	MA	5738580-1				replaced kero test cc that was leak
3	05/27/2004	07/08/2004	LRSFB	5			Summit Ave	Sharon	MA	5587251-1				REPLACED OLD LEAKING METER FIT W/NE
1	03/25/2004	03/24/2004	LRMXB				Upland Rd	Sharon	MA	5533380-1	Intermedt	Bare Steel	2 "	Installed 2-2" PC nad cut off 1" dr
2	09/16/2004	09/16/2004	LRMXB				Upland Rd	Sharon	MA	5683243-1	Intermedt	Bare Steel	2 "	INSTALLED FOUR TWO 2" CLAMPS ON MAI
1	04/16/2004	04/15/2004	SRERB	32			Upland Rd	Sharon	MA	5552139-1	Intermedt	Bare Steel	1/2 "	RENEWED SERVICE FROM CC TO INSIDE W
1	04/21/2004	04/21/2004	LRSFB	52			Upland Rd	Sharon	MA	5554913-1				repaired by service
1	04/06/2004	04/05/2004	LRSFB	180			Wilshire Dr	Sharon	MA	5543277-1	Intermedt	Bare Steel	1 "	blew out cb repaired inside fit lea
1	07/20/2004	07/20/2004	CDMXB				Woodland St	Sharon	MA	5633432-1				TIED MAIN OVER TO NEW MAIN CUT OFF
2	03/16/2004	03/24/2004	LRMXB	10	12		Woodland St	Sharon	MA	5525621-1	Intermedt	Bare Steel	1 1/2 "	Installed 4' 1/2 band clamps on mai
2	09/24/2004	09/27/2004	LRMXB	27			Woodland St	Sharon	MA	5691251-1	Intermedt	Bare Steel	1 1/4 "	(SEE WO 5486147) CUT MAIN OFF AT PO
2	10/18/2004	09/25/2004	LRMXB	27			Woodland St	Sharon	MA	5715315-1				completed 9/25/04 abandoned by t le
1	03/05/2004	03/05/2004	LRSFB	15			Abbey Ln	Stoughton	MA	5517269-1				repaired leaking fit.
2	02/27/2004	09/16/2004	LRMXB	20	22		Brock St	Stoughton	MA	5510675-1				MAIN REPLACE
1	02/26/2004	02/24/2004	LRMXB	30			Brock St	Stoughton	MA	5509824-1	Intermedt	Bare Steel	6 "	installed 6" handy band clamp.
1	02/26/2004	02/24/2004	LRMXB	40			Brock St	Stoughton	MA	5509826-1	Intermedt	Bare Steel	6 "	installed 6" handy band clamp.
2	03/18/2004	09/16/2004	LRMXB	40			Brock St	Stoughton	MA	5527766-1				MAIN REPLACE
2	03/18/2004	09/16/2004	LRMXB	40			Brock St	Stoughton	MA	5527765-1				MAIN REPLACE
2	03/18/2004	09/23/2004	LRMXB				Canton St	Stoughton	MA	5527762-1	Intermedt	Bare Steel	6 "	INSTALLED 2 -6" SIDE OUT PC'S & MAD
2	06/16/2004	10/29/2004	LRMXB				Canton St	Stoughton	MA	5604460-1				leaking on 1 1/4" tee to main going
2	10/05/2004	12/11/2004	LRMXB				Canton St	Stoughton	MA	5702552-1	Intermedt	Bare Steel	6 "	installed 6" handy band on bare ste
2	12/16/2004	12/18/2004	LRMXB				Canton St	Stoughton	MA	5773832-1	Intermedt	Bare Steel	6 "	fixed leak with 6 x 6 handiband. gr
2	11/17/2004	11/26/2004	LRMXB	82			Canton St	Stoughton	MA	5747484-1	Intermedt	Bare Steel	1 1/4 "	cut off 1 1/4" tee and welded pin.
											Intermedt	Bare Steel	4 "	
1	10/21/2004	10/21/2004	RBSXB	129			Canton St	Stoughton	MA	5720017-1				CUST HAD CC BOX W/EDGAR CANCEL IN A
1	10/16/2004	10/16/2004	RTSRB	178			Canton St	Stoughton	MA	5714495-1	Intermedt	Bare Steel	4 "	CUT OFF STUB
2	06/09/2004	06/23/2004	SRERB	31			Central Dr	Stoughton	MA	5598140-1	Intermedt	Bare Steel	2 "	renewed service tee to cc removed c
2	03/18/2004	12/14/2004	LRMXB				Central St	Stoughton	MA	5527768-1	High	Bare Steel	1 1/2 "	greased valve stopped leak. strange
2	06/30/2004	08/18/2004	LRMXB				Central St	Stoughton	MA	5617025-1	Intermedt	Bare Steel	4 "	
2	10/13/2004	11/17/2004	LRMXB				Central St	Stoughton	MA	5710654-1	High	Bare Steel	6 "	installed 1 6" handy band clamp
2	02/12/2004	08/09/2004	SRERB	365			Central St	Stoughton	MA	5498572-1				
2	06/18/2004	06/19/2004	LRMXB	1144			Central St	Stoughton	MA	5606739-1	Intermedt	Bare Steel	4 "	INSTALLED 2 - 4" HANDY BAND CLAMPS
1	06/21/2004	06/19/2004	LRMXB	1144			Central St	Stoughton	MA	5608309-1	Intermedt	Bare Steel	4 "	REPAIR LEAK WITH ONE 4" CLAMP
2	02/10/2004	02/28/2004	LRMXB	1888			Central St	Stoughton	MA	5496492-1	Intermedt	Bare Steel	6 "	repaired leak by 6"x6" handy band c
2	02/10/2004	04/10/2004	LRMXB	1990			Central St	Stoughton	MA	5496491-1	Intermedt	Bare Steel	6 "	installed 6 x 6 clamp
2	10/18/2004	10/30/2004	LRMXB	2232			Central St	Stoughton	MA	5715306-1	Intermedt	Bare Steel	6 "	installed 2 handiband clamps on 6"
2	07/06/2004	07/20/2004	LRMXB	2240			Central St	Stoughton	MA	5621700-1				previously repaired by t green
2	08/18/2004	01/11/2005	LRMXB	2245			Central St	Stoughton	MA	5658027-1	Intermedt	Bare Steel	6 "	installed handi band on main and ve
2	06/16/2004	07/09/2004	SRERB	8			Connell Dr	Stoughton	MA	5604451-1				cut off old service at main. pinned
1	11/23/2004		LRMX	80			Copperwood Dr	Stoughton	MA	5753021-1				

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
1	03/18/2004	03/18/2004	LRSFB	7			Cornell Dr	Stoughton	MA	5527316-1				Located c.cock. and blew out box as
1	03/09/2004	02/27/2004	LRSFB	50			Cottonwood Dr	Stoughton	MA	5519573-1				replaced 3/4" h.p.c.
1	02/23/2004	02/23/2004	LRSFB	40			Cross St	Stoughton	MA	5506126-1	Intermedt	Bare Steel	1 "	repaired inside swing fit, dug and
1	02/05/2004	02/05/2004	LRSFB	82			Cross St	Stoughton	MA	5492839-1				remade inside fit
locate and repair														
2	02/18/2004	03/12/2004	LRSFB	45			Cushing St	Stoughton	MA	5502392-1				greased H.P. cock .
2	10/12/2004	11/17/2004	LRMXB	345			Cushing St	Stoughton	MA	5709368-1	High	Bare Steel	1 1/4 "	installed 1 11/4 handy band clamp
1	03/09/2004	03/09/2004	LRSFB	79			Donahue Way	Stoughton	MA	5519702-1				located and raised cc box to grade,
1	02/06/2004	02/06/2004	LRSFB	101			Donahue Way	Stoughton	MA	5493723-1				located curb cock, blew out, shut o
1	09/29/2004	09/23/2004	LRSXB	5			Drake Ave	Stoughton	MA	5696037-1				installed 3/4" x 1/2" pt with no fl
4	02/06/2004	02/06/2004	LRSXB	121			Ewing Dr	Stoughton	MA	5493458-1				loosened h.p.c. reteflon pasted an
2	09/09/2004	09/09/2004	LRSFB	5			Glover Dr	Stoughton	MA	5677175-1				RAISED & REPLACED EXISTING FIT
2	09/24/2004	10/04/2004	LRMXB	49			Grove St	Stoughton	MA	5691248-1	Intermedt	Bare Steel	2 "	FIXED TWO 2" LEAKS ON MAIN WITH CLA
2	09/25/2004	09/26/2004	LRMXB	117			Jamie Ln	Stoughton	MA	5692566-1				REPLACED O RING ON PLASTIC PUNCHER
2	11/09/2004	11/12/2004	LRSXB	44			Ledgebrook Ave	Stoughton	MA	5739596-1				TAKE OUT LEAKING CURB COCK PUT IN 1
2	11/17/2004	11/29/2004	LRMXB	44			Ledgebrook Ave	Stoughton	MA	5747478-1				cancel this order per p baker. 5439
1	05/24/2004	05/21/2004	CDSXB	50			Lurie Cir	Stoughton	MA	5583398-1				REPAIRED BROKEN 1/2" PP SERVICE WIT
1	01/08/2004	01/07/2004	LRSXB	7			Manor Dr	Stoughton	MA	5464318-1				CUT OFF OLD GAS LIGHT
1	11/16/2004	11/16/2004	LRMXB				Monk St	Stoughton	MA	5746500-1	Intermedt	Bare Steel	2 "	INSTALLED 2 2" HANDY BAND CLAMPS
1	08/31/2004	08/31/2004	LRMXB				Morton Sq	Stoughton	MA	5669713-1				REPLACED 4' OF 2" PP
1	03/22/2004	03/22/2004	LRSXB	76			Morton St	Stoughton	MA	5530218-1	Intermedt	Bare Steel	1 "	Found 1"sevice leaking, installed 2
2	02/27/2004	09/16/2004	LRMXB	176			Morton St	Stoughton	MA	5510660-1				MAIN REPLACE
2	02/27/2004	09/16/2004	LRMXB	176			Morton St	Stoughton	MA	5510667-1				MAIN REPLACE
2	02/27/2004	09/16/2004	LRMXB	176			Morton St	Stoughton	MA	5510673-1				MAIN REPLACE
2	10/06/2004	10/14/2004	LRMXB	176			Morton St	Stoughton	MA	5704009-1				MAIN ABANDONED DUE TO MAIN REPLACEM
2	03/04/2004	03/25/2004	LRMXB	43			Packard Rd	Stoughton	MA	5516217-1	Intermedt	Bare Steel	2 "	Installed 2"x6" handy band clamp on
1	01/15/2004	01/15/2004	LRMXB	2			Park Ave	Stoughton	MA	5472656-1	Intermedt	Bare Steel	1 1/4 "	Installed 4 1/4 clamps at bt mai
1	12/15/2004	12/15/2004	LRSFB	658			Park St	Stoughton	MA	5772538-1				PIPE WORK AT METER AND NEW HIGH PRE
1	01/15/2004	01/08/2004	LRSFB	883			Park St	Stoughton	MA	5472671-1				Replaced meter fit.
1	08/23/2004	08/24/2004	LRMXB	11			Pearl St	Stoughton	MA	5661814-1	Intermedt	Bare Steel	3 "	INSTALLED 2 3" X 6" CLAMPS ON LEAKI
2	09/03/2004	10/02/2004	LRMXB	11			Pearl St	Stoughton	MA	5673169-1	Intermedt	Bare Steel	3 "	located leak ok cleaned pipe ok ins
1	05/17/2004	05/15/2004	LRMXB	32			Pearl St	Stoughton	MA	5577647-1	Intermedt	Bare Steel	3 "	REPAIRED LEAK ON MAIN WITH 4 X 6 HA
1	05/04/2004	05/04/2004	LRSFB	420			Plain St	Stoughton	MA	5566349-1				BLEW OUT RAISED & REPAIRED CC BOX I
4	07/21/2004	07/20/2004	LRMXB	32			Pleasant St	Stoughton	MA	5634545-1				negative results
1	12/18/2004	12/18/2004	RTSRB	109			Pleasant St	Stoughton	MA	5776078-1	Intermedt	Bare Steel	4 "	CUT OFF SERVICE AT MAIN & WELDED PI
1	01/30/2004	01/30/2004	LRSFB	295			Pleasant St	Stoughton	MA	5486869-1				located, shut off cock repaired fit
2	02/12/2004	03/05/2004	LRMXB	295			Pleasant St	Stoughton	MA	5498581-1	Intermedt	Bare Steel	4 "	replaced bolts on 4" dresser.
2	07/02/2004	11/23/2004	SRERB	449			Pleasant St	Stoughton	MA	5619687-1	High	Bare Steel	1 "	renew gas service 12' removed cc se
											High	Bare Steel	4 "	
2	02/26/2004	03/12/2004	LRSFB	14			Prospect St	Stoughton	MA	5509306-1				Replaced H.P. cock.
2	09/10/2004	10/01/2004	SRERB	33			Record St	Stoughton	MA	5678393-1	Intermedt	Bare Steel	1 1/2 "	renewed servicer from tee to pp ren
2	10/13/2004	10/07/2004	LRMXB	33			Record St	Stoughton	MA	5710276-1	Intermedt	Bare Steel	1 1/2 "	FOUND LEAK ON MAIN CLAMPED W/HANDI
2	12/14/2004	12/14/2004	LRMXB				Rockland St	Stoughton	MA	5771182-1	High	Bare Steel	1 1/4 "	installed 1 11/4" handy band clamp
2	12/20/2004	02/07/2005	LRMXB				Rockland St	Stoughton	MA	5776611-1				tightened 2" dresser ok now
2	12/08/2004	12/11/2004	LRMXB	31			Rockland St	Stoughton	MA	5766389-1	Intermedt	Bare Steel	1 1/4 "	install 3 1.25 x 6 clamps and plurg
2	12/23/2004	01/18/2005	LRMXB	75			Rockland St	Stoughton	MA	5780040-1	High	Bare Steel	1 1/2 "	pinpointed leak, repaired street le
1	11/09/2004	11/12/2004	LRSFB	61			Rogers Dr	Stoughton	MA	5739333-1				REPLACE OUTSIDE METER FIT SWING FIT
1	02/12/2004	02/05/2004	LRSFB	34			Ross St	Stoughton	MA	5498770-1				located raised, 2 blew out c. box,
2	03/05/2004	03/12/2004	LRSFB	52			Ryan Rd	Stoughton	MA	5517233-1				replaced H.P. cock.
1	10/08/2004	10/07/2004	RTSRB				School St	Stoughton	MA	5707009-1	Intermedt	Bare Steel	2 "	CUT OFF LEAKING STUB @ MAIN PINNED
1	10/06/2004	10/06/2004	CDSXB	307			School St	Stoughton	MA	5703447-1				REPAIR BROKEN SERVICE FOR CONTRACT
2	01/20/2004	01/22/2004	LRSFB	279			Seaver St	Stoughton	MA	5477230-1				(curb cock raised)

remade fit (tee

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
1	03/09/2004	03/08/2004	LRSFB	98			Swanson Ter	Stoughton	MA	5519388-1				HPC installed, replaced ell steet
1	08/27/2004	08/27/2004	LRSFB	23			Walnut Ave	Stoughton	MA	5666884-1				repaired inside fit leak ok on vari
2	12/23/2004	01/13/2005	LRSXB	56			Walnut Ct	Stoughton	MA	5780044-1				repaired leak at cc. eliminated cc
1	08/24/2004	08/24/2004	LRMXB	103			Water St	Stoughton	MA	5662742-1				installed 6" handi band clamps
1	03/10/2004	03/09/2004	LRSFB	797			West St	Stoughton	MA	5520381-1				HPC Installed, repaired leak on plu
1	04/01/2004	03/31/2004	LRSFB	797			West St	Stoughton	MA	5539065-1				Repair leaks on service inside, loc
1	03/15/2004	03/15/2004	LRSFB	829			West St	Stoughton	MA	5524020-1				Repair all leaks on service.
2	05/18/2004	08/07/2004	LRMXB	184		0	Willow ST	Stoughton	MA	5578570-1	Intermedt	Bare Steel	1 1/4 "	REPACK 1 1/4 GATE VALVE
1	08/23/2004	08/23/2004	LRMXB	192			Willow St	Stoughton	MA	5661816-1	Intermedt	Bare Steel	1 1/2 "	INSTALLED ONE 1 1/2 X 6 " CLAMP FOR
2	09/08/2004	09/08/2004	LRMXB	192			Willow St	Stoughton	MA	5675952-1				MAIN ABANDONED
1	01/20/2004	01/19/2004	LRMXB					Taunton	MA	5476909-1				installed 4" full seal clamp on cra
1	09/28/2004	09/28/2004	RTSNB	33			4th St	Taunton	MA	5694664-1	Intermedt	Bare Steel	1 1/4 "	CUT OFF SERVICE IN SIDEWALK.
1	06/08/2004	06/08/2004	CDMXB				Alegi Ave	Taunton	MA	5596902-1				REPAIR 2" BROKEN SERVICE WITH TWO E
2	06/23/2004	07/08/2004	LRSXB	87			Amherst Ave	Taunton	MA	5610463-1				removed kero test cc
2	10/05/2004	10/06/2004	LRMXB				Arlington St	Taunton	MA	5702250-1				TIGHTENED 6" DRESSER & GREASED VALV
3	05/26/2004	02/15/2005	LRSFB	33			Baker Rd	Taunton	MA	5585355-1				repaired leak at meter fit. raised
2	10/13/2004	10/25/2004	SRERB	25			Battle Row	Taunton	MA	5710647-1	Intermedt	Bare Steel	2 "	
1	03/03/2004	03/02/2004	LRMXB	325			Bay St	Taunton	MA	5514688-1				replaced leaking clamp on broken ma
1	04/06/2004	04/06/2004	SRERB	575			Bay St	Taunton	MA	5543405-1				RENEW GAS SERVICE, MAIN TO HOUSE.
1	10/14/2004	10/14/2004	SRERB	620			Bay St	Taunton	MA	5712286-1	Low	Bare Steel	1 1/2 "	INSTALLED 1 1/2" STEEL CC & RENEWED
1	05/18/2004	05/18/2004	SRERB	38	40		Benefit St	Taunton	MA	5578578-1				RENEW TEE TO CURB COCK.
1	09/22/2004	09/22/2004	CDSXB	45			Broadway	Taunton	MA	5689199-1				
1	01/21/2004	01/21/2004	SRERB	148			Broadway	Taunton	MA	5477981-1				inserted from c.c. to house
1	02/04/2004	02/04/2004	SRERB	148			Broadway	Taunton	MA	5491388-1				renew c.c. to main
1	02/19/2004	02/20/2004	JCIXB	148			Broadway	Taunton	MA	5503384-1				Found cracked main 1" from HUB 6" C
1	11/13/2004	11/08/2004	JCIXB	179			Broadway	Taunton	MA	5744188-1				SEAL BELL JOINT.
REPAIRED BELL JOIN														
1	03/29/2004	03/29/2004	CDMXB	237			Broadway	Taunton	MA	5536058-1				Repaired broken 2" p.p. main with 2
1	02/02/2004	02/01/2004	LRMXB	62			Cedar St	Taunton	MA	5488748-1				install 1-4"x8" full seal CI clamp
1	12/11/2004	12/11/2004	LRMXB				Chandler Ave	Taunton	MA	5769785-1				installed clamp on 3" ci main to re
1	08/14/2004	08/14/2004	LRMXB	4			Chase St	Taunton	MA	5655569-1				cut off 1" drip from 2" WI main ins
1	01/21/2004	01/21/2004	SRERB	3			Cherry St	Taunton	MA	5478078-1	Low	Bare Steel	1 1/4 "	CUT IN CURB COCK, INSERTED TO CELLA
1	10/12/2004	10/09/2004	LRSXB	33			Cliff Dr	Taunton	MA	5709309-1				remove leaking c.c.
1	05/11/2004	05/11/2004	LRSFB	59			Clifford St	Taunton	MA	5572631-1				REMADE OUTSIDE FIT.
1	01/09/2004	01/09/2004	LRSFB	574			Cohannet St	Taunton	MA	5465732-1				Remade inside fit, repair all leaks
2	01/16/2004	01/20/2004	LRSFB	896			Cohannet St	Taunton	MA	5473881-1				remade gas fit locate and repair c.
1	02/27/2004	02/27/2004	LRSFB	962			Cohannet St	Taunton	MA	5510715-1				repaired all leaks on inside fit re
3	07/13/2004	07/14/2004	LRSFB	295			Constitution Blvd	Taunton	MA	5627610-1				REPAIRED LEAKS AT 2 RISERS 1- ON MA
2	01/16/2004	01/20/2004	LRSFB	35			Dana St	Taunton	MA	5473891-1				remade 425 fit
2	06/23/2004	06/29/2004	LRSFB	400			Danforth Ext	Taunton	MA	5610301-1				repaired fit leak
1	02/04/2004	02/04/2004	LRMXB	64			Danforth St	Taunton	MA	5491162-1				rewrap pipe.
1	02/09/2004	02/09/2004	LRMXB	30			Davenport St	Taunton	MA	5495082-1	Low	Bare Steel	4 "	Found 2 good leaks, repaired by 2-
4	06/03/2004	06/01/2004	LRMXB	70			Devon St	Taunton	MA	5593326-1				neg leak
4	01/12/2004	01/09/2004	RTSNB	10			Dexter Ave	Taunton	MA	5468230-1				Cut Off 1.5 inch service at protie
1	07/31/2004	07/30/2004	CDSXB	10			Dexter Ave	Taunton	MA	5644085-1				REPLACED 2' OF .50 P.P., USED 2 - .
3	12/15/2004	01/11/2005	LRMXB	10			Dexter Ave	Taunton	MA	5772813-1				removed leaking 1/2" end cap by tie
2	02/04/2004	02/26/2004	LRMXB	13			E Broadway	Taunton	MA	5491433-1				seal 6" sleeve
2	05/03/2004	06/03/2004	LRMXB	13			E Broadway	Taunton	MA	5565245-1				disassemble old avon seal clamps. i
1	03/18/2004	03/18/2004	LRSXB	70			E Water St	Taunton	MA	5527242-1				Repaired leaking 6" clamp, repair l
2	06/23/2004	06/29/2004	LRSFB	35			Eldridge St	Taunton	MA	5610293-1				repaired fit leak paint piping. fin
2	06/23/2004	07/09/2004	JXXXB	63			Fremont St	Taunton	MA	5610379-1				SEALED 6" CAST IRON JOINT
1	09/29/2004	09/29/2004	SRERB	91			Fremont St	Taunton	MA	5696019-1	Low	Bare Steel	1 1/4 "	RENEWED SERVICE FROM TEE TO INSIDE

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
2	05/18/2004	06/10/2004	SRERB	9			General Cobb St	Taunton	MA	5578608-1				insert service 1" into house
1	02/09/2004	02/09/2004	LRMXB	53			General Cobb St	Taunton	MA	5495234-1				Cut off leaking 3 /4 drip repair 1
4	07/12/2004	07/09/2004	LRMXB	7			Grant St	Taunton	MA	5626756-1				negative results
2	05/21/2004	06/22/2004	JXXXB	32			Grant St	Taunton	MA	5581756-1				sealed 6" ci joint in front of #32
2	10/18/2004	10/26/2004	JCIXB	32			Grant St	Taunton	MA	5715308-1				sealed bell joint
1	12/14/2004	12/12/2004	SRERB	56			Grant St	Taunton	MA	5771380-1	Low	Bare Steel	1 "	RENEWED FROM C.C. IN WITH 1/2" P.P.
1	03/01/2004	03/01/2004	SRERB	10			Greylock Ave	Taunton	MA	5512751-1				renew gas service main to house
3	05/26/2004	02/15/2005	LRSFB	47			Harrison St	Taunton	MA	5585330-1				fit leak repaired, painted fit
2	07/07/2004	08/04/2004	LRMXB	22			Hart St	Taunton	MA	5622815-1				REPAIR SMALL PLUG LEAK ON TOP OF 6"
1	12/16/2004	12/14/2004	LRMXB	24			Hart St	Taunton	MA	5774131-1				LEAKING WELD. REPAIRED WITH FULL SE
1	12/22/2004	12/22/2004	LRMXB	24			Hart St	Taunton	MA	5779321-1				INSTALLED 2 - 6" FULL SEAL CLAMPS O
1	09/17/2004	09/17/2004	CDMXB	53			Hart St	Taunton	MA	5684345-1				REPAIRED HIT 6" P.P. MAIN WITH PRET
1	09/21/2004	09/17/2004	CDSXB	55			Hart St	Taunton	MA	5687363-1				Repaired broken 1/2" p.p. service.
2	07/21/2004	07/22/2004	LRSFB	69			Hart St	Taunton	MA	5634518-1				REMOVED METER FIT, PLUGGED H.P.C..
1	09/15/2004	09/15/2004	SRERB	81			Hart St	Taunton	MA	5682394-1				RENEWED SERVICE TEE TO OLD C.C., US
1	07/01/2004	07/01/2004	SRERB	99			Hart St	Taunton	MA	5618153-1				RENEWAL TEE TO CURB COCK.
1	10/01/2004	10/01/2004	LRMXB	122			Hart St	Taunton	MA	5698830-1				DUG & FOUND PLASTIC TEE LEAKING @ C
2	05/17/2004	06/04/2004	LRSFB				Highland St	Taunton	MA	5577610-1				repaired fit leat
2	05/17/2004	06/04/2004	LRSFB				Highland St	Taunton	MA	5577612-1				repaired fit leak
1	05/10/2004	05/10/2004	LRSXB	25			Highland St	Taunton	MA	5571727-1				REPLACE LEAKING PERMASET AT RISER.
4	07/02/2004	07/01/2004	LRMXB	30			Highland St	Taunton	MA	5619655-1				neg results
4	07/01/2004	06/25/2004	LRMXC	125			Highland St	Taunton	MA	5618430-1				negative results
2	08/11/2004	08/23/2004	LRMXB	177			Highland St	Taunton	MA	5652699-1	Intermedt	Bare Steel	8 "	installed 1 8" handi band
2	08/30/2004	09/03/2004	JXXXB	177			Highland St	Taunton	MA	5668289-1				installed boot on 4" bj and repaire
1	12/28/2004	12/27/2004	LRMXB	208			Highland St	Taunton	MA	5782224-1	Intermedt	Bare Steel	8 "	Installed 8" full seal clamp & hand
2	01/05/2004	01/07/2004	LRMXB	216			Highland St	Taunton	MA	5460848-1	High	Bare Steel	8 "	Installed 2 eight inch clamps
2	09/01/2004	09/02/2004	JCIXB				Horton St	Taunton	MA	5670743-1	Low	Bare Steel	4 "	installed 2 4" boots on 4" valve. m
2	04/21/2004	05/07/2004	LRSFB	82			Ingell St	Taunton	MA	5554876-1				repaired leaks on roots mtr. mtr fi
1	11/19/2004	11/19/2004	LRMXB	120			Ingell St	Taunton	MA	5750079-1				REPAIRED LEAK AT DRESSER ON 1 1/2"
1	12/30/2004	12/30/2004	LRMXB	120			Ingell St	Taunton	MA	5784428-1				REPAIRED LEAK AT DRESSER & PURGED.
1	01/08/2004	02/17/2004	SRERB	27			Jackson St	Taunton	MA	5464756-1				Renew Service to HP Main.
1	02/10/2004	02/10/2004	SRERB	54			Jackson St	Taunton	MA	5496608-1				new service main to house.
2	03/12/2004	03/29/2004	JXXXB	27			Kilton St	Taunton	MA	5522828-1				Seal one 8" joint seal, one 4" joi
2	06/30/2004	08/06/2004	JXXXB	27			Kilton St	Taunton	MA	5616915-1				NO LEAK FOUND, SHOULD BE RE-RUN. SE
2	08/17/2004	08/18/2004	JCIXB	27			Kilton St	Taunton	MA	5657014-1				removed leaking avon seal install n
1	10/23/2004	10/23/2004	CDSXB	345			King James Blvd	Taunton	MA	5722584-1				INSTALLED 2 50" PERMA SERT COUPLING
1	03/11/2004	03/11/2004	LRMXB				Knight St	Taunton	MA	5521528-1				Broken 4" CI Main, rpeiar with one
1	12/11/2004	12/10/2004	RTSNB	35			Lawrence St	Taunton	MA	5769638-1	Low	Bare Steel	1 "	LEAK AT WALL. CUT IN 1" C.C. & CAPP
1	02/27/2004	02/27/2004	LRSXB	135			Lima Dr	Taunton	MA	5510409-1				found kero test c. cock leaking rem
1	10/25/2004	10/24/2004	SRERB	309			Lothrop St	Taunton	MA	5723849-1				REPLACE SECTION OF PIPE SERVICE SHA
1	04/29/2004	04/29/2004	SRERB	32			Madison St	Taunton	MA	5562392-1				RENEW GAS SERVICE MAIN TO HOUSE.
2	07/01/2004	07/20/2004	SRERB	42			Main	Taunton	MA	5618042-1				install 1 1/4" service back into ce
2	10/27/2004	10/28/2004	LRMXB	4			Maple Ave	Taunton	MA	5726253-1				repaired sleeve with hydrolic cemen
1	10/27/2004	10/26/2004	LRMXB	4			Maple Ave	Taunton	MA	5726506-1				installed vent box
1	06/22/2004	06/22/2004	CDSXB	85			Mayflower Ave	Taunton	MA	5609194-1				REPAIR BROKEN 1/2" SERVICE.
1	05/12/2004	05/12/2004	SRERB	88			Mayflower Ave	Taunton	MA	5573626-1				RENEW PIPE LEAKING.
2	02/10/2004	02/12/2004	LRMXB				McSoley Ave	Taunton	MA	5496211-1				repair broken main with one 4" clam
2	08/12/2004	08/25/2004	SRERB	1149			Middleboro Ave	Taunton	MA	5653814-1				renewed service from tee to cc remo
2	06/14/2004		SRERB	1676			Middleboro Ave	Taunton	MA	5602266-1	High	Bare Steel	6 "	
2	06/18/2004	07/15/2004	LRSXB	1676			Middleboro Ave	Taunton	MA	5606726-1	High	Bare Steel	6 "	install full seal clamp weld leakin
2	06/04/2004	07/27/2004	RTSRB	2			Morton St	Taunton	MA	5594411-1				found old service leaking. cut off

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
2	07/27/2004	07/28/2004	LRSFB	1			Mozzone Blvd	Taunton	MA	5639367-1				SERVICE CUT OFF ON 07/14/04.
1	10/04/2004	10/04/2004	RTSRB	47			Myrtle St	Taunton	MA	5700538-1				Cut off service. installed 1 - 4" f
2	12/27/2004	12/28/2004	LRMXB	34	36		N Walker St	Taunton	MA	5781504-1	Intermedt	Bare Steel	8 "	removed old clamp replaced w/new 8"
2	06/24/2004	08/03/2004	RTMXB	4			North Ave	Taunton	MA	5611488-1				Install 2" handiband. cut off drip
2	06/23/2004	06/28/2004	LRSFB	650			Norton Ave	Taunton	MA	5610535-1				repair hpc fit leak
1	09/23/2004	09/23/2004	CDSXB	1311			Norton Ave	Taunton	MA	5690177-1				REPAIR 1/2" P.P. SERVICE HIT BY CON
1	04/12/2004	04/12/2004	LRMXB	6	8		Oak Ct	Taunton	MA	5548237-1				BLANK 2" PIPE WITH WELD CAP. OPEN 2
1	01/29/2004	02/02/2004	LRMXB				Orchard St	Taunton	MA	5485843-1				repaired crack 4" CI Main .
1	02/02/2004	01/28/2004	JCIXB	40			Orchard St	Taunton	MA	5489284-1				installed PLCS boot on bell joint,
1	06/14/2004	06/14/2004	SRERB	45			Orchard St	Taunton	MA	5602197-1				INSTALL 1 1/4" SERVICE INTO CELLAR
1	06/17/2004	06/14/2004	JXXXB	45			Orchard St	Taunton	MA	5605480-1				SEAL 4" JOINT.
1	01/30/2004	01/28/2004	LRSXB	50			Orchard St	Taunton	MA	5487101-1				tested for leaks, too much water, c
1	05/25/2004	05/25/2004	SRERB	57			Park St	Taunton	MA	5584542-1	Intermedt	Bare Steel	1 "	RENEWED 1" STEEL THRU FOUNDATION &
1	03/30/2004	03/30/2004	SRERB				Plain St	Taunton	MA	5536999-1				renew gas service main to house
1	08/16/2004	08/16/2004	CDSXB	48			Plain St	Taunton	MA	5656100-1				REPAIRED BROKEN LINE WITH 2' OF 1/2
1	04/22/2004	04/22/2004	SRERB	60			Plain St	Taunton	MA	5555870-1				RENEW MAIN TO HOUSE.
1	08/26/2004	08/26/2004	CDMXB	67			Plain St	Taunton	MA	5665444-1				CLOSED VALVE ON DRIP RISER AFTER HI
2	05/03/2004	05/25/2004	SRERB	71			Plain St	Taunton	MA	5565244-1				renew service street to house
1	04/29/2004	04/30/2004	SRERB	72			Plain St	Taunton	MA	5562361-1				renewed 1/2" pp service thru leakin
1	09/23/2004	09/23/2004	SRERB	88			Plain St	Taunton	MA	5690372-1				RENEW SERVICE TEE TO HOUSE.
1	10/27/2004	10/27/2004	CDSXB	111			Plain St	Taunton	MA	5726411-1				REWRAPPED SVC NO DAMAGE
1	10/26/2004	10/26/2004	CDSXB	117			Plain St	Taunton	MA	5724773-1				REPAIRED 1/2" PP WITH 3' OF 1/2" PP
4	06/16/2004	06/15/2004	LRMXC	2			Pleasant View St	Taunton	MA	5604264-1				negative results
2	06/23/2004	06/28/2004	LRSFB	337			Powderhorn Dr	Taunton	MA	5610540-1				replace hpc paint fit
2	12/23/2004	03/17/2005	LRSXB	20			Quail Dr	Taunton	MA	5780061-1				remove cc
1	02/03/2004	02/03/2004	RTSNB	20			Randall St	Taunton	MA	5490328-1	Low	Bare Steel	3/4 "	cut off 3/4" drip line- should be
2	06/23/2004	07/15/2004	LRSFB	61			Robert Treat Paine Dr	Taunton	MA	5610531-1				repair fit leak paint piping
2	03/08/2004	03/13/2004	JXXXB	4			Russell St	Taunton	MA	5519055-1				seal leaking 4" bj
1	01/23/2004	01/21/2004	LRMXB				School St	Taunton	MA	5480084-1				install 1-6" servi seal over broken
1	08/30/2004	08/30/2004	CDSXB	296			Shagbark Rd	Taunton	MA	5668598-1				REPAIREDHIT SERVICE.
1	08/28/2004	08/28/2004	LRMXB				Short St	Taunton	MA	5667844-1	High	Bare Steel	2 "	2" nipple leaking at valve. should
2	06/08/2004	10/20/2004	LRSXB	70			Short St	Taunton	MA	5596795-1				SERV. RENEWED 09/09/04. MAIN ABANDO
1	01/09/2004	01/08/2004	LRSXB				Somerset Ave	Taunton	MA	5465592-1	Low	Bare Steel	1 1/2 "	DRESSER IN NEW PIPE 1 1/2" C.S. PIP
2	01/14/2004	11/29/2004	LRMXB				Somerset Ave	Taunton	MA	5471265-1				6"main abandoned 11/22/04 leak elim
2	03/01/2004	05/12/2005	LRMXB				Somerset Ave	Taunton	MA	5512779-1				this wo not needed see wo 5897409
2	01/14/2004	11/29/2004	LRMXB	78			Somerset Ave	Taunton	MA	5471169-1				6" main abandoned 11/22/04 leak eli
2	01/14/2004	03/22/2004	RTSRB	308			Somerset Ave	Taunton	MA	5471183-1				Cut off stub on 6" CI Main.
2	02/17/2004	02/19/2004	RTSRB	322			Somerset Ave	Taunton	MA	5501656-1				cut off 2- 1 1/4" stubs on 6" CI m
2	03/26/2004	04/08/2004	JXXXB	351			Somerset Ave	Taunton	MA	5534223-1				seal 14" b.j.
2	05/05/2004	12/29/2004	LRMXB	351			Somerset Ave	Taunton	MA	5567693-1				dug leak found nothing (return)
2	09/16/2004	12/15/2004	SRERB	441			Somerset Ave	Taunton	MA	5683568-1				renew service cut off old service i
1	01/08/2004	01/08/2004	LRSXB	473		0	Somerset AVE	Taunton	MA	5464705-1	Low	Bare Steel	1/2 "	REMOVED LEAKING COUPLING, INSTALL T
2	01/14/2004	03/13/2004	JCIXB	492	502		Somerset Ave	Taunton	MA	5471200-1				found 14" joint leaking-installed 1
2	06/17/2004	07/26/2004	SRERB	1521			Somerset Ave	Taunton	MA	5605352-1	Intermedt	Bare Steel	3/4 "	replaced curb cock with 1/2" permas
1	08/19/2004	08/19/2004	CDSXB	71			Stevens St	Taunton	MA	5659410-1				REPAIR & REPLACE 1 1/4" LINE TO BUI
1	10/21/2004	10/21/2004	SRERB	9	11		Third Ave	Taunton	MA	5720020-1	Low	Bare Steel	1 1/4 "	WALL LEAK INSERTED 1 1/4" WITH PP 1
1	05/12/2004	05/12/2004	CDSXB	1			Tremont Ave	Taunton	MA	5573561-1				REPAIR HIT SERVICE. RELO HIT SERVIC
1	10/21/2004	10/21/2004	SRERB	138			Tremont St	Taunton	MA	5719674-1				RENEWED SVC WITH 1.25 PP
1	12/22/2004	12/22/2004	RTSRB	199			Tremont St	Taunton	MA	5779325-1				CUT OFF HIT STUB AT MAIN WITH 1 1/4
1	12/21/2004	12/21/2004	SRERB	200			Tremont St	Taunton	MA	5778098-1				INSTALLED LOW PRESSURE 1 IN P.P. -
1	03/02/2004	03/01/2004	SRERB	223			Tremont St	Taunton	MA	5513541-1				installed 6" servi seal insert 40 i

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
1	04/06/2004	04/04/2004	SRERB	273			Tremont St	Taunton	MA	5543530-1	Low	Bare Steel	1 1/4 "	2 - 1 1/4" X 6" BAND CLAMP. RENEW A
1	10/01/2004	10/01/2004	SRERB	110			Viking St	Taunton	MA	5698968-1				RENEWED SERVICE TEE TO INSIDE.
1	03/29/2004	03/27/2004	SRERB	18			W Britannia St	Taunton	MA	5535724-1				INSERT #18 WITH 30' - 1 1/4" MAIN T
1	02/06/2004	01/07/2004	LRMXB	29			W Britannia St	Taunton	MA	5493837-1				installed 6" servi-stela clamp on c
2	08/31/2004	12/03/2004	LRMXB	500			W Water	Taunton	MA	5669288-1				main abandoned 12/2/04 leak elimina
1	03/22/2004	03/20/2004	LRSXB	605			W Water St	Taunton	MA	5530292-1				Threaded and capped 2" line inside
3	06/02/2004	06/21/2004	LRSFB	704			W Water St	Taunton	MA	5592075-1				Change h.p.c. on bypass & relite ap
2	06/02/2004	06/18/2004	LRSFB	740			W Water St	Taunton	MA	5592073-1				CHANGE H.P.C. & RELITE.
2	06/23/2004	06/29/2004	LRSFB	79			W Britannia St	Taunton	MA	5610307-1				REPAIR FIT LEAK. REPAIR BOX C.C. RA
1	03/16/2004	03/16/2004	RTSRB	300			W Britannia St	Taunton	MA	5525210-1				Cut off service at main.
2	03/12/2004	12/03/2004	LRMXB				W Water St	Taunton	MA	5522862-1				main abandoned 12/2/04 leak elimina
2	06/02/2004	11/30/2004	LRSFB	109			W Water St	Taunton	MA	5592076-1				CUT IN VALVE FOR CAR WASH. ALSO CUT
1	08/28/2004	08/28/2004	LRMXB	600			W Water St	Taunton	MA	5667858-1				NO LEAK FOUND. BUILDING CLEAR, PURG
1	03/24/2004	03/24/2004	LRSXB	4			W Weir St	Taunton	MA	5531932-1	Low	Bare Steel	1 "	CLAMP 1" B.S. SERVICE. METERS WILL
1	02/09/2004	02/09/2004	LRMXB				Weir St	Taunton	MA	5495708-1				Installed 4" full seal clamp over c
2	06/03/2004	09/13/2004	LRMXB	49			Weir St	Taunton	MA	5593315-1				REPAIRED VALVE & REPACKED VALVE STE
2	01/05/2004	02/11/2004	LRMXB	270			Weir St	Taunton	MA	5461238-1				repair leaking gas valve, both join
2	02/17/2004	02/27/2004	LRMXB	270			Weir St	Taunton	MA	5501655-1				gate valve repack, no leaks found.
1	03/24/2004	03/24/2004	SRERB	29			White Pine Dr	Taunton	MA	5532091-1				renew cc to house
1	05/03/2004	05/03/2004	CDMXB				White St	Taunton	MA	5565213-1	Low	Bare Steel	3 "	TAPPED 3" BAG HOLE & REPLACED 3' OF
2	06/02/2004	06/04/2004	LRSFB	2	4		White St	Taunton	MA	5592077-1				repaired fit leak
3	05/26/2004	01/07/2005	LRSFC	20			White St	Taunton	MA	5585327-1				survey 1/7/05 rm/sa neg. call off.
1	03/08/2004	03/06/2004	SRERB	32			White St	Taunton	MA	5518564-1				Partial Renewal tee to curb 14'-1 1
3	05/26/2004	01/07/2005	LRSFC	33			White St	Taunton	MA	5585326-1				survey 1/7/05 neg rm/sa. main aban
2	03/12/2004	03/26/2004	SRERB	1			Whitehill St	Taunton	MA	5522832-1				Renew gas service main to house, se
2	07/01/2004	07/08/2004	LRSFB				Whittenton St	Taunton	MA	5618107-1				REPAIRED BY JAY 07/08/04.
REPAIRED														
2	03/08/2004	04/05/2004	JXXXB	105	107		Whittenton St	Taunton	MA	5519050-1				repaired leak at 4" joint
1	11/10/2004	11/10/2004	LRSXB	426			Whittenton St	Taunton	MA	5741056-1	Low	Bare Steel	2 "	2" clamp on service, need to renew
2	06/23/2004	06/29/2004	LRSFB	595			Whittenton St	Taunton	MA	5610312-1				repair fit leak paint cust piping r
1	09/15/2004	09/15/2004	LRSFB	69			Williams Ave	Taunton	MA	5682336-1				REPAIRED FIT LEAK. MUST RETURN TO R
2	07/21/2004	07/29/2004	LRSFB	31			Winslow Dr	Taunton	MA	5634544-1				REPAIR LEAK. SERVICE IS O.K.
1	03/08/2004	03/08/2004	SRERB	46			Winter St	Taunton	MA	5518888-1				renew c.c. to house, install t.s an
1	03/01/2004	02/29/2004	RTSRB	24			Winthrop St	Taunton	MA	5512768-1				cut off old 1 1/2 bs at main and n
1	08/09/2004	08/09/2004	CDSXB	282			Winthrop St	Taunton	MA	5650915-1				REPAIRED BROKEN 1 1/4" SERVICE TO M
2	06/01/2004	06/08/2004	LRMXB	427			Winthrop St	Taunton	MA	5590413-1	High	Bare Steel	2 "	install two 2" clamps
2	08/11/2004	09/07/2004	LRMXB	427			Winthrop St	Taunton	MA	5652700-1	High	Bare Steel	2 "	inst 2" handiband
1	12/02/2004	12/02/2004	LRMXB	427			Winthrop St	Taunton	MA	5760317-1	Intermedt	Bare Steel	2 "	INSTALLED ONE 2" X 6" CLAMP ON MAIN
1	12/16/2004	12/17/2004	LRSXB	555			Winthrop St	Taunton	MA	5774229-1				LOWERED EXPOSED 1 1/4" SERVICE, 1 1
1	10/16/2004	10/16/2004	LRMXB	7			Allston Dr	Walpole	MA	5714496-1				INSTALLED 2" HANDI BAND ON MAIN & V
2	11/02/2004	11/10/2004	LRMXB	15			Charles St	Walpole	MA	5732337-1	Intermedt	Bare Steel	2 "	2" clamp on main pipe in poor cond.
2	10/18/2004	11/06/2004	LRMXB	50			Charlotte Rd	Walpole	MA	5715309-1	Intermedt	Bare Steel	3 "	cut 3" steel pipe off at end of mai
2	10/13/2004	10/20/2004	LRMXB	7			Chickering Ln	Walpole	MA	5710656-1				take out compressing coupling put i
1	03/09/2004	03/11/2004	LRMXB				Common St	Walpole	MA	5519525-1	Intermedt	Bare Steel	2 "	See leak differenr spot, had filled
2	06/14/2004	06/23/2004	LRMXB	103			Common St	Walpole	MA	5601952-1	Intermedt	Bare Steel	2 "	installed 2 handi bands
2	09/16/2004	11/09/2004	LRMXB	103			Common St	Walpole	MA	5683572-1	Intermedt	Bare Steel	2 "	installed 2" handy band clamp to re
1	03/11/2004	03/11/2004	LRMXB	268			Common St	Walpole	MA	5521453-1	Intermedt	Bare Steel	2 "	installed 3- 2"x6" handy band clamp
2	03/30/2004	03/30/2004	LRMXB	268			Common St	Walpole	MA	5536790-1	Intermedt	Bare Steel	2 "	Installed 6 clamps in 2 different a
2	07/20/2004	08/09/2004	SRERB	598			Common St	Walpole	MA	5633415-1				RENEWED 3/4" C.S. SERVICE W/ 1/2" P
1	03/01/2004	03/01/2004	LRSXB	5			Drake Cir	Walpole	MA	5512911-1				renewed kero test c.c. and repalced
2	04/12/2004	01/02/2005	LRMXB				East St	Walpole	MA	5548039-1				valve eliminated when main abandone
2	06/14/2004	11/30/2004	LRMXB	427			East St	Walpole	MA	5601955-1	High	Bare Steel	6 "	installed 6" clamp

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
2	04/06/2004	04/07/2004	LRSXB	44			Edgewood Ave	Walpole	MA	5543443-1				repaired service
2	10/05/2004	10/12/2004	LRMXB	15			Ellis St	Walpole	MA	5702554-1	Intermedt	Bare Steel	2 "	INSTALLED 2 - (2X6) HANDIBAND CLAMP
2	09/08/2004	09/08/2004	LRSXB				Hilltop St	Walpole	MA	5675930-1				replaced leaking 1 1/4" permaset cu
2	06/18/2004	08/16/2004	LRMXB				Kendall St	Walpole	MA	5606727-1	Intermedt	Bare Steel	2 "	installed 2" CLAMP ON BARE STEEL MA
2	01/05/2004	01/12/2004	LRSXB	15			Lake Ave	Walpole	MA	5461220-1				MAIN ABANDONED, LEAK TAKEN ARE OF -
2	03/29/2004	03/29/2004	LRMXB	14			Maple St	Walpole	MA	5535663-1	Intermedt	Bare Steel	2 "	Installed 2" full seal clamp on mai
2	11/23/2004	11/16/2004	LRMXB				Nectar Rd	Walpole	MA	5752601-1				repaired leaking 2" valve. greased.
2	11/18/2004	12/02/2004	LRMXB				North St	Walpole	MA	5748931-1				greased leaking valve. replaced val
4	12/01/2004	12/02/2004	LRMXB				North St	Walpole	MA	5759465-1				per p baker duplicate wo# 5748431 c
1	05/26/2004	05/26/2004	LRSFB	435			Old Post Rd	Walpole	MA	5585274-1				replaced hpc and fit and tied in le
2	01/05/2004	01/17/2004	LRSXB	7			Patty Ann Pl	Walpole	MA	5461028-1				remove .50 kerotest and curb cock.
1	08/17/2004	08/15/2004	SRERB	129			Pleasant St	Walpole	MA	5657123-1	High	Bare Steel	3/4 "	renewed service cc to house using 2
2	02/12/2004	02/18/2004	LRMXB				Robbins Rd	Walpole	MA	5498352-1				Found dresser couplings leaking, ab
1	03/26/2004	03/25/2004	LRMXB				School St	Walpole	MA	5534286-1	Intermedt	Bare Steel	2 "	Installed 2"x6" band clamps on main
2	05/18/2004	07/10/2004	LRMXB				School St	Walpole	MA	5578573-1	Intermedt	Bare Steel	2 "	installed 2 handiband clamps on mai
2	07/20/2004	07/20/2004	LRMXB	249			School St	Walpole	MA	5633361-1	Intermedt	Bare Steel	2 "	installed 2" handiband on main rene
2	06/14/2004	07/15/2004	LRMXB	257			School St	Walpole	MA	5601949-1	Intermedt	Bare Steel	2 "	repaired leaks on 2" main installed
2	12/14/2004	12/14/2004	LRMXB	12			Towle Rd	Walpole	MA	5771188-1				installed one 2" x 6" clamp on main
1	04/07/2004	04/07/2004	SRERB	255			Union St	Walpole	MA	5544455-1				CUT IN CURB COCK & INSERT SERVICE T
1	09/07/2004	09/06/2004	CDSXB	12		3	Vintage Farm Ln	Walpole	MA	5674917-1				REPAIRED HIT SERVICE. BROKE ELECTRI
2	06/14/2004	11/26/2004	LRMXB	469			Washington St	Walpole	MA	5602263-1	Intermedt	Bare Steel	4 "	4" clamp on main
1	02/26/2004	02/06/2004	LRMXB	639			Washington St	Walpole	MA	5509605-1	Intermedt	Bare Steel	4 "	installed 4"full seal on BS Main.
2	09/20/2004	09/25/2004	LRMXB	1280			Washington St	Walpole	MA	5685983-1				installed 6 xc 6 handi band clamp
2	08/18/2004	08/19/2004	LRMXB	1476			Washington St	Walpole	MA	5657989-1	Intermedt	Bare Steel	6 "	Repaired leak on main wirth 6x6 han
2	02/17/2004	02/28/2004	LRMXB	1690			Washington St	Walpole	MA	5501657-1	High	Bare Steel	6 "	clamp 6" main.
2	09/20/2004	01/21/2005	LRMXB	33			Water St	Walpole	MA	5685991-1	Intermedt	Bare Steel	6 "	installed one 6" x 6" clamp on main
1	04/16/2004	04/16/2004	LRMXB	54			Water St	Walpole	MA	5552133-1	Intermedt	Bare Steel	6 "	installed 6" handiband clamp on lea
1	03/01/2004	03/01/2004	CDSXB	227			West St	Walpole	MA	5512480-1				Water Dpt. digging, hit old dead 1"
2	08/19/2004	09/24/2004	LRMXB				Wolcott Ave	Walpole	MA	5659394-1				DIG 3 X 3 HOLE AT VALVE, TAKE PLUG
1	02/24/2004	02/24/2004	LRMXB	7			Woodland Rd	Walpole	MA	5507069-1	Intermedt	Bare Steel	3 "	installed 3"x6" clamp
1	02/13/2004	02/13/2004	RTMXB	18			Bryant St	West Bridgewater	MA	5499423-1	Intermedt	Bare Steel	1 "	leak tested and pinpointed leaks, 1
2	02/12/2004	03/03/2004	LRMXB	10			Charles St	West Bridgewater	MA	5498586-1	Intermedt	Bare Steel	2 "	leak tested and pipointed leak, fou
2	09/13/2004	09/24/2004	LRSFB	164			Copeland St	West Bridgewater	MA	5679934-1				INSTALLED NEW METER FIT AND RELIGHT
1	02/12/2004	02/12/2004	LRMXB	420			Crescent St	West Bridgewater	MA	5498348-1	Intermedt	Bare Steel	2 "	installed one 2"x6" full seal clamp
4	08/30/2004	08/19/2004	LRMXB	53			Grant St	West Bridgewater	MA	5668275-1				neg results
1	01/15/2004	12/17/2003	LRMXB	19			High St	West Bridgewater	MA	5472699-1	Intermedt	Bare Steel	2 "	INTALLLED 2" HB LEAKING MAIN APPROX
2	01/05/2004	01/12/2004	LRSFB	547			Manley St	West Bridgewater	MA	5461205-1				Made repairs to leak - 1/12/04 0318
2	04/20/2004	05/25/2004	LRMXB	448			Matfield St	West Bridgewater	MA	5554038-1	Intermedt	Bare Steel	4 "	leak tested and pinpointed leak. fo
2	04/01/2004	05/18/2004	LRMXB	458			Matfield St	West Bridgewater	MA	5539155-1				REPLACED 4" CLAMP WITH 4" FULL SEAL
2	06/08/2004	08/26/2004	LRMXB	455			N Elm St	West Bridgewater	MA	5596813-1				cancel/ replaced main on street @ t
2	01/16/2004	02/20/2004	LRSXB	550			N Main St	West Bridgewater	MA	5473820-1				replaced kerotest c.c. with new per
2	02/17/2004	02/26/2004	LRMXB	111			Prospect St	West Bridgewater	MA	5501660-1	Intermedt	Bare Steel	3 "	old weld leaking used 3" serviseal
1	06/01/2004	06/01/2004	LRMXB	192			S Main St	West Bridgewater	MA	5590383-1	Intermedt	Bare Steel	4 "	LEAK TESTED & PINPOINTED LEAK FOUND
2	10/27/2004	12/03/2004	LRSFB	382			Spring St	West Bridgewater	MA	5726426-1				REPAIR HPC STOP LEAK
4	05/10/2004	05/06/2004	LRMXC	10			Blake Rd	Wrentham	MA	5571465-1				neg leak
1	04/14/2004	04/14/2004	LRMXB	470			Dedham St	Wrentham	MA	5550128-1	Intermedt	Bare Steel	4 "	Found welded pin leaking, repaired.
2	03/31/2004	04/17/2004	LRMXB	655			Dedham St	Wrentham	MA	5538136-1		Bare Steel	4 "	repair leak with one 4" clamp
1	05/18/2004	05/18/2004	SRERB	195			East St	Wrentham	MA	5578390-1				INSERTED SERVICE C.C. TO RISER.
1	01/05/2004	01/05/2004	LRSFB	279			East St	Wrentham	MA	5460889-1				repaired leaking 1 1/4" hpc leak fo
1	01/05/2004	01/05/2004	LRSFB	289			East St	Wrentham	MA	5460867-1				repaired 1 1/4 hpc leak found by ch
2	07/01/2004	07/07/2004	LRMXB	663			East St	Wrentham	MA	5618039-1	Intermedt	Bare Steel	6 "	installed 6" handiband clamp on cor

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
2	12/03/2004	12/24/2004	SRERB	750			East St	Wrentham	MA	5762386-1	Intermedt	Bare Steel	6 "	installed 1 6" full seal on main. r
2	12/28/2004	12/24/2004	LRMXB	750			East St	Wrentham	MA	5782495-1				installed 1 6" full seal on main
2	11/22/2004	11/29/2004	LRMXB	720			Franklin	Wrentham	MA	5751884-1	Intermedt	Bare Steel	6 "	install 6" full seal clamp on main
2	01/14/2004	02/08/2005	LRSXB	201			Franklin St	Wrentham	MA	5471220-1				dup up valve ck for leak neg. not a
2	04/08/2004	04/09/2004	LRMXB	708			Franklin St	Wrentham	MA	5545832-1	Intermedt	Bare Steel	6 "	REPLACED TEE. PINNED OLD TEE FLOW L
2	04/22/2004	04/27/2004	LRMXB	720			Franklin St	Wrentham	MA	5556239-1	Intermedt	Bare Steel	6 "	installed 6" handy band on 6" bare
2	11/04/2004	11/15/2004	LRMXB	15			Jennifer Dr	Wrentham	MA	5735337-1				dug up service tee leak at cap
1	12/01/2004	11/30/2004	LRSXB	121			Lakeside Ave	Wrentham	MA	5759059-1				REPLACED 4' OF 1" PLASTIC PUNCTURED
2	05/05/2004	05/10/2004	SRERB	5			North St	Wrentham	MA	5567694-1				inserted service cc to riser remove
2	06/08/2004	07/07/2004	LRMXB	346			South	Wrentham	MA	5597077-1	Intermedt	Bare Steel	4 "	replaced 4 x 6 handiband with anoth
2	04/14/2004	04/15/2004	LRSFB	121			Taunton St	Wrentham	MA	5550354-1				replaced leaking hpc on steel riser
2	12/14/2004	12/18/2004	LRMXB	181			Winter St	Wrentham	MA	5771606-1	High	Bare Steel	3 "	repair leak with one full seal 3" c

Total : 1586

End of Report

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

REPORT PARAMETERS

Division :	Brockton
Leak Class :	(All)
Pipe Type :	Coated Stl
Pipe Size :	(All)
Pipe Pressure :	(All)
From Date :	01/01/2004
To Date :	12/31/2004
Status From :	
Status To :	

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
1	04/23/2004	04/23/2004	SRERB	19			4th St	Attleboro	MA	5556947-1				RELIEVED 2ND STBY CREW. RENEWAL, CU
1	05/21/2004	05/21/2004	LRMXB	85			Adamsdale Ave	Attleboro	MA	5581781-1				CLAMP MAIN 2". PURGE, HIGH READINGS
1	06/18/2004	06/17/2004	LRSFB	59			Black Oak Dr	Attleboro	MA	5606493-1				
1	01/14/2004	01/13/2004	SRERB	55			Bliss Ave	Attleboro	MA	5470758-1				ReCC and Replace with 1/2 plastic a
1	01/14/2004	01/13/2004	LRSXB	55			Bliss Ave	Attleboro	MA	5471515-1				Remove C.C., Replace with 5 ' of 1/
2	05/18/2004	07/12/2004	LRMXB	28			Bourne Ave	Attleboro	MA	5578522-1				installed three 2 x 6 handiband cla
2	06/08/2004	08/05/2004	LRMXB				Brown St	Attleboro	MA	5596787-1				INSTALLED 3" X 6" HANDIBAND CLAMP O
1	09/22/2004	09/22/2004	LRMXB	142			Brown St	Attleboro	MA	5689086-1				CUT OFF STUB & PINNED MAIN & INSTAL
1	08/09/2004	08/07/2004	SRERB	180			Brown St	Attleboro	MA	5650960-1	Intermedt	Coated Stl	3/4 "	Leak at punch & tee. Replace tee on
2	01/05/2004	02/02/2004	LRMXB	375			Brown St	Attleboro	MA	5461043-1				Repaired leak on 3" main, installed
1	03/31/2004	03/30/2004	LRMXB	375			Brown St	Attleboro	MA	5537838-1				Install 1-3" full seal.
2	01/05/2004	01/26/2004	LRMXB	396			Brown St	Attleboro	MA	5461074-1				repaired leak on 3" b.s main using
1	03/01/2004	03/01/2004	LRMXB				County St	Attleboro	MA	5512463-1				removed 2 old press on seals, insta
2	07/20/2004	08/13/2004	LRMXB				County St	Attleboro	MA	5633410-1				leak tested and pinpointed leak. fo
1	06/15/2004	06/15/2004	SRERB	142			County St	Attleboro	MA	5602906-1				Renewed srvc from c.c. in, previous
1	03/18/2004	03/18/2004	LRSFB	109			Dean St	Attleboro	MA	5527562-1				Installed new 1 1/4 HPC.
1	03/01/2004	02/28/2004	LRSFB	37			Dennis St	Attleboro	MA	5512744-1				changed leaking meter, raised burie
2	07/22/2004	08/09/2004	JXXXB	57			Dennis St	Attleboro	MA	5635862-1				SEAL 6" BELL JOINT.
2	03/04/2004	03/29/2004	JXXXB				Elizabeth St	Attleboro	MA	5516264-1				Sealed 5 joints- 2 on a Regular Hub
3	09/02/2004	09/02/2004	LRSXB	34			Forest St	Attleboro	MA	5672197-1				see 5669497
1	03/08/2004	03/08/2004	SRERB	22			Franklin St	Attleboro	MA	5518962-1				renewed service c.c. to house using
1	07/20/2004	07/20/2004	SRERB	32			Grant St	Attleboro	MA	5633706-1	Intermedt	Coated Stl	1 "	Renewed service from c.c. to house.
1	07/19/2004	07/19/2004	LRMXB	31			Greenhill Ave	Attleboro	MA	5632806-1	Intermedt	Coated Stl	2 "	INSTALLED 2 CLAMPS ON 2" MAIN (CHES
2	07/30/2004	08/07/2004	RTMXB	31			Greenhill Ave	Attleboro	MA	5642802-1	Intermedt	Coated Stl	2 "	CUT 2" STUB OFF AT VALVE.
1	07/23/2004	07/23/2004	CDSXB	33			Guisti Dr	Attleboro	MA	5636873-1				REPLACED 1' OFF 1/2" PLASTIC WITH 2
2	05/03/2004	06/04/2004	SRERB	4			Hazelwood Ave	Attleboro	MA	5565225-1				renewed service from tee to propert
1	04/06/2004	04/03/2004	JCIXB	14			Hodges St	Attleboro	MA	5543542-1				AVON SEAL 4" BELL JOINT.
2	02/17/2004	02/18/2004	LRSXB	79			Hollcott Dr	Attleboro	MA	5501647-1	Intermedt	Coated Stl	1 1/4 "	Clamped 1 1/4 service pipe using
2	08/23/2004	08/26/2004	JXXXB				Horton St	Attleboro	MA	5662115-1				avon sealed 3 joints on 3 way tee.
2	11/22/2004	12/13/2004	JCIXB	35			James St	Attleboro	MA	5751820-1				avon seales 8" joint
1	01/02/2004	01/02/2004	SRERB	24			John St	Attleboro	MA	5459492-1				Renewed service from main to inside
2	12/14/2004	01/03/2005	SRERB	25			Lawn St	Attleboro	MA	5771258-1				renewed service relocate service to
1	12/22/2004	12/19/2004	LRMXB	40			Lawn St	Attleboro	MA	5779264-1				INSTALLED 3 - 2" HANDY BANDS ON B.S
1	11/12/2004	11/12/2004	LRSXB	55			Leedham St	Attleboro	MA	5742831-1				LEAK ON KEROTEST C.C. REMOVED C.C.
1	11/26/2004	11/12/2004	LRSXB	55			Leedham St	Attleboro	MA	5755231-1				LEAK ON KEROTEST C.C. REMOVED C.C.
1	12/14/2004	12/12/2004	LRMXB				Locust St	Attleboro	MA	5771445-1				DISASSEMBLED & REPACKED GATE VALVE.
2	05/13/2004	01/10/2005	LRMXB	407			Locust St	Attleboro	MA	5574583-1				removed 2" 4" handy band and insta
1	12/14/2004	12/14/2004	LRMXB	499			Locust St	Attleboro	MA	5771410-1				REPACKED VALVE & LOCUST & OAKHILL.
4	09/10/2004	09/09/2004	LRMXB	178			Main St	Attleboro	MA	5678375-1				negative results
2	10/07/2004	10/22/2004	JXXXB	185			Maple St	Attleboro	MA	5705461-1				installed one 6" avon boot
1	02/02/2004	02/02/2004	LRSXB	64			Mechanic St	Attleboro	MA	5489365-1				replaced leaking carotest cc with 1
2	03/16/2004	03/30/2004	LRSXB	64			Mechanic St	Attleboro	MA	5525573-1				Repaired leak, had to cut off old r
2	11/02/2004	11/16/2004	LRMXB	208			Mendon Rd	Attleboro	MA	5732344-1				repaired leak using 1 4" handy band
1	03/02/2004	03/02/2004	JCIXB				N Main St	Attleboro	MA	5513793-1				sealed 5" joint.
2	03/04/2004	05/23/2004	LRMXB	200			N Main St	Attleboro	MA	5516270-1				CUT OFF DRIP RISER & CEMENTED COVER
2	11/23/2004	11/17/2004	LRMXB				Newport	Attleboro	MA	5752596-1				5732368 completed installed 2 clamp
1	09/17/2004	09/17/2004	LRMXB	369			Newport Ave	Attleboro	MA	5684443-1				clamp main handiband
2	11/02/2004	11/17/2004	LRMXB	369	389		Newport Ave	Attleboro	MA	5732368-1				repaired leaks in 2 separate locati
2	10/21/2004	11/04/2004	LRMXB	950			Oak Hill Ave	Attleboro	MA	5720035-1				repaired leak using 1-4" handi band
2	02/20/2004	03/05/2004	LRMXB	1049			Oak Hill Ave	Attleboro	MA	5504436-1				repaired leak using 1-4" handy band
1	11/19/2004	11/19/2004	LRMXB	2			Oakhill Ave	Attleboro	MA	5750219-1	Intermedt	Coated Stl	1 1/4 "	Leak on threads on valve, riser sid

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
1	12/18/2004	12/13/2004	LRMXB	58			Old Stagecoach Rd	Attleboro	MA	5776097-1				REPAIRED LEAKING GATE VALVE.
2	10/08/2004	10/21/2004	JCIXB	73			Orange St	Attleboro	MA	5706988-1				installed 2 6" avon boots
2	06/30/2004	08/02/2004	JCIXB	79			Orange St	Attleboro	MA	5617027-1				FOUND LEAK ON 6" ENCAPSULATION KIT
1	04/02/2004	04/02/2004	LRMXB	12			Park Ave	Attleboro	MA	5540425-1				CLAMPED MAIN, USING 1 - FULL SEAL.
2	02/27/2004	04/06/2004	LRMXB				Park St	Attleboro	MA	5510549-1				clamped main using 2 - 2" handi ban
1	09/18/2004	09/14/2004	CDSXB				Park St	Attleboro	MA	5685250-1				SHUT OFF SERVICE AT C.C. TO BE CUT
2	05/15/2004	05/20/2004	RTMXB	2			Park St	Attleboro	MA	5576868-1				CUT END OF MAIN. INSTALLED DRESSER
1	04/26/2004	04/26/2004	SRERB	14	16		Park St	Attleboro	MA	5558793-1				REPLACED PIPE 4' OF 2" STEEL BACK T
2	02/23/2004	03/10/2004	LRMXB	1201			Park St	Attleboro	MA	5506190-1				Service tee to #1201 was leaking.
1	02/19/2004	02/19/2004	LRMXB	1503			Park St	Attleboro	MA	5503443-1				installed 4" handy band on 4" BS
1	02/23/2004	02/23/2004	LRMXB	1503			Park St	Attleboro	MA	5505987-1				leak tested and pipointed leak, rep
1	02/24/2004	02/24/2004	LRMXB	1503			Park St	Attleboro	MA	5507083-1				repair leak with one 4" clamp, purg
1	10/02/2004	10/01/2004	LRMXB	1503			Park St	Attleboro	MA	5699897-1				INSTALLED 1 - 4" FULL SEAL CLAMP ON
3	07/02/2004	09/13/2004	LRSFB	5			Peckham St	Attleboro	MA	5619623-1				RETHREADED RISER. INSTALLED NEW FIT
1	03/09/2004	03/09/2004	RTSRB	16			Perrin	Attleboro	MA	5519603-1				cut off service at main installed 1
1	09/16/2004	09/16/2004	CDMXB	205			Pine St	Attleboro	MA	5683311-1				CONTRACTOR HIT PIPE, NOT OURS.
2	08/30/2004	10/05/2004	JXXXB				Pleasant St	Attleboro	MA	5668475-1				avon seal 5 joints all 1 ' away fro
1	02/18/2004	02/18/2004	LRSFB	1077			Pleasant St	Attleboro	MA	5502645-1				repaired fit leak.
2	05/25/2004	08/02/2004	JCIXB				Robert St	Attleboro	MA	5584653-1				Repaired leaking encapsulation join
4	02/18/2004	02/14/2004	RTSRB	3			Robert St	Attleboro	MA	5502320-1				cut off service clamp main w/ 4" ha
1	12/18/2004	12/18/2004	CDSXB	253			Robinson Ave	Attleboro	MA	5776058-1				REPAIRED 1/2" PLASTIC SERVICE.
1	05/14/2004	05/14/2004	SRERB	30			S Main St	Attleboro	MA	5576027-1				INSERTED 1.25" P.P. FROM C.C. IN TO
2	04/29/2004	04/24/2004	LRSFB	418			S Main St	Attleboro	MA	5562242-1	Intermedt	Coated Stl	3/4 "	REPAIRED LEAK ON OUTSIDE METER FIT.
2	09/10/2004	10/04/2004	LRSXB	146			South Ave	Attleboro	MA	5678385-1				Installed 3 - 2" handi bands on 2"
2	05/18/2004	07/16/2004	SRERB	7			Sturdy St	Attleboro	MA	5578520-1				renewed service from main to end w/
2	11/08/2004	11/15/2004	LRMXB	21			Tappan Ave	Attleboro	MA	5738567-1				repaired leak on drip. installed ne
2	08/27/2004	09/14/2004	LRMXB				Thacher St	Attleboro	MA	5666825-1				REPAIRED LEAK ON SAVER NIPPLE.
1	04/30/2004	04/30/2004	LRSXB				Wall St	Attleboro	MA	5563378-1				FOUND DAMAGE TO 2" SERVICE. REMOVED
2	08/30/2004	09/14/2004	LRMXB				Washington St	Attleboro	MA	5668288-1				REPAIRED LEAK ON MAIN & VALVE. VALV
2	03/04/2004	03/23/2004	JXXXB	32			West St	Attleboro	MA	5516268-1				6" CI coupling leaking, Avon Sealed
2	03/04/2004	03/25/2004	LRMXB	63			West St	Attleboro	MA	5516240-1				Cut off old drip that was leaking.
2	02/20/2004	02/03/2004	LRSXB	68			Wilmarth St	Attleboro	MA	5504440-1				replaced leaking tee with a 3/4 " x
2	04/02/2004	04/10/2004	LRMXB	86			Wilmarth St	Attleboro	MA	5540557-1				installed 2" full seal on B S main
1	04/23/2004	04/23/2004	LRMXB	86			Wilmarth St	Attleboro	MA	5556943-1				installed 1 h.b. clamp on main - pu
1	05/18/2004	05/18/2004	LRMXB	86			Wilmarth St	Attleboro	MA	5578376-1				LEAK ON 2" 1928 MAIN 2 - 2" X6" BAN
2	05/20/2004	08/09/2004	LRMXB	97			Wilmarth St	Attleboro	MA	5580529-1				REPLACE MAIN IN AREA OF LEAKAGE - C
2	04/26/2004	05/13/2004	RTSRB	8			Wolfenden St	Attleboro	MA	5558946-1				CUT OFF 1.25" STUB SRVC THAT WAS NO
2	11/19/2004	11/20/2004	LRMXB	4			Yale St	Attleboro	MA	5750002-1				installed on 2" handyband this mai
2	07/28/2004	08/02/2004	LRMXB				Bodwell St	Avon	MA	5640566-1				LEAK TESTED & PINPOINTED LEAK REPAI
2	11/23/2004	12/03/2004	LRSXB	3			Bruce St	Avon	MA	5752919-1				removed leaking cc with 3' of 1/2"
1	11/23/2004	11/21/2004	CDSXB	173			E Spring St	Avon	MA	5753001-1				REPAIRED BROKEN 1/2" PP SERIVE WITH
2	05/03/2004	06/08/2004	LRMXB				Gill St	Avon	MA	5565232-1				leak tested and pinpointed leak. fo
1	09/30/2004	09/30/2004	CDSXB	21			Granite St	Avon	MA	5697238-1				CUT BACK 8' OF STEEL INSTALLED 8' O
1	09/13/2004	09/13/2004	CDMXB	76			Highland St	Avon	MA	5680091-1				INSTALLED TWO 2" DRESSERS AND INSTA
1	07/21/2004	07/21/2004	CDSXB	500			Page St	Avon	MA	5634757-1	Intermedt	Coated Stl	1 1/4 "	REPLACED HIT SERVICE
1	06/11/2004	06/11/2004	CDSXB	82			South St	Avon	MA	5600411-1				REPAIRED BROKEN PIPE WITH PERMA SER
2	04/09/2004		LRSF	13			Apache Rd	Bellingham	MA	5546779-1				
1	03/12/2004	03/12/2004	CDSXB	19			Harper Blvd	Bellingham	MA	5522635-1	Intermedt	Coated Stl	1 "	Located and raised c.cock, rewrappe
2	11/04/2004	11/17/2004	LRMXB				Hartford Ave	Bellingham	MA	5735335-1				repaired leaking grease riser on va
2	11/29/2004	12/17/2004	LRMXB				Hartford Ave	Bellingham	MA	5756279-1	Intermedt	Coated Stl	4 "	installed 2 4" pc's and replaced 4"
1	01/10/2004	01/10/2004	LRSFB	17			N Main St	Bellingham	MA	5467154-1				Replace regulator on AL 800 Meter a

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
1	12/10/2004	12/10/2004	CDMXB	1201			Old Bridge	Bellingham	MA	5768881-1				installed 2 - 2" dressers & a 4' x
1	02/19/2004	02/19/2004	CDSXB	1602			Old Bridge Ln	Bellingham	MA	5503477-1				repaired broken svc with permaset c
1	02/20/2004	02/20/2004	CDSXB	1603			Old Bridge Ln	Bellingham	MA	5504350-1				repaired broken svc-hit with jack h
2	02/04/2004	06/30/2004	SRERB	105			Plymouth Rd	Bellingham	MA	5491105-1	Intermedt	Coated Stl	2 "	renewed service with 1/2" pp from t
1	06/02/2004	05/30/2004	LRSFB	19			Roberta Ln	Bellingham	MA	5591847-1	Intermedt	Coated Stl	1 "	REPAIRED LEAKING FIT.
2	03/09/2004	04/02/2004	LRSFB	2			S Maple St	Bellingham	MA	5519647-1				Replaced HP cock and reducer.
2	06/03/2004	07/17/2004	LRMXB	84			Auburn St	Bridgewater	MA	5593242-1				install 1.5 x 6 clamp
1	11/20/2004	11/20/2004	LRMXB				Bedford St	Bridgewater	MA	5750972-1	Intermedt	Coated Stl	2 "	replaced 5' of 2" bare steel with 5
2	10/21/2004	10/20/2004	LRSFB	859			Bedford St	Bridgewater	MA	5720037-1				completed by # 0702 see ticket 9493
1	01/21/2004	01/21/2004	LRSFB	1345			Bedford St	Bridgewater	MA	5478393-1				change leaking hpc
1	05/24/2004	05/23/2004	LRSXB	17			Blueberry Knls	Bridgewater	MA	5583404-1				replaced a leaking permaset couplin
2	02/27/2004	07/06/2004	LRMXB				Broad St	Bridgewater	MA	5510554-1				made repair with 4 x 6 handi band c
2	01/29/2004	04/08/2004	LRMXB	136			Broad St	Bridgewater	MA	5485845-1	Intermedt	Coated Stl	6 "	NIPPLE LEAKING INSTALL 6" SERV SEAL
1	04/21/2004	04/29/2004	SRECB	136			Broad St	Bridgewater	MA	5554955-1	Intermedt	Coated Stl	6 "	4/21/04 renew leaking service from
2	04/30/2004	04/30/2004	LRMXB	136			Broad St	Bridgewater	MA	5563447-1				install 6" clamp with 2" oulet 6"x
2	04/15/2004	06/14/2004	LRMXB	103			Center St	Bridgewater	MA	5551314-1				negative % at curb cock
1	12/30/2004	12/30/2004	LRMXB				Central Sq	Bridgewater	MA	5784543-1				VALVE LEAKING, USED VAL TEX TO LUBE
2	04/15/2004	05/19/2004	LRMXB	35			Country Dr	Bridgewater	MA	5551310-1				TIGHTEN AND DOPE TEE CAP ON SERVICE
2	08/31/2004	09/14/2004	LRMXB	70			Dean St	Bridgewater	MA	5669280-1				REPAIRED LEAKING VALVE CLASS 1 WHEN
1	11/09/2004	11/09/2004	LRMXB				Grove St	Bridgewater	MA	5739605-1	Intermedt	Coated Stl	6 "	GREASED 6" VALVE
2	03/26/2004	04/20/2004	LRSXB	464			High St	Bridgewater	MA	5534220-1				TEE & FLO LIMITOR LEAKING REPLACE T
2	04/26/2004	05/24/2004	SRERB	479			High St	Bridgewater	MA	5558762-1				renew tee to curb cock pin old tee
2	01/29/2004	01/30/2004	LRSXB	1084			High St	Bridgewater	MA	5485608-1	Intermedt	Coated Stl	1 "	replaced 1' of ritted pipe on riser
2	05/13/2004	07/15/2004	SRERB	25			Lantern Ln	Bridgewater	MA	5575026-1	Intermedt	Coated Stl	2 "	renew leaking service from main to
1	07/26/2004	07/23/2004	LRMXB	355			Laurel St	Bridgewater	MA	5638856-1	Intermedt	Coated Stl	4 "	REPAIR LEAKING TEE TO HOUSE 355
2	05/03/2004	07/15/2004	LRMXB	47			Lawrence Ave	Bridgewater	MA	5565253-1				install clamp
1	05/13/2004	05/13/2004	LRMXB	32			Leonard St	Bridgewater	MA	5574995-1				CUT OFF AND PINNED F.L. LEAKING TEE
2	09/30/2004		LRSF	40	41		Meadow Ln	Bridgewater	MA	5697708-1				
1	03/10/2004	03/10/2004	RTSNB	55			Miranda Way	Bridgewater	MA	5520646-1				Cut off leaking stub.
2	05/17/2004	06/07/2004	LRMXB	111			Mount Prospect St	Bridgewater	MA	5577439-1				install clamp
2	05/13/2004	06/09/2004	SRERB	182			Pleasant St	Bridgewater	MA	5574627-1				renew service pin old tee weld
1	09/15/2004	09/15/2004	CDMXB	734			Pleasant St	Bridgewater	MA	5682340-1	Intermedt	Coated Stl	8 "	SLIDE 8" FULL SEAL CLAMP OVER HOLE
2	05/18/2004	06/17/2004	LRMXB	25			Robin Rd	Bridgewater	MA	5578603-1	High	Coated Stl	2 "	grease valve flush valve operate va
2	08/03/2004	10/07/2004	LRMXB	49			South St	Bridgewater	MA	5645686-1	Intermedt	Coated Stl	1 "	REPAIRED LEAKING DRESSER ON SERVIC
1	09/02/2004	09/02/2004	CDSXB	25		133	Stonemeadow Dr	Bridgewater	MA	5671750-1				REPLACE 4' OF 1/2" PP
2	03/12/2004	03/29/2004	JXXXB					Brockton	MA	5522868-1				Leak tested and pipointed leak. Fo
1	02/02/2004	02/01/2004	SRERB	29			Allen St	Brockton	MA	5489105-1				leak tested and pinpointed leak, f
1	02/19/2004	02/19/2004	RTSRB	22			Annis Ave	Brockton	MA	5503557-1				cut off old 1" service , not in use
1	12/22/2004	12/20/2004	JCIXB	12			Appleton St	Brockton	MA	5779236-1				AVON SEALED 4" BELL JOINT.
1	04/06/2004	04/04/2004	LRSXB	50			Ash St	Brockton	MA	5543547-1				leak on service. clamped 2 1 1/4" c
1	10/27/2004	10/27/2004	SRERB	43			Auburn St	Brockton	MA	5726268-1				COMPLETE SERVICE RENEWAL INSTALLED
1	10/05/2004	10/07/2004	SRERB	173			Bartlett St	Brockton	MA	5702322-1				CUT IN 1.25" CURB COCK. INSERTED 1.
1	07/20/2004	07/20/2004	LRSFB	12			Bassett Rd	Brockton	MA	5633436-1				REPLACED H.P.C. IN CELLAR FOR SRVC
3	05/25/2004	01/10/2005	LRMXC				Belmont Ave	Brockton	MA	5584712-1				surveyed 1/10/05 fp/sa neg called o
1	02/06/2004	02/06/2004	SRERB	44			Belmont Ave	Brockton	MA	5493555-1				renewed 1 1/4" with 1" pp - install
2	01/08/2004	01/20/2004	JCIXB	217			Belmont Ave	Brockton	MA	5464677-1				sealed 4" joint
1	05/12/2004	05/12/2004	JXXXB	806			Belmont St	Brockton	MA	5573467-1				LEAK TESTED & PINPOINTED LEAK. FOUN
1	05/06/2004	05/06/2004	JXXXB	808			Belmont St	Brockton	MA	5568846-1				LEAK TESTED & PINPOINTED LEAK. FOUN
1	02/03/2004	02/04/2004	MRPEB				Blaine St	Brockton	MA	5490204-1				Take out 4" cast iron 4 way tee and
1	08/02/2004	08/02/2004	LRMXB	18			Boyden St	Brockton	MA	5644737-1				LEAK TESTED & PINPOINTED LEAK. INST
1	08/09/2004	08/09/2004	LRSXB	39			Boyden St	Brockton	MA	5650913-1				Replaced 1' of 1/2" p.p. Cst hit li

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
2	07/29/2004	08/10/2004	JCIXB	133	135		Boylston St	Brockton	MA	5641628-1				leak tested and pinpointed leak fo
2	01/22/2004	01/30/2004	JCIXB	149			Boylston St	Brockton	MA	5479295-1				sealed 8" joint
3	06/19/2004	08/28/2004	LRSFB	270			Boylston St	Brockton	MA	5607507-1				repaired leak on fit painted fit an
1	09/23/2004	09/23/2004	CDSXB	318			Boylston St	Brockton	MA	5690084-1				FIXED 1 1/4" PLASTIC SERVICE AND P.
1	06/29/2004	06/29/2004	CDSXB	159			Braemoor Rd	Brockton	MA	5615894-1				CUST. CUT 1/2" GAS SERVICE WITH HAN
1	07/14/2004	07/14/2004	SRERB	31			Broad St	Brockton	MA	5628826-1				RENEWED LEAKING 1 1/4" B.S. SERVICE
1	10/28/2004	10/28/2004	CDSXB	20			Brook St	Brockton	MA	5727524-1				INSTALLED 2 2" DRESSERS 5' 2" PLAST
1	10/05/2004	10/05/2004	SRERB	60			Brook St	Brockton	MA	5702651-1				Renewed service with 1" plastic.
1	10/04/2004	10/04/2004	LRSXB	68			Brook St	Brockton	MA	5700935-1				INSTALLED 1 1/4" HANDIBAND ON CORRO
1	10/12/2004	10/12/2004	LRMXB	80			Brook St	Brockton	MA	5709146-1				Repaired corrosion leak on service
2	01/14/2004	01/21/2004	JCIXB	24			Bunker Ave	Brockton	MA	5471210-1				avon sealed 4" c.i. joint
2	11/23/2004	12/06/2004	LRMXB	28			Bunker Ave	Brockton	MA	5752922-1				removed one bj clamp and installed
1	08/13/2004	08/11/2004	SRERB	103			Burkeside Ave	Brockton	MA	5654792-1				RENEW FROM C.C. TO METER FIT INSIDE
1	01/29/2004	01/28/2004	LRMXB	35			Byron Ave	Brockton	MA	5485579-1				installed 4" servi- seal on cracked
2	03/04/2004	03/25/2004	JXXXB	55			Byron Ave	Brockton	MA	5516271-1				Leak tested and pinpointed leak, fo
1	06/21/2004	06/21/2004	LRSFB	34			Cabot St	Brockton	MA	5608331-1				repaired fit leak
1	06/16/2004	06/16/2004	CDMXB	35		1	Cappys Way	Brockton	MA	5604059-1				REPAIRED BROKEN 2" P.P. GAS MAIN WI
1	05/10/2004	05/08/2004	SRERB	63			Carl Ave	Brockton	MA	5571489-1				Renew service tee to meter.
2	02/18/2004	02/24/2004	LRMXB	14			Carroll Ave	Brockton	MA	5502524-1				leak tested and pipointed leak- fou
1	05/14/2004	05/14/2004	LRMXB	35			Cary St	Brockton	MA	5576028-1				CLAMP 6" MAIN.
2	07/06/2004	07/05/2004	LRMXB	85			Cary St	Brockton	MA	5621390-1				INSTALLED 6" HANDY BAND ON B.S. MAI
2	10/18/2004	10/25/2004	LRMXB				Center St	Brockton	MA	5715299-1				found and raised 2 valves and greas
2	03/05/2004	05/12/2004	JXXXB	555			Center St	Brockton	MA	5517266-1				LEAK TESTED & PINPOINTED LEAK. FOUN
2	05/20/2004	06/05/2004	LRMXB	555			Center St	Brockton	MA	5580538-1				SEE WO#5517266 FOR DETAILS (BELL JO
2	03/01/2004	03/01/2004	JCIXB	172			Chestnut St	Brockton	MA	5512417-1				leak tested and pinpointed leak, fo
2	09/20/2004	09/22/2004	RTSRB				Clarence St	Brockton	MA	5686240-1				CUT OFF OLD 1 1/4" STUB GOING DOWN
2	11/02/2004	11/06/2004	JXXXB	12			Clarence St	Brockton	MA	5732359-1				repaired leaking bell joint took of
1	11/09/2004	11/06/2004	LRSXB	12			Clarence St	Brockton	MA	5739497-1	Low	Coated Stl	2 "	TIGHTENED NIPPLE ON SWING TEE INTO
1	10/23/2004	10/23/2004	SRERB	26			Clarence St	Brockton	MA	5722426-1				INSERTED SERVICE FROM MAIN TO INSID
1	10/22/2004	10/22/2004	CDMXB	28			Clarence St	Brockton	MA	5721072-1				RAN NEW PLASTIC SERIVE FOR TEE HPC
2	09/21/2004	10/02/2004	SRERB	50			Clarence St	Brockton	MA	5687762-1				renewed service tee house using 60'
1	09/20/2004	09/20/2004	CDSXB	52			Clarence St	Brockton	MA	5686528-1				HIT SERVICE. RENEWED TEE TO C.C. WI
2	03/08/2004	05/06/2004	SRERB	49			Cleveland Ave	Brockton	MA	5519043-1				leak tested and pinpointed leak. fo
2	09/17/2004	09/27/2004	JXXXB				Clifton Ave	Brockton	MA	5684569-1				installed two 12" boots one 8" boot
4	09/10/2004	09/08/2004	LRMXB	31			Clifton Ave	Brockton	MA	5678379-1				negative results
2	09/17/2004	09/23/2004	JCIXB	60			Clifton Ave	Brockton	MA	5684570-1				found 4 x 32 reducer leaking sealed
1	10/14/2004	09/21/2004	SRERB	60			Clifton Ave	Brockton	MA	5712290-1				RENEWED SERVICE TEE TO INSIDE & BOO
2	09/15/2004	09/20/2004	JCIXB	64			Clifton Ave	Brockton	MA	5682333-1				09/15/04 - Class 2 leak - probably
1	08/24/2004	08/24/2004	SRERB	124			Clifton Ave	Brockton	MA	5662846-1				found service leaking renewed with
1	09/21/2004	09/22/2004	CDSXB	133			Clifton Ave	Brockton	MA	5687641-1				INSTALLED 3' OF 1 1/4" P.P. AFTER S
4	07/28/2004	07/26/2004	LRMXB	33			Colonel Bell Dr	Brockton	MA	5640570-1				negative results
1	10/27/2004	10/25/2004	SRERB	5			Colonial Ter	Brockton	MA	5726501-1				RENEWED SERVICE CC TO HOUSE USING 2
2	03/04/2004	03/16/2004	RTSRB	154			Concord St	Brockton	MA	5516273-1				leak tested and pipointed leak, fou
1	10/12/2004	10/09/2004	SRERB	14			Condon St	Brockton	MA	5709312-1				RENEW C.C. TO HOUSE.
4	06/03/2004	06/02/2004	LRMXB				Copeland St	Brockton	MA	5593337-1				neg results
1	03/10/2004	03/10/2004	LRSFB	828			Court St	Brockton	MA	5520376-1				repaired leaks on meter fit, relit
2	09/07/2004	08/10/2004	LRSFB	94			Cross St	Brockton	MA	5674895-1				CHANGED 1 1/4" H.P.C. AND REPIPED.
1	01/19/2004	01/17/2004	LRSFB	16			Curve Ave	Brockton	MA	5476536-1				installed 1 1/4 h.i.c & replaced 3/
1	02/17/2004	02/17/2004	JCIXB	34			Custer St	Brockton	MA	5501341-1				leak tested and pippointed leak, fo
1	12/29/2004	12/28/2004	LRMXB	34			Davids St	Brockton	MA	5783285-1				REPAIRED CRACKED CAST IRON MAIN WIT
2	11/23/2004	12/10/2004	LRSFB	12			Della Ave	Brockton	MA	5753025-1	High	Coated Stl	3/4 "	LOCATED AND RAISED CC AND INSTALLED

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
2	06/04/2004	06/24/2004	LRSXB	524			E Ashland	Brockton	MA	5594400-1				REMOVED KAROTEST C.C. FLO LIMIT ER T
3	04/20/2004	08/04/2004	LRSFB	531			East St	Brockton	MA	5554033-1	Intermedt	Coated Stl	3/4 "	REPAIRED LEAKS BELOW H.P.C.
2	03/02/2004	03/10/2004	JCIXB				Echo St	Brockton	MA	5514069-1				leak tested and pipointed leak, fou
1	09/29/2004	09/29/2004	SRERB	86			Echo St	Brockton	MA	5696016-1				Installed 1 1/4" curb cock o.k. Ins
2	06/23/2004	07/19/2004	LRMXB	52			Edgar St	Brockton	MA	5610377-1				leak tested and pinpointed leak. fo
2	04/22/2004	05/19/2004	JXXXB	38			Ellsworth Ave	Brockton	MA	5556254-1				SEAL ONE 6" JOINT.
1	03/04/2004	03/03/2004	LRSXB	10			Ellsworth St	Brockton	MA	5515880-1	Low	Coated Stl	1 1/4 "	Replace 1 1/4 HPC and swing fit.
1	06/17/2004	06/17/2004	SRERB	29			Emmet St	Brockton	MA	5605617-1				RENEWED SERVICE C.C. TO END W/ 1" P
2	02/17/2004	02/23/2004	JCIXB	88			Emmet St	Brockton	MA	5501662-1				sealed 6" joint.
2	02/27/2004	03/22/2004	JXXXB				Fairmount Ave	Brockton	MA	5510633-1				Leak tested and pinpointed leak, fo
1	05/28/2004	05/28/2004	LRSFB	4			Fairmount Ave	Brockton	MA	5588476-1				REPAIRED LEAK ON INSIDE FIT.
2	01/12/2004	01/20/2004	LRMXB	33			Fenway Cir	Brockton	MA	5468834-1				loaking at poss loc tightened up st
1	07/23/2004	07/23/2004	CDSXB	9			Fieldstone Dr	Brockton	MA	5636879-1				REPAIRED HIT 1/2" P.P. SERVICE.
1	12/10/2004	12/10/2004	RTSRB	112			Florence St	Brockton	MA	5768865-1				cut service off of main wall leak.
2	01/07/2004	01/23/2004	JCIXB				Forest Ave	Brockton	MA	5463403-1				avon sealed 6" bell joint
2	02/10/2004	02/23/2004	JCIXB				Forest Ave	Brockton	MA	5496222-1				repaired leak using 1-6" avon seal
2	03/04/2004	04/09/2004	JXXXB				Forest Ave	Brockton	MA	5516277-1				leak tested and pinpointed leak. fo
2	02/04/2004	02/12/2004	SRERB	265			Forest Ave	Brockton	MA	5491420-1				renew 1 1/4' bs service- w/ 1" pp
2	03/04/2004	04/16/2004	JXXXB	380			Forest Ave	Brockton	MA	5516281-1				LEAK TESTED & PINPOINTED LEAK. FOUN
1	09/08/2004	09/08/2004	CDSXB				Forest Rd	Brockton	MA	5676286-1				INSTALLED 2 - 2" CLAMPS. SKETCH ON
1	08/12/2004	08/12/2004	RTSNB	128			Forest St	Brockton	MA	5653894-1				Cut in c.c. and cut service off @ c
2	07/20/2004	08/03/2004	JXXXB	82			Foster St	Brockton	MA	5633369-1				REMOVED LEAKING MECHANICAL COUPLING
2	01/22/2004	02/09/2004	SRERB	46			Frankton Ave	Brockton	MA	5479302-1				Renewed 1 1/4" steel service with
3	01/22/2004	03/21/2005	JXXXB				French Ave	Brockton	MA	5479307-1				encapsulated 2- 4" ci joints. leaki
1	02/17/2004	02/17/2004	JCIXB	71	73		French Ave	Brockton	MA	5501307-1				Avon sealed 6" bell joint street to
1	01/29/2004	01/29/2004	LRMXB	7			Garden Rd	Brockton	MA	5485582-1				installed 4" full seal CI on main i
1	10/14/2004	10/14/2004	SRERB	23			Gardner Ave	Brockton	MA	5711912-1				RENEWED CURB COCK TO END WITH 100 P
3	10/15/2004	10/16/2004	LRSFB	35			Glendale Ave	Brockton	MA	5713270-1	Intermedt	Coated Stl	1 1/2 "	REPAIRED LEAK ON OUTSIDE METER FIT.
2	01/08/2004	01/22/2004	JCIXB				Goddard Rd	Brockton	MA	5464682-1				sealed 2-4" joints also installed 4
2	02/04/2004	02/17/2004	JCIXB				Grafton St	Brockton	MA	5491422-1				sealed 2 8" bell joints and soap te
1	02/09/2004	02/08/2004	SRERB	11			Grafton St	Brockton	MA	5495074-1				inserted service with 5" pp per W>
1	09/07/2004	09/07/2004	JCIXB	25			Grafton St	Brockton	MA	5674787-1				INSTALLED AVON SEAL BOOT ON 4" C.I.
1	02/18/2004	02/17/2004	RTSRB	53			Grafton St	Brockton	MA	5502291-1				Cut off at main.
1	02/23/2004	02/17/2004	LRMXB	55			Grafton St	Brockton	MA	5506057-1				Repaired crack with servi seal 4" C
1	08/24/2004	08/24/2004	LRSFB	77			Grafton St	Brockton	MA	5662872-1				repaired inside fit leak
4	07/01/2004	06/25/2004	LRMXC	243			Grafton St	Brockton	MA	5618444-1				negative results
1	09/27/2004	09/27/2004	SRERB	302			Grafton St	Brockton	MA	5693459-1				INSTALLED 1 1/4" CURB COCK IN LAWN.
1	09/14/2004	09/13/2004	LRSFB	65			Grant Ave	Brockton	MA	5681262-1				REMADE FIT.
1	01/22/2004	01/22/2004	SRERB	274			Green St	Brockton	MA	5479148-1				found 2" service leaking to # 271,
2	02/06/2004	02/12/2004	SRERB	275	277		Green St	Brockton	MA	5493833-1				renewed svc across street installed
2	03/04/2004	03/04/2004	SRERB	282			Green St	Brockton	MA	5516027-1				leak tested and pinpointed leak, fo
1	04/27/2004	04/27/2004	LRSFB	25			Greenbriar Rd	Brockton	MA	5559980-1	Intermedt	Coated Stl	1 "	REPLACED H.P.C. & METER FIT & REG.
1	11/12/2004	11/12/2004	RTSRB	30			Greenfield	Brockton	MA	5743108-1				CUT OFF HIT TUB SERVICE WITH 1 1/4"
2	03/04/2004	03/16/2004	JXXXB	30			Hampden Ave	Brockton	MA	5516289-1				Leak tested and pinpointed leak, fo
3	07/17/2004	08/04/2004	LRSFB	35			Harold St	Brockton	MA	5631940-1	Intermedt	Coated Stl	1 1/2 "	FOUND RISER LEAKING, CUT DOWN & RE-
1	03/10/2004	03/10/2004	LRSXB	34			Harvard St	Brockton	MA	5520793-1				Repaired pp svc where kinked.
1	07/30/2004	07/30/2004	SRERB	18			Hazel St	Brockton	MA	5642982-1				CUT IN 1 1/4" C.C. AND INSERTED 1"
2	02/24/2004	02/25/2004	SRERB	79			Herrod Ave	Brockton	MA	5507100-1				installed 6" servi seal clamp onCI
2	02/23/2004	02/26/2004	JCIXB	88	90		Highland St	Brockton	MA	5506131-1				sealed 4" CI joint.
2	02/23/2004	03/01/2004	JCIXB	104			Highland St	Brockton	MA	5506213-1				sealed leaking 4" joint.
2	01/23/2004	02/11/2004	SRERB	107			Highland St	Brockton	MA	5480259-1				leak tested and pinpointed leak, fo

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
1	08/17/2004	08/13/2004	LRSFB	130			Highland St	Brockton	MA	5657111-1				replaced inside swivel fit and inst
2	03/12/2004	03/30/2004	JXXXB	186			Highland St	Brockton	MA	5522909-1				leak tested and pinpointed leak. fo
1	02/05/2004	02/05/2004	LRSXB	67			Highland Ter	Brockton	MA	5492674-1				replaced service seal clamp and fit
1	07/22/2004	07/22/2004	RTSRB	95			Hillberg Ave	Brockton	MA	5635759-1				CUT OFF SRVC - BROKEN IN STREET - P
1	12/17/2004	12/17/2004	RTSRB	101			Hillberg Ave	Brockton	MA	5775040-1				cut off 1 1/4" service at 4" ci mai
1	03/01/2004	03/01/2004	LRMXB	132			Hillberg Ave	Brockton	MA	5512595-1				leak tested and pinpointed leak, fo
1	07/15/2004	07/15/2004	SRERB	72			Hillside Ave	Brockton	MA	5630071-1				RENEWED PIPE FROM C.C. TO METER FIT
1	07/08/2004		LRSF	68			Hollis St	Brockton	MA	5623997-1				
1	07/01/2004	07/01/2004	SRERB	199			Hovendon Ave	Brockton	MA	5618202-1				RENEW SERVICE FROM CURB COCK INTO H
2	02/13/2004	02/14/2004	SRERB	20			Howard Sq	Brockton	MA	5499546-1				renewed service P.I. 4" servi seal
2	02/27/2004	03/16/2004	LRMXB	78			Huntington St	Brockton	MA	5510560-1				Drilled holes and tested, ery sligh
2	03/29/2004	06/15/2004	JCIXB	78			Huntington St	Brockton	MA	5536219-1				leak tested and pinpointed leak. fo
1	08/11/2004	08/11/2004	LRMXB	51			Irving St	Brockton	MA	5652651-1				Installed 1 1/4" handiband clamp.
3	07/28/2004	10/01/2004	LRSFB	40		0	Ithaca Rd	Brockton	MA	5640828-1				greased hp cock soap test meter fit
1	12/16/2004	12/16/2004	SRERB	25			James St	Brockton	MA	5773925-1				cut in curb cock and insert with 1"
1	01/05/2004	01/04/2004	SRERB	31			Johnson St	Brockton	MA	5460953-1				renewed from c.c. to house, susing
4	01/12/2004	01/01/2004	SRERB	8			Juneau Rd	Brockton	MA	5468220-1				Renewed service from cc to house wi
2	09/22/2004	09/25/2004	LRMXB	40			Juneau Rd	Brockton	MA	5689181-1	High	Coated Stl	2 "	REPAIR LEAKING VALVE.
1	06/16/2004	06/16/2004	SRERB	24			Keith Ave	Brockton	MA	5604341-1				INSTALLED 1 1/4" C.C. AND RENEWED S
1	06/23/2004	06/23/2004	LRSFB	30			Keswick Rd	Brockton	MA	5610497-1				Repair fit leak.
1	07/09/2004	07/09/2004	SRERB	29			Leavitt St	Brockton	MA	5625094-1				Installed 1 1/4" c.c. & insert to i
1	08/03/2004	08/02/2004	SRERB	46			Leavitt St	Brockton	MA	5645701-1				RENEW GAS SERVICE C.C. TO HOUSE.
1	02/02/2004	02/02/2004	JCIXB	22			Legion Pky	Brockton	MA	5489358-1				dug out leaking 12" bell joint, 4 c
2	03/05/2004	03/12/2004	LRMXB	22			Legion Pky	Brockton	MA	5517256-1				12" split servi sealed by Old Keyst
2	02/24/2004	03/15/2004	JXXXB				Lenox St	Brockton	MA	5506895-1				Leak tested and pipointed leak, fou
1	06/30/2004	06/30/2004	LRSXB	28			Leyden St	Brockton	MA	5616722-1				CUT IN 1 1/4" COMPRESSION CURB COCK
2	10/28/2004	11/16/2004	LRMXB	130			Liberty St	Brockton	MA	5727638-1				2 existing 6" clamps were leaking.
2	02/03/2004	02/15/2004	LRMXB	30			Linwood St	Brockton	MA	5490427-1				repaired 2 leaks using 2-2" handy b
4	11/10/2004	11/30/2004	LSMXB				Main Leak Survey	Brockton	MA	5740871-1				
4	11/10/2004		LSMX				Main Leak Survey	Brockton	MA	5740871-3				
4	11/10/2004		LSMX				Main Leak Survey	Brockton	MA	5740871-5				
2	09/29/2004	09/30/2004	JCIXB				Main St	Brockton	MA	5695858-1				INSTALLED ONE 12" AVON BOOT.
1	09/17/2004	09/17/2004	LRSFB	157			Main St	Brockton	MA	5684445-1				REPLACED RISER.
1	08/05/2004	08/05/2004	JCIXB	335			Main St	Brockton	MA	5648298-1				LEAK TESTED & PINPOINTED LEAK. FOUN
1	10/08/2004	10/08/2004	LRSXB	1085			Main St	Brockton	MA	5707013-1				SHORTEN LEAKING STUB INSTALLED CC O
2	10/13/2004	11/01/2004	JCIXB	1108			Main St	Brockton	MA	5710651-1				leak tested and pinpointed leak. fo
1	09/13/2004	09/13/2004	LRMXB				Manomet St	Brockton	MA	5679905-1				LEAK TESTED & PINPOINTED LEAK. FOUN
2	09/27/2004	09/30/2004	LRMXB				Manomet St	Brockton	MA	5693604-1				installed 5 2" handy band clamps on
2	02/05/2004	03/03/2004	LRMXB	151			Manomet St	Brockton	MA	5492612-1				installed 6" handi band clamp.
2	01/07/2004	01/23/2004	LRMXB	153			Manomet St	Brockton	MA	5463378-1				leak tested and pinpointed leak, fo
1	05/25/2004	05/25/2004	CDMXB	43			Massasoit Ave	Brockton	MA	5584591-1				CUT OUT SMALL HOLE & PUT DRESSER CO
1	07/21/2004	07/20/2004	SRERB	29			May Ave	Brockton	MA	5634776-1				RENEW FROM P.L. TO CELLAR, PER SUPE
1	07/19/2004	07/19/2004	LRSFB	15			Mellen St	Brockton	MA	5632595-1				REPLACED LEAKING SHUT OFF INSIDE.
2	08/23/2004	09/23/2004	JCIXB				Montello St	Brockton	MA	5662124-1				avon sealed 12" joint
1	10/28/2004	10/28/2004	LRSFB	148			Montello St	Brockton	MA	5727721-1				SHUT GAS OFF REPAIRED LEAK BELOW HP
1	12/18/2004	12/16/2004	JCIXB	583			Montello St	Brockton	MA	5775992-1				Put 12" boot on 12" joint, it was l
1	12/22/2004	12/16/2004	JXXXB	585			Montello St	Brockton	MA	5779234-1				12" boot on 12" main.
2	03/02/2004	04/07/2004	JXXXB	847			Montello St	Brockton	MA	5514091-1				removed leaking clamp sealed 12" jo
2	03/02/2004	04/07/2004	SRERB	908			Montello St	Brockton	MA	5514089-1				leak tested & pinpointed leak. foun
1	03/29/2004	03/29/2004	LRSFB	11			Moraine St	Brockton	MA	5535988-1				Repair fit leak.
2	10/28/2004	11/09/2004	JCIXB	58			Moraine St	Brockton	MA	5727634-1				encapsulated 4" joint leaking.

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
2	03/04/2004	04/15/2004	SRERB	12			Morrison Rd	Brockton	MA	5516291-1	Intermedt	Coated Stl	2 "	cut off service and welded.inserted
1	07/12/2004	07/12/2004	SRERB	27			Moulton St	Brockton	MA	5626629-1				RENEWED SERVICE TEE TO INSIDE WITH
2	03/04/2004	03/30/2004	JXXXB				Myrtle St	Brockton	MA	5516293-1				leak tested and pinpointed leak. fo
1	07/28/2004	07/28/2004	SRERB	97			Myrtle St	Brockton	MA	5640808-1				RENEWED SVC FROM MAIN TO INSIDE HOU
1	02/18/2004	02/18/2004	LRSFB	119			Myrtle St	Brockton	MA	5502377-1				fixed small crack on inside fit.
2	03/04/2004	04/16/2004	JXXXB	144			Myrtle St	Brockton	MA	5516295-1				sealed 6" joint
1	02/10/2004	02/10/2004	SRERB	4			N Arlington St	Brockton	MA	5496806-1				found service leaking, renewed comp
1	02/19/2004	02/19/2004	LRSXB	4			N Arlington St	Brockton	MA	5503626-1				purged from previous class one leak
2	01/23/2004	01/29/2004	JCIXB	11			N Arlington St	Brockton	MA	5480267-1				Installed 4" PLCS kit on leaking be
2	03/12/2004	04/06/2004	SRERB	12			N Arlington St	Brockton	MA	5522905-1				inserted service back inside with 1
1	04/22/2004	04/22/2004	RTSRB	10			N Belcher Ave	Brockton	MA	5555934-1				CUT OFF NON USER AT 4" C.I. LONG SI
1	05/07/2004	05/07/2004	SRERB	998			N Main St	Brockton	MA	5569972-1				LEAK TESTED & PINPOINTED LEAK. FOUN
1	07/19/2004	07/19/2004	SRERB	593			N Montello St	Brockton	MA	5632818-1				RENEW FROM P.L. TO RISER. PUT RISER
1	02/02/2004	02/04/2004	LRMXB				N Bassett Rd	Brockton	MA	5489363-1				found 19% at foundation and 45% 15
1	02/20/2004	02/02/2004	LRMXB				N Bassett Rd	Brockton	MA	5504513-1				Leak tested and pinpointed leak, fo
1	11/26/2004	11/10/2004	LRMXB				N Cary St	Brockton	MA	5755224-1	High	Coated Stl	2 "	REPAIRED 2 INCH C.S. VALVE LEAKING,
2	01/07/2004	01/31/2004	JCIXB				N Main St	Brockton	MA	5463431-1				avon sealed 12" bell joint
2	02/27/2004	04/12/2004	JCIXB				N Main St	Brockton	MA	5510591-1				removed leaking old split sleeve fr
2	02/03/2004	02/11/2004	JCIXB	324	330		N Main St	Brockton	MA	5490403-1				Avon sealed 1-4" joint
2	03/02/2004	04/08/2004	JXXXB	798	810		N Montello St	Brockton	MA	5514076-1				CLAMPED LEAKING 8" C.I. JOINT.
2	02/03/2004	02/10/2004	JCIXB				Nason St	Brockton	MA	5490437-1				found bell joint leaking, sealed jo
2	08/17/2004	09/15/2004	LRMXB				Oak Hill Way	Brockton	MA	5657024-1				Greased valve o.k. No readings or s
3	10/30/2004		LRSF	135			Oak Hill Way	Brockton	MA	5730268-1				
2	02/09/2004	02/19/2004	LRSFB	100			Oak St	Brockton	MA	5495335-1				greased 1 1/4 H.P.C. to fix leak.
1	05/14/2004	05/14/2004	RTSNB	770			Oak St	Brockton	MA	5575877-1				SHUT OFF VALVE AND CUT SRVC BACK FO
2	02/11/2004	02/17/2004	LRSFB				Oakdale St	Brockton	MA	5497381-1				replaced leaking valve inside
1	08/27/2004	08/28/2004	SRERB	22			Oakdale St	Brockton	MA	5666888-1				renewed leaking 1 1/4 bare steel p
2	01/12/2004	01/26/2004	JCIXB				Oakland Ave	Brockton	MA	5468815-1				SEALED 2-4" JOINTS C. MATHEWS WORKI
2	01/12/2004	01/26/2004	JCIXB				Oakland Ave	Brockton	MA	5468828-1				leak tested and pinpointed leak, fo
1	02/09/2004	02/07/2004	RTMXB	16			Oakland Pl	Brockton	MA	5495071-1				cut off 18" of 2" WI Main with 3/
1	02/26/2004	02/26/2004	LRSFB	887			Old Ash St	Brockton	MA	5509583-1				Neg. leak -svc. man repaired heater
1	06/11/2004	06/11/2004	SRERB	33	35		Oneida Ave	Brockton	MA	5600472-1				RENEWED SRVC FROM TEE TO INSIDE WIT
1	05/27/2004	05/26/2004	RTSRB	12			Packard St	Brockton	MA	5587303-1				cut off 1 1/4" service at main & in
1	01/27/2004	01/27/2004	SRERB	78			Packard Way	Brockton	MA	5483331-1				RENEWED SERVICE USING 34' 1' P.P.
1	10/07/2004	10/07/2004	SRERB	133			Packard Way	Brockton	MA	5705872-1				CUT IN 1.25 CURB COCK. INSERTED 1.0
1	02/26/2004	02/26/2004	LRMXB	19			Palmer St	Brockton	MA	5509863-1				found 4" C.I. cracked, installed 4"
2	03/11/2004	03/15/2004	LRMXB	529			Pearl St	Brockton	MA	5521920-1	Intermedt	Coated Stl	6 "	Greased valve.
1	06/15/2004	06/15/2004	CDSXB	1014			Pearl St	Brockton	MA	5602937-1				REPAIRED HIT SERVICE.
2	02/27/2004	03/30/2004	JXXXB				Perkins Ave	Brockton	MA	5510645-1				Sealed 4" joint.
2	09/22/2004	11/01/2004	LRMXB				Perkins Ave	Brockton	MA	5689180-1				found cracked main and avon boot le
1	01/20/2004	01/21/2004	JCIXB	31			Perkins Ave	Brockton	MA	5477133-1				leak tested and pinpointed leak, fo
2	12/23/2004	01/04/2005	RTSRB	67			Perkins Ave	Brockton	MA	5780060-1				found old stub leaking cut off at m
1	12/06/2004	12/05/2004	SRERB	17			Pine St	Brockton	MA	5764345-1	High	Coated Stl	8 "	RE-NEWED MAIN TO ORIGINAL C.C. REPL
2	06/15/2004	07/06/2004	LRMXB	671			Plain	Brockton	MA	5603120-1				clamped 6" main using 1 6" handy ba
2	07/20/2004	07/26/2004	LRMXB	671			Plain	Brockton	MA	5633373-1				leak tested and pinpointed leak. fo
1	07/28/2004	07/28/2004	LRMXB	671			Plain	Brockton	MA	5640733-1				installed 6" clamp
2	01/08/2004	02/24/2004	LRMXB	671			Plain St	Brockton	MA	5464612-1				installed 2 6x9 handi band clamps.
2	08/13/2004	01/31/2005	LRMXB	671			Plain St	Brockton	MA	5654639-1				cancel - main abandoned
1	11/30/2004	11/30/2004	RTSNB	708			Plain St	Brockton	MA	5757756-1				found tee leaking. cut off at main.
1	11/13/2004	11/09/2004	CDMXB				Pleasant St	Brockton	MA	5744191-1				INSTALLED 2" HANDY BAND ON 2" WI
2	11/08/2004	01/07/2005	SRERB	331			Pleasant St	Brockton	MA	5738584-1				renewed svc with 1 1/4" pp insert b

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
2	12/14/2004	12/22/2004	SRERB	385			Pleasant St	Brockton	MA	5771599-1				renewed service from tee to co whe
1	12/09/2004	12/09/2004	SRERB	461	463		Pleasant St	Brockton	MA	5768030-1				wall leak. cut in curb cock at prop
1	11/16/2004	11/16/2004	RTSRB	530		0	Pleasant ST	Brockton	MA	5746109-1				Cut off stub srvc at main with 1" p
1	11/13/2004	11/12/2004	CDSXB	555			Pleasant St	Brockton	MA	5744177-1				CUT OFF STUB SERVICE AT MAIN & INST
1	11/13/2004	12/26/2004	RTSNB	587			Pleasant St	Brockton	MA	5744173-1				Repaired broken, inactivated servic
2	02/24/2004	03/15/2004	SRERB	9			Prospect Ave	Brockton	MA	5506890-1				Renewed 2" B.S. service, also seale
1	12/17/2004	12/17/2004	LRMXB	21			Provost St	Brockton	MA	5775050-1				install new permaset curb cock
1	05/03/2004	05/03/2004	LRSFB	10			Raymond Rd	Brockton	MA	5565405-1				rebuilt meter fit located and raise
1	02/19/2004	02/19/2004	CDSXB	253			Richmond St	Brockton	MA	5503350-1				repaired 1/2" pp broken service rep
1	08/28/2004	08/24/2004	SRERB	30			River St	Brockton	MA	5667847-1				Renew service main to house 14 ft 1
4	02/02/2004	03/01/2004	LSSXB				Service Leak Survey	Brockton	MA	5489068-1				
1	07/13/2004	07/13/2004	LRSFB	150			Short St	Brockton	MA	5627603-1				REPLACED METER FIT.
1	12/15/2004	12/15/2004	CDMXB	10			Silver Rd	Brockton	MA	5772636-1				Broken main. Installed one 4' x 12'
1	12/02/2004	12/02/2004	CDSXB	37			Silver Rd	Brockton	MA	5760320-1				cut off old 1 1/4" service using 1
2	03/05/2004	03/26/2004	JXXXB	15			Skinner St	Brockton	MA	5517258-1				Leak tested and pipointed leak, fou
1	11/04/2004	11/04/2004	CDSXB	346			Spring St	Brockton	MA	5735253-1				FOUND 2" STUB SRVC BROKEN AT MAIN.
2	12/08/2004	12/08/2004	LRMXB	93			Summer St	Brockton	MA	5766502-1				leak tested & pinpointed leak. foun
2	12/07/2004	12/14/2004	LRMXB	112			Summer St	Brockton	MA	5765632-1				leak tested and pinpointed leak. fo
1	12/03/2004	12/03/2004	LRMXB	123			Summer St	Brockton	MA	5762344-1				installed one 6" handy band
2	02/24/2004	04/12/2004	JXXXB				Sycamore Ave	Brockton	MA	5506898-1				leak tested and pinpointed leak fou
2	03/08/2004	03/30/2004	JXXXB	18			Sycamore St	Brockton	MA	5519052-1				Sealed 3-4" joints.
3	01/13/2004	03/05/2004	LRSFB	215			Thatcher St	Brockton	MA	5469925-1				repaired lock on riser
2	06/18/2004	07/02/2004	JCIXB	59			Thorney Lea Ter	Brockton	MA	5606720-1				leak tested and pinpointed leak. fo
4	06/03/2004	06/01/2004	LRMXB	68			Thorny Lea Ter	Brockton	MA	5593333-1				neg results
2	05/15/2004	05/12/2004	SRERB	15			Torrey St	Brockton	MA	5576876-1				RENEWED FROM CURB IN, MUST RENEW AT
2	03/10/2004	05/05/2004	MRPEB	586			Torrey St	Brockton	MA	5520613-1				Installed 21-6" p.c.'s, made 6" pla
2	05/10/2004	05/13/2004	JXXXB				Track St	Brockton	MA	5571458-1				LEAK TESTED & PINPOINTED LEAK. FOUN
1	09/28/2004	09/28/2004	LRSFB	224			Tribou St	Brockton	MA	5694678-1				installed new hpc and refit pipe an
2	02/03/2004	02/10/2004	JCIXB	47			Tripp Ave	Brockton	MA	5490433-1				leak tested and pipointed leak, fou
1	07/16/2004	07/16/2004	SRERB	57			Verne St	Brockton	MA	5630987-1				INSERTED 1 1/4" B.S. WITH 1" P.P. F
1	06/24/2004	06/24/2004	LRSFB	12	14		Vesey St	Brockton	MA	5611878-1				REPAIR LEAK AT H.P.C.
1	06/25/2004	06/25/2004	SRERB	12	14		Vesey St	Brockton	MA	5612964-1				RENEW FROM C.C. TO CELLAR WITH 15'
2	08/11/2004	08/23/2004	JXXXB	166			W Chestnut St	Brockton	MA	5652681-1				leak tested and pinpointed leak. re
1	10/13/2004	10/12/2004	CDSXB	970			W Chestnut St	Brockton	MA	5710622-1				REPAIR BROKEN 1 1/4" PLASTIC SERVIC
2	02/10/2004	02/11/2004	LRMXB	530			W Elm St	Brockton	MA	5496199-1				fouund cracked main on 4" CI, repai
1	02/02/2004	02/02/2004	LRMXB	564			W Elm St	Brockton	MA	5488934-1				leak tested and pinpointed leak, fo
1	05/14/2004	05/14/2004	LRMXB				W Chestnut St	Brockton	MA	5576146-1				LEAK ON 6" MAIN, USED 1 - 6" X 6" B
2	08/13/2004	08/18/2004	JXXXB	150			W Chestnut St	Brockton	MA	5654798-1				leak tested and pinpointed leak. fo
2	02/05/2004	02/09/2004	LRSFB	234			W Elm St	Brockton	MA	5492496-1				repaired leak on riser.
2	02/06/2004	02/19/2004	RTSRB	468			W Elm St	Brockton	MA	5493835-1				sealed 1-6" joint and also cut off
1	08/18/2004	02/19/2004	JCIXB	468			W Elm St	Brockton	MA	5658225-1				see wo 5493835 for details 1-6" be
2	05/12/2004	05/18/2004	SRERB	359			Warren Ave	Brockton	MA	5573537-1				INSERTED OLD 1 1/4" SRVC WITH 1" P.
2	05/12/2004	05/17/2004	JCIXB	411			Warren Ave	Brockton	MA	5573542-1				FOUND SEALED BELL JOINT LEAKING. RE
2	05/10/2004	05/17/2004	SRERB	438			Warren Ave	Brockton	MA	5571456-1				RENEWED SRVC TO 436-438 WITH 1" P.P
2	05/12/2004	05/19/2004	SRERB	486			Warren Ave	Brockton	MA	5573546-1				RENEWED SERVICE TEE TO C.C.
1	10/18/2004	10/17/2004	RTSRB	551			Warren Ave	Brockton	MA	5715293-1				FOUND 1 1/2 PIPE LEAKING CUT OFF &
2	09/14/2004	10/23/2004	JXXXB				West St	Brockton	MA	5681249-1				removed existing (leaking) encapula
2	05/10/2004	05/27/2004	JCIXB	24			Weston St	Brockton	MA	5571703-1				LEAK TESTED & PINPOINTED LEAK. FOUN
2	01/12/2004	01/19/2004	JCIXB	15			Wheeler Ave	Brockton	MA	5468889-1				leak tested and pinpointed leak, fo
2	01/12/2004	02/05/2004	JXXXB	95			Wheeler Ave	Brockton	MA	5468896-1				leak tested and pipointed leak, fou
2	02/23/2004	02/25/2004	SRERB	38			Wilmington St	Brockton	MA	5506318-1		Intermedt Coated Stl	8 "	Renewed and relocated old leaking s

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
2	06/30/2004	07/22/2004	LRMXB	346			Winter St	Brockton	MA	5617028-1				leak tested and pinpointed leak fo
2	11/22/2004	12/04/2004	SRERB	200	206		Woodard Ave	Brockton	MA	5751824-1	Intermedt	Coated Stl	2 "	renew leaking service from main to
2	12/16/2004	01/03/2005	SRERB	220			Woodard Ave	Brockton	MA	5773830-1	Intermedt	Coated Stl	2 "	renewed service with 1/2" pp elimin
2	03/08/2004	04/10/2004	SRERB	99			Woodland Ave	Brockton	MA	5519054-1				installed 4" servi seal at main. re
1	07/28/2004	07/28/2004	LRSFB	4			Woodside Ave	Brockton	MA	5640571-1				RAISED CURB BOX FOR REPAIR OF INSID
1	12/28/2004	12/28/2004	LRSXB	5	6		Brayton Cir	Canton	MA	5782521-1				LEAK ON NUTS OF COMP CURB COCK TIGH
1	12/22/2004	12/24/2004	LRSXB	9			Brayton Cir	Canton	MA	5779312-1				REPAIRED LEAK AT COMPRESSION CC
2	01/29/2004	02/17/2004	LRMXB	30			Brooksweld Rd	Canton	MA	5485848-1				installed 2"x6" band clamp
2	07/06/2004	07/24/2004	LRMXB	36			Brooksweld Rd	Canton	MA	5621699-1				INSTALLED 9 2" CLAMPS ON BS MAIN
2	07/29/2004	07/30/2004	LRMXB	36			Brooksweld Rd	Canton	MA	5641629-1	Intermedt	Coated Stl	2 "	4 2 x 6 clamps and 9 others existin
1	09/23/2004	09/20/2004	LRSFB	119			Capper Dr	Canton	MA	5690001-1	Intermedt	Coated Stl	1 "	LEAK AT RISER ON TEE FIXED & RELIT
3	09/14/2004	10/25/2004	LRSFB	64			Cedarcrest Rd	Canton	MA	5681257-1				new pipe work and new meter fit ins
1	02/06/2004	02/06/2004	LRSXB	138			Chapman St	Canton	MA	5493660-1				removed kero test, curb cock instal
1	03/24/2004	03/24/2004	LRSFB	12			Charles Dr	Canton	MA	5532035-1	Intermedt	Coated Stl	1 "	Replaced inside swing fit.
3	03/12/2004	03/25/2004	LRSFB	11			Country Ln	Canton	MA	5522557-1				Located, blew out, raised curb box
1	03/01/2004	03/01/2004	LRSFB	7			Cynthia Rd	Canton	MA	5512756-1				Repaired fit leak located and raise
2	01/29/2004	04/20/2005	LRMXB	21			Cynthia Rd	Canton	MA	5485847-1	High	Coated Stl	2 "	installed 2 inch handiband clamp on
2	12/09/2004	12/18/2004	SRERB	1			Dewitt Ave	Canton	MA	5767963-1				renewed service to #1 dweitt ave. f
1	03/29/2004	03/29/2004	LRSFB	39			Elm St	Canton	MA	5536082-1				Located, dug and raised c.c. box an
1	03/17/2004	03/17/2004	LRSFB	14			Fencourt Rd	Canton	MA	5526359-1	Intermedt	Coated Stl	1 "	located and raised c.c. box, change
1	03/29/2004	03/27/2004	LRSFB	10			Greenbriar Rd	Canton	MA	5535721-1				Redo fit (inside fit).
2	09/03/2004	09/14/2004	LRMXB	14			Greenbriar Rd	Canton	MA	5673163-1	Intermedt	Coated Stl	2 "	INSTALLED 2" X 6" HANDIBAND CLAMP O
1	03/30/2004	03/30/2004	LRSFB	8			Historical Way	Canton	MA	5537128-1				Located raised curb cock box, repai
2	08/17/2004	08/20/2004	LRMXB	15			Kempley St	Canton	MA	5657020-1				removed and replaced 1 1/4 band cla
2	10/18/2004	10/20/2004	LRSFB	8			Kings Rd	Canton	MA	5715292-1				replaced leaking fit
1	04/06/2004	04/06/2004	LRSFB	29			Kings Rd	Canton	MA	5543455-1				repaired inside fit leak
2	04/07/2004	04/07/2004	LRSFB	34			Kings Rd	Canton	MA	5544487-1				replace hpc and meter fit and vent
1	03/25/2004	03/24/2004	LRSFB	4			Kirby Dr	Canton	MA	5532839-1				Repaired inside fit leak.
2	07/22/2004	07/26/2004	LRMXB	6			Lawrence St	Canton	MA	5635864-1				FOUND WELDED PIN FROM OLD CUT OFF L
1	12/22/2004	12/19/2004	LRMXB	90			Lawrence St	Canton	MA	5779239-1				INSTALLED 2" HANDY BAND ON BS MAIN
2	04/21/2004	07/06/2004	LRSXB	195			Lawrence St	Canton	MA	5554953-1				found tee to #195 leaking. pinned o
1	04/21/2004	04/18/2004	LRSXB	211			Lawrence St	Canton	MA	5554858-1				REPLACED LEAKING CC 18" 1/2" PP ONE
1	02/27/2004	02/27/2004	LRSFB	7			Lexington St	Canton	MA	5510845-1				blew out C.B. and replaced inside s
1	04/09/2004	04/09/2004	LRSFB	2			Marilyn Dr	Canton	MA	5546801-1				repaired leaking fits
1	03/19/2004	03/19/2004	LRSFB	114			Mechanic St	Canton	MA	5528439-1				Located raised, blew out c. cock, c
2	04/13/2004	04/13/2004	LRSFB	205			Mechanic St	Canton	MA	5549070-1				REPAIRED LEAKING FIT
2	11/22/2004	11/27/2004	LRMXB				Neponset St	Canton	MA	5751831-1				greased valve
2	08/18/2004	08/24/2004	SRERB	137			Norfolk St	Canton	MA	5658140-1				renewed serv from tee to prop line
1	02/11/2004	02/11/2004	LRSFB	27			Old Coach Rd	Canton	MA	5497413-1				changed fit, repaired leaks, locate
1	05/06/2004	05/06/2004	CDSXB	15			Old Meadow Ln	Canton	MA	5568857-1				REPAIR 1/2" PP BORKEN SERVICE
1	03/26/2004	03/26/2004	LRSFB	1			Patriots Dr	Canton	MA	5534369-1				Located raised box and blew out, ch
1	04/06/2004	04/05/2004	LRSFB	35			Patriots Dr	Canton	MA	5543347-1				repaired inside fit leak
1	04/01/2004	03/31/2004	LRSFB	7			Paul St	Canton	MA	5539067-1				
1	03/19/2004	03/18/2004	LRSFB	15			Paul St	Canton	MA	5528231-1				Found and repaired c.c. box, repai
1	03/24/2004	03/24/2004	LRSFB	18			Paul St	Canton	MA	5531856-1	Intermedt	Coated Stl	1 "	Replaced inside swing fit.
4	08/30/2004	08/25/2004	LRMXB	750			Pleasant St	Canton	MA	5668286-1				negative results
1	04/06/2004	04/05/2004	LRSFB	1177			Pleasant St	Canton	MA	5543434-1				replaced inside swing fit
1	03/18/2004	03/18/2004	LRSFB	1209			Pleasant St	Canton	MA	5527687-1				Located and raised curb box on repa
2	01/29/2004	02/05/2004	LRMXB	33			Ponkapoag Way	Canton	MA	5485852-1				installed 2-2"x6" band clamp
1	07/26/2004	07/26/2004	CDSXB	935			Randolph St	Canton	MA	5638514-1				CONTRACTOR DIGGING FOR WATER CAME A
2	12/20/2004	12/21/2004	LRSXB	12			Royal Ave	Canton	MA	5776586-1				kerotest curb cock leak and take ou

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
1	03/26/2004	03/26/2004	LRSFB	6			Shepard Way	Canton	MA	5534132-1				Located raised c. box changed fit,
1	02/13/2004	02/13/2004	LRSFB	3			Shore Dr	Canton	MA	5499345-1				found repaired cc box, replaced ins
3	04/06/2004		LRSF	128			Spring Ln	Canton	MA	5543559-1				
1	06/07/2004	06/07/2004	SRERB	35			Sutcliffe Ave	Canton	MA	5596081-1				RENEWED SERVICE FROM TEE TO HOUSE
2	04/16/2004	05/19/2004	LRMXB	120			Tolman St	Canton	MA	5552208-1				REPLACED 8' OF 2' PLASTIC MAIN
1	04/10/2004	04/10/2004	LRSFB	12			Traverse St	Canton	MA	5547490-1				repaired fit leak
1	03/24/2004	03/23/2004	LRSFB	197			Turnpike St	Canton	MA	5531786-1				Replaced inside swing fit andinstal
1	03/25/2004	03/24/2004	LRSFB	214			Turnpike St	Canton	MA	5532840-1				Repaired inside fit leak.
1	12/18/2004	12/18/2004	LRSXB	105			Walnut St	Canton	MA	5775954-1				replaced 1" kero test cc with 1" st
2	08/30/2004	11/09/2004	LRMXB				Washington	Canton	MA	5668294-1				clamp blowing needed to replace sav
2	01/29/2004	02/17/2004	LRMXB				Washington St	Canton	MA	5485854-1				replaced 2- 3"x6" handy band clamps
2	03/24/2004	04/24/2004	LRMXB				Washington St	Canton	MA	5532296-1				install 2 3 x 6 clamp restoration c
2	03/24/2004	01/04/2005	LRMXB				Washington St	Canton	MA	5532302-1	Intermedt	Coated Stl	1 "	found 1" purge nipple leaking. remo
1	04/24/2004	04/24/2004	CDSXB				Washington St	Canton	MA	5557907-1				REPAIRED BROKEN 1 1/4" PP SERVICE W
2	03/09/2004	03/09/2004	LRSFB	158			Washington St	Canton	MA	5519486-1				locate and raise c.c. box, shut off
4	07/02/2004	06/30/2004	LRMXB	510			Washington St	Canton	MA	5619656-1				neg results
1	01/30/2004	01/30/2004	LRMXB	538		0	Washington St	Canton	MA	5486991-1				found 1" 1/4" c lamp double rubber
1	05/07/2004	05/07/2004	CDSXB	610			Washington St	Canton	MA	5569911-1				CHECKED 4" BS PIPE EXPOSED BY CONTR
2	06/14/2004	06/08/2004	LRSFB	622			Washington St	Canton	MA	5602235-1				LEAK ON METER FIT FIXED
2	05/18/2004	05/15/2004	LRMXB	626			Washington St	Canton	MA	5578563-1				INSTALLED 2 HB CLAMPS INSTALLED 2 F
2	06/08/2004	06/06/2004	LRMXB	632			Washington St	Canton	MA	5597154-1				PUT FULL SEAL CLAMP ON 4" MAIN 1 LE
2	01/23/2004	01/23/2004	LRMXB	634			Washington St	Canton	MA	5480010-1				replaced bolts on 4" dressed to sto
2	04/20/2004	05/01/2004	LRMXB	700			Washington St	Canton	MA	5553975-1				install 2 4" clamps
2	11/23/2004	02/03/2005	RTSRB	833			Washington St	Canton	MA	5752926-1				cut off 1" bs stub
1	02/02/2004	02/02/2004	LRSXB	960			Washington St	Canton	MA	5488871-1	Intermedt	Coated Stl	4 "	contractor hit nipple on meter fit.
2	02/23/2004	03/26/2004	LRSXB	2222			Washington St	Canton	MA	5506202-1				Repaired leak at curb cock on servi
1	05/04/2004	05/03/2004	SRERB	2346			Washington St	Canton	MA	5566337-1				reneweed svc cc into house. flowlim
1	01/15/2004	01/14/2004	LRSXB	2500			Washington St	Canton	MA	5472400-1				Installed 1 1/2 handy band on servi
1	10/20/2004	10/20/2004	CDSXB	130			Westchester Dr	Canton	MA	5718542-1				REPAIRED 1/2" PP WITH PERMASET COUP
3	04/06/2004	01/20/2005	LRSFB	33			Wheeler Cir	Canton	MA	5543560-1				REPAIRED FIT LEAK LOCATED CURB COCK
1	07/09/2004	07/08/2004	LRSXB	55	59		Will Dr	Canton	MA	5625181-1				INSTALLED CLAMP ON RISER BELOW SHUT
1	03/18/2004	03/18/2004	LRSFB	10			Woodlock Rd	Canton	MA	5527256-1				Located curb cock, changed fit, lef
1	03/23/2004	03/23/2004	LRSFB	12			Woodlock Rd	Canton	MA	5530829-1				Changed inside fit, located blew ou
1	11/13/2004	11/11/2004	CDSXB	5			York Brook Rd	Canton	MA	5744176-1				REPLACE 4' OF .50 PLASTIC PIPE
2	08/09/2004	08/14/2004	SRERB	395			York St	Canton	MA	5650695-1				put tee on side of main
1	03/02/2004	03/02/2004	LRSFB	429			York St	Canton	MA	5514078-1				changed fit inside, located, raised
1	04/22/2004	04/22/2004	LRMXB	71			Forest St	Dighton	MA	5555951-1				Leak tested & pinpointed leak. foun
1	11/10/2004	11/10/2004	LRSFB	316			Main St	Dighton	MA	5741049-1	Intermedt	Coated Stl	1 "	dug cur box to shut off curb cock t
1	10/26/2004	10/26/2004	LRSFB	88			Abrams Hill Rd	Duxbury	MA	5725097-1				TOOK APART STREET ELBOW & NIPPLE RE
2	02/27/2004	03/03/2004	LRMXB	137			Abrams Hill Rd	Duxbury	MA	5510545-1				installed 1- 1 1/2"x6" handi band c
2	02/19/2004	03/03/2004	LRMXB	53			Arrowhead Rd	Duxbury	MA	5503497-1				installed and clamped 1 2"x6" hb an
1	08/26/2004	08/26/2004	LRSFB	7			Bay Ave	Duxbury	MA	5665821-1				REPAIRED LEAKING ELBOW ON THREADS R
1	11/23/2004	11/18/2004	CDSXB	25			Bay Rd	Duxbury	MA	5753009-1				REPAIRED BROKEN SERVICE 4' 1 1/4" P
2	02/19/2004	05/25/2004	LRMXB	154			Bay Rd	Duxbury	MA	5503498-1				installed 4 1 1/2" x 6" clamps 5/25
1	02/19/2004	02/19/2004	LRMXB	405			Bay Rd	Duxbury	MA	5503480-1				Install 2x6 clamp (couldn't stop le
2	02/19/2004	05/05/2004	LRMXB	52			Bayview Rd	Duxbury	MA	5503491-1				install clamp
2	08/24/2004	10/06/2004	LRMXB	146			Crescent St	Duxbury	MA	5662610-1				dug up street under minded by hand
2	07/20/2004	08/18/2004	LRMXB	35			Depot St	Duxbury	MA	5633376-1	Intermedt	Coated Stl	2 "	REPAIRED ANODE - REPAIRED LEAKING C
1	04/08/2004	04/08/2004	SRERB	32			Linden Ln	Duxbury	MA	5545842-1				inserted .50 pp from ;main to insid
2	07/12/2004	12/21/2004	LRMXB	5			Lovers Ln	Duxbury	MA	5626720-1				installed 1 handiband clamp on bare
1	06/11/2004	06/11/2004	RTSNB	64			Saint George St	Duxbury	MA	5600596-1				TEMP CUT OFF LEAKING 1.25 PP SERVIC

Continued on next page...

Program: wwrpt053.p
Date: 07/01/2005
Req By: Deborah Souza

Bay State Gas Company
Work Order Management System
D.O.T. Leak Repairs Report

Lk Cl	Reported Date	Completed Date	Work Code	At	To	Lot	Street	Town	State	Work Order	Pressure	Exposed Pipe Type	Size	Comments
2	02/27/2004	04/13/2004	LRMXB	12			Samoset Rd	Duxbury	MA	5510737-1				installed 1 11/2" x 6" handi band c
1	01/28/2004	01/28/2004	LRSFB	59			Standish St	Duxbury	MA	5485068-1				locate and repair c.c. box, remade
1	04/06/2004	04/05/2004	CDMXB				Stetson Pl	Duxbury	MA	5543296-1				thread and cap leaking stub main to
1	05/20/2004	05/20/2004	CDSXB	346			Summer St	Duxbury	MA	5580585-1				repaired 1/2" service with 4" of 1/
2	03/09/2004	05/04/2004	RTSRB	35			Taylor St	Duxbury	MA	5519695-1				cut off and pinned leaking stub at
1	11/02/2004	11/02/2004	CDMXB				Tremont St	Duxbury	MA	5732270-1				PINNED WELDED -STUB!
1	03/02/2004	02/26/2004	LRSXB	104			Tremont St	Duxbury	MA	5514128-1				REPLACE LEAKING TEE. PLURGE IN FRON
1	02/23/2004	02/23/2004	LRMXB	113			Tremont St	Duxbury	MA	5506059-1				installed 1 4"x6" hts.
1	04/09/2004	04/09/2004	LRMXB	393			Tremont St	Duxbury	MA	5546636-1				install 4 x 6 clamp
1	09/14/2004	09/14/2004	CDSXB	620			Tremont St	Duxbury	MA	5681381-1				REPAIRED HIT 1/2" PP SERVICE
2	08/31/2004	09/11/2004	LRMXB	14			Adams Ln	East Bridgewater	MA	5669281-1		Intermedt Coated Stl	3/4 "	REPLACED LEAKING REG ON FARM TAP FO
2	08/09/2004	08/21/2004	LRMXB				Bedford St	East Bridgewater	MA	5650694-1				dug 4" valve and creased and instal
2	03/26/2004	04/05/2004	LRMXB				Elm St	East Bridgewater	MA	5534097-1				INSTALLED 6X8 HANDI BAND CLAMP
2	06/03/2004	06/29/2004	LRMXB				Elm St	East Bridgewater	MA	5593280-1				leak tested and pinpointed leak. fo
2	09/08/2004	09/14/2004	LRMXB				Matfield St	East Bridgewater	MA	5675942-1				INSTALLED TWO 4" CUP CLAMPS ON 4" M
1	09/13/2004	09/13/2004	LRSFB	470			N Central St	East Bridgewater	MA	5680308-1				REPAIRED LEAKS ON TEE INSIDE
2	06/03/2004	10/13/2004	LRSXB	176			Pine St	East Bridgewater	MA	5593320-1				REPAIR LEAK ON SERVICE (1 1/4" PLUG
1	08/17/2004	08/17/2004	LRMXB	50			Spear Ave	East Bridgewater	MA	5657183-1				LEAK TESTED & PINPOINTED LEAK FOUND
1	01/24/2004	01/24/2004	LRSXB	720			Summer St	East Bridgewater	MA	5481232-1				REPLACED .50 P.P. GOING INTO FLOW L
1	11/03/2004	11/04/2004	LRSFB	265			Union St	East Bridgewater	MA	5733658-1				INSTALLED NEW POSILOCK OLD POSILOCK
1	02/03/2004	02/02/2004	LRSXB	75			Washington St	East Bridgewater	MA	5490280-1		Intermedt Coated Stl	3/4 "	replaced regulator on tap
measures														
1	02/02/2004	02/03/2004	LRSXB	78			Washington St	East Bridgewater	MA	5488869-1		Intermedt Coated Stl	3/4 "	replaced regulator on frm tap
2	07/09/2004	07/14/2004	LRMXB				Water St	East Bridgewater	MA	5624958-1				installed one 2 x 6 hb clamp on mai
2	08/17/2004	08/17/2004	LRMXB				Water St	East Bridgewater	MA	5657292-1				installed 2 2 x 6 handi band clamps
2	11/16/2004	08/18/2004	LRMXB				Water St	East Bridgewater	MA	5746603-1				INSTALLED 3 2 X 6 HANDI BAND CLAMPS
2	11/17/2004	11/24/2004	LRMXB				Water St	East Bridgewater	MA	5747447-1				clamp on 2" main
1	06/23/2004	06/23/2004	LRMXB				Baldwin St	Easton	MA	5610529-1				installed 2 x 6 clamp (seam) main
4	07/06/2004	07/02/2004	LRMXB	28			Baldwin St	Easton	MA	5621698-1				negative results
1	08/17/2004	08/16/2004	LRMXB	50			Center St	Easton	MA	5657109-1				INSTALLED 3 2" CLAMPS ON BS MAIN
2	12/28/2004	01/03/2005	LRSXB	56			Center St	Easton	MA	5782206-1				pinned service tee and installed ne
2	04/20/2004	05/28/2004	LRMXB	125			Center St	Easton	MA	5554046-1				leak tested and pinpointed leak. fo
1	08/24/2004	08/24/2004	CDSXB	43		30	Concerto Ct	Easton	MA	5662674-1				FOUND 1/2" PP BROKEN BY EXCAVATOR.
1	08/27/2004	08/27/2004	CDSXB	3			Deer Run Rd	Easton	MA	5666960-1				CONTRACTOR CUT 1/2" PP SVC WITH POS
2	05/28/2004	06/09/2004	SRERB	131			Depot	Easton	MA	5588500-1				leak tested and pinpointed leak. fo
1	01/15/2004	01/12/2004	LRSXB	670			Depot St	Easton	MA	5472443-1				Replacekerotest C.C. with new one.
2	08/18/2004	09/13/2004	LRSXB	47			Galahad Way	Easton	MA	5657991-1		Intermedt Coated Stl	2 "	TEMP REPAIRED LEAK ON SERVICE TO HO
4	07/02/2004	06/29/2004	LRMXB				Jenny Lind@williams	Easton	MA	5619657-1				negative results
4	06/16/2004	06/15/2004	LRMXC	2			Kerrin Marie Way	Easton	MA	5604262-1				negative results
1	11/18/2004	11/18/2004	CDSXB	14		16	Littlefield Ln	Easton	MA	5749059-1				FOUND 1/2" PP BROKEN IN 1 1/4 PP S
1	11/04/2004	11/04/2004	CDMXB	100			Lothrop St	Easton	MA	5735200-1				INSTALLED 6' OF 2" PP AND TWO DRESS
1	12/07/2004	12/07/2004	CDSXB	100			Lothrup St	Easton	MA	5765152-1				REMOVED 5' SECTION OF DAMAGE 2" PP
2	10/13/2004	11/02/2004	LRMXB	24			Main St	Easton	MA	5710652-1				leak tested and pinpointed leak, fo
1	06/28/2004	06/25/2004	LRSFB	312			Main St	Easton	MA	5614833-1				REPLACE 3/4" HPC ON BY PASS LINE OF
4	08/30/2004	08/19/2004	LRMXB	134			Pine St	Easton	MA	5668284-1				negative results
2	10/12/2004	10/21/2004	LRMXB	149			Pine St	Easton	MA	5709358-1				put repair clamp on 4" bare steel m
1	02/12/2004	02/12/2004	SRERB	12			Pleasant St	Easton	MA	5498423-1				tested leak and pinpointed leak, fo
2	09/16/2004	09/25/2004	LRMXB				Rockland St	Easton	MA	5683549-1		Intermedt Coated Stl	2 "	REPAIR LEAKING VALVE
2	06/30/2004	08/03/2004	LRMXB	30			Seaver St	Easton	MA	5616912-1				FOUND LEAK ON 2" BS MAIN CLAMPED WI
1	05/18/2004	05/18/2004	CDSXB				Symphony Dr	Easton	MA	5578482-1				REPAIRED 1/2" PP SERVICE WITH 4' OF
2	10/05/2004	11/03/2004	LRMXB	40			Turnpike St	Easton	MA	5702493-1				installed one 1 1/2" handyband on 1
1	04/09/2004	04/09/2004	LRSFB	192			Turnpike St	Easton	MA	5546685-1				CUT DOWN RISER, RETHREADED, PUT BAC